



MCP9600/L00/RL00

Silicon Errata and Data Sheet Clarification

The MCP9600/L00/RL00 parts you have received conform functionally to the Device Data Sheet (DS20005426E), except for the anomalies described below.

All of the issues listed here will be addressed in future revisions of the MCP9600 silicon.

Contact Microchip for the latest silicon fix.

1. Module: T_{H_ACY} , or the T_H Hot-Junction Temperature Accuracy

The Hot-Junction (T_H) Temperature Accuracy T_{H_ACY} of the MCP9600 devices before Date Code 1723 or Device ID/Revision value of 0x4011, may not meet the specified accuracy in the data sheet, starting from revision C data sheet (DS20005426C) to the latest data sheet. This issue affects the T_H temperature register only.

The Cold-Junction (T_C) and the Junctions Delta (T_Δ) Temperature registers are not affected by this issue. These registers meet the accuracy performance as specified in the data sheet.

Work around

Convert the T_C and the T_Δ temperature data from the units of Degree Celsius ($^{\circ}\text{C}$) to millivolt (mV) using the NIST ITS-90 conversion look-up table or polynomial equation. Then sum the two voltages, and convert the summed value from millivolt to Degree Celsius using the NIST ITS-90 conversion table or polynomial equation.

Date Codes that pertain to this issue:

All production devices before Date Code 1723 and with Device ID/Revision register value of 0x4011 are affected, as shown in [Table 1](#).

Fix

Devices with Date Code of 1723 or later are not affected. These devices have a Device ID/Revision value of 0x4012.

2. Module: Intermittent I²C Read Command Clock Stretching Failure

During I²C Sequential Read communication for two or more bytes, the MCP9600/L00/RL00 may intermittently fail to Clock Stretch, t_{STRETCH} , as described in the data sheet, for bus frequencies greater than 85 kHz (typical). When this failure occurs, the MCP9600/L00/RL00 continues to output the previously transmitted data. For example, when reading the two byte T_H temperature register, if the device fails to clock stretch for the Least Significant Byte, then the device will output the Most Significant Byte.

Work around

Since this issue is intermittent, repeat the Sequential Read instruction until the second byte read is different from the Most Significant Byte.

Date Codes that pertain to this issue:

All production devices before Data Code 1845 and with Device ID/Revision register value of 0x4012 or lower are affected, as shown in [Table 1](#).

Fix

Devices with Date Code of 1845 or later are not affected. These devices have a Device ID/Revision value of 0x4013.

3. Module: Input Range bit (Bit 4 of the Status Register)

When Bit 4 of Status Register, Input Range bit, is set to '1', T_H , T_C and T_Δ registers are not updated as indicated in the Rev E data sheet bit description (DS20005426E). This characteristic may result in what appears to be unpredictable temperature data, if the temperature register is not updated when the thermocouple temperature is near the upper or the lower temperatures limits for the specified thermocouple range. For example, if the thermocouple EMF is within the specified range, but the sum with the Cold Junction EMF exceeds the specified thermocouple range, then the Input Range bit is set to '1' and the temperature registers are not updated.

Work around

None.

Date Codes that pertain to this issue:

All production devices before Date Code 1845 and with Device ID/Revision register value of 0x4012 or lower are affected, as shown in [Table 1](#).

Fix

Devices with Date Code 1845 or later are not affected. These devices have a Device ID/Revision value of 0x4013.

Devices with the Device ID/Revision value of 0x4013 update the temperature registers as follows, when the Bit 4 of the Status Register, Input Range bit, is set to '1':

- If the thermocouple EMF exceeds the specified range, then T_H and T_Δ Registers are not updated, but T_C Register is updated with a valid temperature data at the specified interval, or t_{CONV} .
- If the thermocouple EMF is within the specified range, but the sum with the Cold-Junction EMF exceeds the specified range, then T_H Register is not updated, but T_Δ and T_C Registers are updated with valid temperature data at the specified interval, or t_{CONV} . The value of T_Δ and T_C Registers can be used to calculate valid Hot-Junction temperature data using the NIST ITS-90 conversion look-up table or polynomial equation.

4. Module: Outputs Extra 0x00 data during Sequential Read

When the MCP9600/L00/RL00 Registers are Sequentially Read, the device outputs 0x00 between the Least Significant Byte of the Alert 4 Register and the Most Significant Byte of the Device ID/Revision Register values.

Work around

Ignore the byte.

Date Codes that pertain to this issue:

All production devices before Date Code 1845 and with Device ID/Revision register value of 0x4012 are affected, as shown in [Table 1](#).

Fix

Devices with Date Code 1845 or later are not affected. These devices have a Device ID/Revision value of 0x4013.

Data Sheet Clarifications

The following typographic corrections and clarifications are to be noted for the latest version of the device data sheet (DS20005426E):

The Input Range Bit of the Status Register (Bit 4) will be clarified on the next data sheet revision, as described in [Module 3](#).

TABLE 1: SILICON ISSUE SUMMARY

Module	Feature	Issue Summary	Affected Device ID/Revision ⁽¹⁾			Fixed Date Code
			0x4011	0x4012	0x4013	
1	T _{H_LAC}	This parameter may not meet data specification starting from Rev C data sheet DS20005426C (MCP9600 only)	X	—	—	1723
2	t _{STRETCH}	This parameter may not meet data specification (MCP9600/L00/RL00)	X	X	—	1845
3	Input Range	Device Characteristics changed from the data sheet description (MCP9600/L00/RL00)	X	X	—	1845
4	Extra Byte	Correction to the Device Characteristics (MCP9600/L00/RL00)	X	X	—	1845

Note 1: The Device ID/Revision Register is found in the user register pointer 0x20.

APPENDIX A: DOCUMENT REVISION HISTORY

Rev. C Document (5/2019)

- Added Errata Modules 2, 3 and 4.

Rev. B Document (9/2017)

- Added Fix regarding the devices with Date Code of 1723.
- Added [Note 1](#) to [Table 1](#).

Rev. A Document (5/2017)

- Initial release of this document.

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as “unbreakable.”

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

Microchip received ISO/TS-16949:2009 certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona; Gresham, Oregon and design centers in California and India. The Company's quality system processes and procedures are for its PIC® MCUs and dsPIC® DSCs, KEELQ® code hopping devices, Serial EEPROMs, microperipherals, nonvolatile memory and analog products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001:2000 certified.

QUALITY MANAGEMENT SYSTEM
CERTIFIED BY DNV
== ISO/TS 16949 ==

Trademarks

The Microchip name and logo, the Microchip logo, AnyRate, AVR, AVR logo, AVR Freaks, BitCloud, chipKIT, chipKIT logo, CryptoMemory, CryptoRF, dsPIC, FlashFlex, flexPWR, Helder, JukeBlox, KeeLoq, Klear, LANCheck, LINK MD, maXStylus, maXTouch, MediaLB, megaAVR, MOST, MOST logo, MPLAB, OptoLyzer, PIC, picoPower, PICSTART, PIC32 logo, Prochip Designer, QTouch, SAM-BA, SpyNIC, SST, SST Logo, SuperFlash, tinyAVR, UNI/O, and XMEGA are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

ClockWorks, The Embedded Control Solutions Company, EtherSynch, Hyper Speed Control, HyperLight Load, IntelliMOS, mTouch, Precision Edge, and Quiet-Wire are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Adjacent Key Suppression, AKS, Analog-for-the-Digital Age, Any Capacitor, AnyIn, AnyOut, BodyCom, CodeGuard, CryptoAuthentication, CryptoAutomotive, CryptoCompanion, CryptoController, dsPICDEM, dsPICDEM.net, Dynamic Average Matching, DAM, ECAN, EtherGREEN, In-Circuit Serial Programming, ICSP, INICnet, Inter-Chip Connectivity, JitterBlocker, KlearNet, KlearNet logo, memBrain, Mindi, MiWi, motorBench, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach, Omniscient Code Generation, PICDEM, PICDEM.net, PICKit, PICtail, PowerSmart, PureSilicon, QMatrix, REAL ICE, Ripple Blocker, SAM-ICE, Serial Quad I/O, SMART-I.S., SQI, SuperSwitcher, SuperSwitcher II, Total Endurance, TSHARC, USBCheck, VariSense, ViewSpan, WiperLock, Wireless DNA, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

Silicon Storage Technology is a registered trademark of Microchip Technology Inc. in other countries.

GestIC is a registered trademark of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2019, Microchip Technology Incorporated, All Rights Reserved.
ISBN: 978-1-5224-4519-7

Worldwide Sales and Service

AMERICAS

Corporate Office
2355 West Chandler Blvd.
Chandler, AZ 85224-6199
Tel: 480-792-7200
Fax: 480-792-7277
Technical Support:
<http://www.microchip.com/support>
Web Address:
www.microchip.com

Atlanta
Duluth, GA
Tel: 678-957-9614
Fax: 678-957-1455

Austin, TX
Tel: 512-257-3370

Boston
Westborough, MA
Tel: 774-760-0087
Fax: 774-760-0088

Chicago
Itasca, IL
Tel: 630-285-0071
Fax: 630-285-0075

Dallas
Addison, TX
Tel: 972-818-7423
Fax: 972-818-2924

Detroit
Novi, MI
Tel: 248-848-4000

Houston, TX
Tel: 281-894-5983

Indianapolis
Noblesville, IN
Tel: 317-773-8323
Fax: 317-773-5453
Tel: 317-536-2380

Los Angeles
Mission Viejo, CA
Tel: 949-462-9523
Fax: 949-462-9608
Tel: 951-273-7800

Raleigh, NC
Tel: 919-844-7510

New York, NY
Tel: 631-435-6000

San Jose, CA
Tel: 408-735-9110
Tel: 408-436-4270

Canada - Toronto
Tel: 905-695-1980
Fax: 905-695-2078

ASIA/PACIFIC

Australia - Sydney
Tel: 61-2-9868-6733

China - Beijing
Tel: 86-10-8569-7000

China - Chengdu
Tel: 86-28-8665-5511

China - Chongqing
Tel: 86-23-8980-9588

China - Dongguan
Tel: 86-769-8702-9880

China - Guangzhou
Tel: 86-20-8755-8029

China - Hangzhou
Tel: 86-571-8792-8115

China - Hong Kong SAR
Tel: 852-2943-5100

China - Nanjing
Tel: 86-25-8473-2460

China - Qingdao
Tel: 86-532-8502-7355

China - Shanghai
Tel: 86-21-3326-8000

China - Shenyang
Tel: 86-24-2334-2829

China - Shenzhen
Tel: 86-755-8864-2200

China - Suzhou
Tel: 86-186-6233-1526

China - Wuhan
Tel: 86-27-5980-5300

China - Xian
Tel: 86-29-8833-7252

China - Xiamen
Tel: 86-592-2388138

China - Zhuhai
Tel: 86-756-3210040

ASIA/PACIFIC

India - Bangalore
Tel: 91-80-3090-4444

India - New Delhi
Tel: 91-11-4160-8631

India - Pune
Tel: 91-20-4121-0141

Japan - Osaka
Tel: 81-6-6152-7160

Japan - Tokyo
Tel: 81-3-6880-3770

Korea - Daegu
Tel: 82-53-744-4301

Korea - Seoul
Tel: 82-2-554-7200

Malaysia - Kuala Lumpur
Tel: 60-3-7651-7906

Malaysia - Penang
Tel: 60-4-227-8870

Philippines - Manila
Tel: 63-2-634-9065

Singapore
Tel: 65-6334-8870

Taiwan - Hsin Chu
Tel: 886-3-577-8366

Taiwan - Kaohsiung
Tel: 886-7-213-7830

Taiwan - Taipei
Tel: 886-2-2508-8600

Thailand - Bangkok
Tel: 66-2-694-1351

Vietnam - Ho Chi Minh
Tel: 84-28-5448-2100

EUROPE

Austria - Wels
Tel: 43-7242-2244-39
Fax: 43-7242-2244-393

Denmark - Copenhagen
Tel: 45-4450-2828
Fax: 45-4485-2829

Finland - Espoo
Tel: 358-9-4520-820

France - Paris
Tel: 33-1-69-53-63-20
Fax: 33-1-69-30-90-79

Germany - Garching
Tel: 49-8931-9700

Germany - Haan
Tel: 49-2129-3766400

Germany - Heilbronn
Tel: 49-7131-72400

Germany - Karlsruhe
Tel: 49-721-625370

Germany - Munich
Tel: 49-89-627-144-0
Fax: 49-89-627-144-44

Germany - Rosenheim
Tel: 49-8031-354-560

Israel - Ra'anana
Tel: 972-9-744-7705

Italy - Milan
Tel: 39-0331-742611
Fax: 39-0331-466781

Italy - Padova
Tel: 39-049-7625286

Netherlands - Drunen
Tel: 31-416-690399
Fax: 31-416-690340

Norway - Trondheim
Tel: 47-7288-4388

Poland - Warsaw
Tel: 48-22-3325737

Romania - Bucharest
Tel: 40-21-407-87-50

Spain - Madrid
Tel: 34-91-708-08-90
Fax: 34-91-708-08-91

Sweden - Gothenberg
Tel: 46-31-704-60-40

Sweden - Stockholm
Tel: 46-8-5090-4654

UK - Wokingham
Tel: 44-118-921-5800
Fax: 44-118-921-5820