

**MICROCHIP****PIC18F24J10/25J10/44J10/45J10****PIC18F24J10/25J10/44J10/45J10 Rev. A2 Silicon Errata**

The PIC18F24J10/25J10/44J10/45J10 Rev. A2 parts you have received conform functionally to the Device Data Sheet (DS39682A), except for the anomalies described below. Any Data Sheet Clarification issues related to the PIC18F24J10/25J10/44J10/45J10 will be reported in a separate Data Sheet errata. Please check the Microchip web site for any existing issues.

The following silicon errata apply only to PIC18F24J10/25J10/44J10/45J10 devices with these Device/Revision IDs:

Part Number	Device ID	Revision ID
PIC18F24J10	0001 1101 000	0001
PIC18LF24J10	0001 1101 010	0001
PIC18F25J10	0001 1100 000	0001
PIC18LF25J10	0001 1100 010	0001
PIC18F44J10	0001 1101 001	0001
PIC18LF44J10	0001 1101 011	0001
PIC18F45J10	0001 1100 001	0001
PIC18LF45J10	0001 1100 011	0001

The Device IDs (DEVID1 and DEVID2) are located at addresses 3FFFFEh:3FFFFFh in the device's configuration space. They are shown in hexadecimal in the format "DEVID2 DEVID1".

1. Module: Timer1

In 16-Bit Asynchronous Counter mode or 16-Bit Asynchronous Oscillator mode, the TMR1H buffer does not update when TMR1L is read. This issue only affects reading the TMR1H registers. The timers increment and set the interrupt flags as expected. The Timer registers can also be written as expected.

Work around

Use 8-bit mode by clearing the RD16 (T1CON<7>) bit or use the synchronization option by clearing T1SYNC (T1CON<2>).

2. Module: EUSART

In asynchronous duplex communication, the reception can get corrupted if any bit of the TXSTA register is modified during a reception.

Work around

The CSRC (TXSTA<7>) bit should not be set. Though this is a "don't care" bit in Asynchronous mode, make sure that this bit is not set.

3. Module: EUSART

In Synchronous mode, EUSART baud rates using SPBRG values of '0' and '1' may not function correctly.

Work around

Use another baud rate configuration to generate the desired baud rate.

4. Module: EUSART

After the last received byte has been read from the EUSART receive buffer, RCREG, the value is no longer valid for subsequent read operations. The RCREG register should only be read once for each byte received.

Work around

After each byte is received from the EUSART, store the byte into a user variable. To determine when a byte is available to read from RCREG, poll the RCIDL (BAUDCON<6>) bit for a low-to-high transition, or use the EUSART Receive Interrupt Flag, RCIF (PIR1<5>).

5. Module: EUSART

In 9-Bit Asynchronous, Full-Duplex, Receive mode, received data may be corrupted if the TX9D bit (TXSTA<0>) is not modified immediately after RCIDL (BAUDCON<6>) is set.

Work around

Only write to TX9D when a reception is not in progress (RCIDL = 1). No interrupt is associated with RCIDL, therefore, it must be polled in software to determine when TX9D can be updated.

PIC18F24J10/25J10/44J10/45J10

6. Module: MSSP

In SPI mode, the Buffer Full flag bit, BF (SSPxSTAT<0>), the Write Collision Detect bit, WCOL (SSPxCON1<7>), and the Receive Overflow Indicator bit, SSPOV (SSPxCON1<6>), are not reset upon disabling the SPI module (by clearing the SSPEN bit in the SSPxCON1 register).

For example, if SSPxBUF is full (BF bit is set) and the MSSP module is disabled and re-enabled, the BF bit will remain set. In SPI Slave mode, a subsequent write to SSPxBUF will result in a write collision. Also, if a new byte is received, a receive overflow will occur.

Work around

Ensure that if the buffer is full, SSPxBUF is read (thus clearing the BF flag) and WCOL is clear before disabling the MSSP module. If the module is configured in SPI Slave mode, ensure that the SSPOV bit is clear before disabling the module.

7. Module: MSSP (I²C™ Mode)

It has been observed that following a Power-on Reset, I²C mode may not initialize properly by just configuring the SCLx and SDAx pins as either inputs or outputs. This has only been seen in a few unique system environments.

A test of a statistically significant sample of pre-production systems, across the voltage and current range of the application's power supply, should indicate if a system is susceptible to this issue.

Work around

Before configuring the module for I²C operation:

1. Configure the SCLx and SDAx pins as outputs by clearing their corresponding TRIS bits.
2. Force SCLx and SDAx low by clearing the corresponding LAT bits.
3. While keeping the LAT bits clear, configure SCLx and SDAx as inputs by setting their TRIS bits.

Once this is done, use the SSPxCON1 and SSPxCON2 registers to configure the proper I²C mode as before .

8. Module: Core (Program Memory Space)

Writes to program memory address 300000h, that are not blocked, can cause the program memory at different locations to be corrupted.

Work around

Do not write to address 300000h. If you wish to modify the contents of the Configuration registers, then modify the Configuration Words located at the end of the user memory (7FF4h for PIC18FX5J10 devices and 3FF4h for PIC18FX4J10 devices) and issue a Reset command. This will reload the Configuration registers with the new configuration setting.

9. Module: EUSART

In rare situations, one or more extra zero bytes have been observed in a packet transmitted by the module operating in Asynchronous mode. The actual data is not lost or corrupted; only unwanted (extra) zero bytes are observed in the packet.

This situation has only been observed when the contents of the transmit buffer, TXREG, are transferred to the TSR during the transmission of a Stop bit. For this to occur, three things must happen in the same instruction cycle:

- TXREG is written to;
- the baud rate counter overflows (at the end of the bit period); and
- a Stop bit is being transmitted (shifted out of TSR).

Work around

If possible, do not use the module's double-buffer capability. Instead, load the TXREG register when the TRMT bit (TXSTA<1>) is set, indicating the TSR is empty.

If double-buffering is used and back-to-back transmission is performed, then load TXREG immediately after TXIF is set or wait 1-bit time after TXIF is set. Both solutions prevent writing TXREG while a Stop bit is transmitted. Note that TXIF is set at the beginning of the Stop bit transmission.

If transmission is intermittent, then do the following:

- Wait for the TRMT bit to be set before loading TXREG.
- Alternatively, use a free timer resource to time the baud period. Set up the timer to overflow at the end of the Stop bit, then start the timer when you load the TXREG. Do not load the TXREG when timer is about to overflow.

Date Codes that pertain to this issue:

All engineering and production devices.

10. Module: ECCP (Enhanced PWM)

When switching direction in Full-Bridge PWM mode, the modulated outputs will switch immediately instead of waiting for the next PWM cycle. This may generate unexpected short pulses on the modulated outputs.

Work around

Disable the PWM or set the duty cycle to zero prior to switching directions.

Date Codes that pertain to this issue:

All engineering and production devices.

PIC18F24J10/25J10/44J10/45J10

REVISION HISTORY

Rev A Document (4/2006)

First revision of this document. Includes silicon issues 1 (Timer1), 2-5 (EUSART), 6 (MSSP), 7 (MSSP – I²C Mode), 8 (Core – Program Memory Space) and 9 (EUSART).

Rev B Document (5/2006)

Updated silicon issue 9 (EUSART).

Rev C Document (10/2006)

Added silicon issue 10 (ECCP – Enhanced PWM).

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as "unbreakable."

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights.

Trademarks

The Microchip name and logo, the Microchip logo, Accuron, dsPIC, KEELoQ, microID, MPLAB, PIC, PICmicro, PICSTART, PRO MATE, PowerSmart, rfPIC, and SmartShunt are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

AmpLab, FilterLab, Migratable Memory, MXDEV, MXLAB, SEEVAL, SmartSensor and The Embedded Control Solutions Company are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Analog-for-the-Digital Age, Application Maestro, CodeGuard, dsPICDEM, dsPICDEM.net, dsPICworks, ECAN, ECONOMONITOR, FanSense, FlexROM, fuzzyLAB, In-Circuit Serial Programming, ICSP, ICEPIC, Linear Active Thermistor, Mindi, MiWi, MPASM, MPLIB, MPLINK, PICkit, PICDEM, PICDEM.net, PICLAB, PICtail, PowerCal, PowerInfo, PowerMate, PowerTool, REAL ICE, rfLAB, rfPICDEM, Select Mode, Smart Serial, SmartTel, Total Endurance, UNI/O, WiperLock and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

All other trademarks mentioned herein are property of their respective companies.

© 2006, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.

 Printed on recycled paper.

QUALITY MANAGEMENT SYSTEM
CERTIFIED BY DNV
== ISO/TS 16949:2002 ==

Microchip received ISO/TS-16949:2002 certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona, Gresham, Oregon and Mountain View, California. The Company's quality system processes and procedures are for its PIC® 8-bit MCUs, KEELoQ® code hopping devices, Serial EEPROMs, microperipherals, nonvolatile memory and analog products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001:2000 certified.



WORLDWIDE SALES AND SERVICE

AMERICAS

Corporate Office
2355 West Chandler Blvd.
Chandler, AZ 85224-6199
Tel: 480-792-7200
Fax: 480-792-7277
Technical Support:
<http://support.microchip.com>
Web Address:
www.microchip.com

Atlanta

Alpharetta, GA
Tel: 770-640-0034
Fax: 770-640-0307

Boston

Westborough, MA
Tel: 774-760-0087
Fax: 774-760-0088

Chicago

Itasca, IL
Tel: 630-285-0071
Fax: 630-285-0075

Dallas

Addison, TX
Tel: 972-818-7423
Fax: 972-818-2924

Detroit

Farmington Hills, MI
Tel: 248-538-2250
Fax: 248-538-2260

Kokomo

Kokomo, IN
Tel: 765-864-8360
Fax: 765-864-8387

Los Angeles

Mission Viejo, CA
Tel: 949-462-9523
Fax: 949-462-9608

Santa Clara

Santa Clara, CA
Tel: 408-961-6444
Fax: 408-961-6445

Toronto

Mississauga, Ontario,
Canada
Tel: 905-673-0699
Fax: 905-673-6509

ASIA/PACIFIC

Asia Pacific Office
Suites 3707-14, 37th Floor
Tower 6, The Gateway
Harbour City, Kowloon
Hong Kong
Tel: 852-2401-1200
Fax: 852-2401-3431

Australia - Sydney
Tel: 61-2-9868-6733
Fax: 61-2-9868-6755

China - Beijing
Tel: 86-10-8528-2100
Fax: 86-10-8528-2104

China - Chengdu
Tel: 86-28-8665-5511
Fax: 86-28-8665-7889

China - Fuzhou
Tel: 86-591-8750-3506
Fax: 86-591-8750-3521

China - Hong Kong SAR
Tel: 852-2401-1200
Fax: 852-2401-3431

China - Qingdao
Tel: 86-532-8502-7355
Fax: 86-532-8502-7205

China - Shanghai
Tel: 86-21-5407-5533
Fax: 86-21-5407-5066

China - Shenyang
Tel: 86-24-2334-2829
Fax: 86-24-2334-2393

China - Shenzhen
Tel: 86-755-8203-2660
Fax: 86-755-8203-1760

China - Shunde
Tel: 86-757-2839-5507
Fax: 86-757-2839-5571

China - Wuhan
Tel: 86-27-5980-5300
Fax: 86-27-5980-5118

China - Xian
Tel: 86-29-8833-7250
Fax: 86-29-8833-7256

ASIA/PACIFIC

India - Bangalore
Tel: 91-80-4182-8400
Fax: 91-80-4182-8422

India - New Delhi
Tel: 91-11-4160-8631
Fax: 91-11-4160-8632

India - Pune
Tel: 91-20-2566-1512
Fax: 91-20-2566-1513

Japan - Yokohama
Tel: 81-45-471-6166
Fax: 81-45-471-6122

Korea - Gumi
Tel: 82-54-473-4301
Fax: 82-54-473-4302

Korea - Seoul
Tel: 82-2-554-7200
Fax: 82-2-558-5932 or
82-2-558-5934

Malaysia - Penang
Tel: 60-4-646-8870
Fax: 60-4-646-5086

Philippines - Manila
Tel: 63-2-634-9065
Fax: 63-2-634-9069

Singapore
Tel: 65-6334-8870
Fax: 65-6334-8850

Taiwan - Hsin Chu
Tel: 886-3-572-9526
Fax: 886-3-572-6459

Taiwan - Kaohsiung
Tel: 886-7-536-4818
Fax: 886-7-536-4803

Taiwan - Taipei
Tel: 886-2-2500-6610
Fax: 886-2-2508-0102

Thailand - Bangkok
Tel: 66-2-694-1351
Fax: 66-2-694-1350

EUROPE

Austria - Wels
Tel: 43-7242-2244-39
Fax: 43-7242-2244-393

Denmark - Copenhagen
Tel: 45-4450-2828
Fax: 45-4485-2829

France - Paris
Tel: 33-1-69-53-63-20
Fax: 33-1-69-30-90-79

Germany - Munich
Tel: 49-89-627-144-0
Fax: 49-89-627-144-44

Italy - Milan
Tel: 39-0331-742611
Fax: 39-0331-466781

Netherlands - Drunen
Tel: 31-416-690399
Fax: 31-416-690340

Spain - Madrid
Tel: 34-91-708-08-90
Fax: 34-91-708-08-91

UK - Wokingham
Tel: 44-118-921-5869
Fax: 44-118-921-5820