

PIC18F1220/1320 Rev. B1 Silicon/Data Sheet Errata

The PIC18F1220/1320 Rev. B1 parts you have received conform functionally to the Device Data Sheet (DS39605C), except for the anomalies described below.

All of the issues listed here will be addressed in future revisions of the PIC18F1220/1320 silicon.

The following silicon errata apply only to PIC18F1220/1320 devices with these Device/Revision IDs:

Part Number	Device ID	Revision ID
PIC18F1220	00 0111 111	00010
PIC18F1320	00 0111 110	00010

The Device IDs (DEVID1 and DEVID2) are located at addresses 3FFFFEh:3FFFFFh in the device's configuration space. They are shown in hexadecimal in the format "DEVID2 DEVID1".

1. Module: Core

Certain combinations of code sequence, code placement, VDD, FOSC and temperature may cause the corruption of fetched instructions. A corrupted instruction fetch will cause the part to execute an incorrect instruction with unpredictable results.

Microchip cannot predict which combinations of these conditions will cause this failure.

If this failure mechanism exists in your system, it should become evident during statistically significant preproduction testing using your particular code sequence and placement (the minimum suggested sample size is 100 units). Preproduction testing should exercise all the functions of your application across system variables. Any changes to code should be tested in the same manner prior to being implemented.

This issue has not been observed for FOSC up to 4 MHz with VDD up to 5.25V. If failures occur while meeting both of these conditions, then the failures are likely not related to this failure mechanism.

Work around

Use the part at or below 4 MHz with VDD at or below 5.25V.

Change the placement of code within program memory.

Use the next revision of silicon when it becomes available.

Date Codes that pertain to this issue:

All engineering and production devices.

2. Module: Data EEPROM

When reading the data EEPROM, the contents of the EEDATA register may be corrupted if the RD bit (EECON1<0>) is set immediately following a write to the address byte (EEADR). The actual contents of the data EEPROM remain unaffected.

Work around

Do not set EEADR immediately before the execution of a read. Write to EEADR at least one instruction cycle before setting the RD bit. The instruction between the write to EEADR and the read can be any valid instruction, including a NOP.

Date Codes that pertain to this issue:

All engineering and production devices.

3. Module: Core (DAW Instruction)

The DAW instruction may improperly clear the Carry bit (STATUS<0>) when executed.

Work around

Test the Carry bit state before executing the DAW instruction. If the Carry bit is set, increment the next higher byte to be added, using an instruction such as INCFSZ (this instruction does not affect any Status flags and will not overflow a BCD nibble). After the DAW instruction has been executed, process the Carry bit normally (see Example 1).

EXAMPLE 1: PROCESSING THE CARRY BIT DURING BCD ADDITIONS

```

MOVLW 0x80      ; .80 (BCD)
ADDLW 0x80      ; .80 (BCD)

BTFSC STATUS, C ; test C
INCFSZ byte2    ; inc next higher LSB
DAW

BTFSC STATUS, C ; test C
INCFSZ byte2    ; inc next higher LSB

This is repeated for each DAW instruction.

```

Date Codes that pertain to this issue:

All engineering and production devices.

4. Module: INTOSC

Incrementing or decrementing the value in the OSCTUNE register may not have the expected effect of shifting the INTRC or INTOSC output frequencies. The OSCTUNE values for which this happens may vary with temperatures above 70°C.

Work around

None

Date Codes that pertain to this issue:

All engineering and production devices.

5. Module: Internal Oscillator Block

At high temperature (above 85°C) or low VDD (below 2.5V), the IOFS bit (OSCCON<2>) may not become set when the internal oscillator block is selected as the system clock source for any frequency above 31 kHz (OSCCON<6:4> ≠ 000). The INTOSC output will stabilize at 8 MHz; however, the IOFS bit may not become set.

Work around

If time critical code is to be executed, it should be delayed by 1 ms following the operation that enables the 8 MHz INTOSC output from the internal oscillator block.

Date Codes that pertain to this issue:

All engineering and production devices.

6. Module: Internal Oscillator Block

If the INTRC clock source was not started at POR (any VDD) and VDD is greater than 4.5V, the INTRC clock source may not start or may require a long delay when starting. The INTRC may not restart when VDD is lowered below 4.5V.

Features that depend on the operation of the INTRC clock source may be affected. These include the INTOSC output when exiting from Sleep mode, the Watchdog Timer (WDT) if enabled by firmware using the WDTCON register, Two-Speed Start-ups during Reset or wake-up from Sleep and the Fail-Safe Clock Monitor (FSCM) when exiting Sleep mode.

The INTOSC frequency may rise very high (for example, 9.5 MHz). The WDT and the FSCM may simply not function. Two-Speed Start-ups may not occur but execution will start once the primary clock source becomes ready.

Work around

Several work arounds may be used.

1. Enable the WDT in Configuration register, CONFIG2H, and place a CLRWDT instruction somewhere in the main loop.
2. Configure the internal oscillator block as the primary clock source using Configuration Register 1H.
3. Any technique that starts the INTRC at Reset and does not disable it may be used.
4. Ensure that VDD is below 4.5V when starting the INTRC clock source.

There may be other work arounds.

Date Codes that pertain to this issue:

All engineering and production devices.

7. Module: EUSART

The CREN bit may be cleared when the EUSART completes an auto-baud measurement.

Work around

When the auto-baud measurement is complete, the CREN bit must be set by firmware.

Date Codes that pertain to this issue:

All engineering and production devices.

8. Module: EUSART

If the TXEN bit is set when an auto-baud measurement is completed, the EUSART may transmit an arbitrary byte.

Work around

Clear the TXEN bit before performing the auto-baud measurement. When the measurement is complete, set the TXEN bit.

Date Codes that pertain to this issue:

All engineering and production devices.

9. Module: EUSART

The auto-baud measurement may not determine the correct baud rate if the ABDEN bit is set while the RB4/RX pin is low.

Work around

If the wake-up function is being used (WUE is set), wait for the RB4/RX pin to go high following a Break signal before setting the ABDEN bit.

If the wake-up function is not being used, ensure that RB4/RX is Idle (high between bytes) before setting the ABDEN bit.

Date Codes that pertain to this issue:

All engineering and production devices.

10. Module: Data EEPROM

When writing to the data EEPROM, the contents of the data EEPROM memory may not be written as expected.

Work around

Either of two work arounds can be used:

1. Before beginning any writes to the data EEPROM, enable the LVD (any voltage) and wait for the internal voltage reference to become stable. LVD interrupt requests may be ignored. Once the LVD voltage reference is stable, perform all EEPROM writes normally. When writes have been completed, the LVD may be disabled.
2. Configure the BOR as enabled (any voltage). Select a threshold below VDD to allow normal operation. If VDD is below the BOR threshold, the device will be held in Brown-out Reset.

Date Codes that pertain to this issue:

All engineering and production devices.

11. Module: Reset

It has been observed that in certain Reset conditions, including power-up, the first GOTO instruction at address 0x0000 may not be executed. This occurrence is rare and affects very few applications.

To determine if your system is affected, test a statistically significant number of applications across the operating temperature, voltage and frequency ranges of the application. Affected systems will repeatably fail normal testing. Systems not affected will continue to not be affected over time.

Work around

Insert a NOP instruction at address 0x0000.

Date Codes that pertain to this issue:

All engineering and production devices.

PIC18F1220/1320

Clarifications/Corrections to the Data Sheet

In the Device Data Sheet (DS39605C), the following clarifications and corrections should be noted.

1. Module: CCP

In **Section 14.0 “Timer3 Module”**, bit 6 of the T3CON register was incorrectly defined as “unimplemented”. The correct definition for T3CON<6> is T3CCP2 and is shown in **bold** below:

REGISTER 14-1: T3CON: TIMER3 CONTROL REGISTER

R/W-0	R/W-0	R/W-0	R/W-0	R/W-0	R/W-0	R/W-0	R/W-0
RD16	T3CCP2	T3CKPS1	T3CKPS0	T3CCP1	$\overline{\text{T3SYNC}}$	TMR3CS	TMR3ON
bit 7		bit 0					

bit 6, 3 **T3CCP2:T3CCP1:** Timer3 and Timer1 to CCP Enable bits
1x = Timer3 is the clock source for compare/capture CCP module
01 = **Reserved**
00 = Timer1 is the clock source for compare/capture CCP module

2. Module: Data EEPROM Memory

In Table 22-1 on page 254 of the Device Data Sheet, the typical value for parameter D122, Data EEPROM Erase/Write Cycle Time (TDEW) has changed. The new value is 5.5 ms and is shown in **bold** below.

TABLE 22-1: MEMORY PROGRAMMING REQUIREMENTS

DC CHARACTERISTICS			Standard Operating Conditions (unless otherwise stated) Operating temperature $-40^{\circ}\text{C} \leq T_A \leq +85^{\circ}\text{C}$ for industrial				
Param No.	Sym	Characteristic	Min	Typ†	Max	Units	Conditions
D122	TDEW	Erase/Write Cycle Time	—	5.5	—	ms	

REVISION HISTORY

Rev A Document (06/2003)

First revision of this document, silicon issues 1 (Data EEPROM), 2 (Data EEPROM), 3 (Core), 4 (INTOSC), 5 (Internal Oscillator Block), 6 (Internal Oscillator Block), 7 (Electrical Specifications), 8 (EAUSART), 9 (EAUSART) and 10 (EAUSART) and Data Sheet Clarification issues 1 (Internal RC Accuracy) and 2 (DC Characteristics Table).

Rev B Document (10/2003)

Added silicon issue 1 (Core).

Rev C Document (12/2003)

Removed silicon issue 2 (Data EEPROM). Changed silicon issue 8, 9 and 10 (was issue 9, 10 and 11) from EAUSART to USART. Added silicon issue 11 (Data EEPROM).

Rev D Document (05/2005)

Removed silicon issue 7 (Electrical Specifications), added silicon issue 11 (Reset), changed previous label of USART to EUSART in silicon issues 7, 8 and 9 (to be consistent with the data sheet) and added Data Sheet Clarification issue 1 (CCP).

Rev E Document (08/2005)

Added Data Sheet Clarification issue 2 (Data EEPROM Memory).

Rev F Document (03/2006)

Corrected part number revision IDs in the table on page one.

PIC18F1220/1320

NOTES:

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as "unbreakable."

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights.

Trademarks

The Microchip name and logo, the Microchip logo, Accuron, dsPIC, KEELoQ, microID, MPLAB, PIC, PICmicro, PICSTART, PRO MATE, PowerSmart, rfPIC, and SmartShunt are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

AmpLab, FilterLab, Migratable Memory, MXDEV, MXLAB, SEEVAL, SmartSensor and The Embedded Control Solutions Company are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Analog-for-the-Digital Age, Application Maestro, dsPICDEM, dsPICDEM.net, dsPICworks, ECAN, ECONOMONITOR, FanSense, FlexROM, fuzzyLAB, In-Circuit Serial Programming, ICSP, ICEPIC, Linear Active Thermistor, MPASM, MPLIB, MPLINK, MPSIM, PICkit, PICDEM, PICDEM.net, PICLAB, PICtail, PowerCal, PowerInfo, PowerMate, PowerTool, REAL ICE, rLAB, rfPICDEM, Select Mode, Smart Serial, SmartTel, Total Endurance, UNI/O, WiperLock and Zena are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

All other trademarks mentioned herein are property of their respective companies.

© 2006, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.

 Printed on recycled paper.

QUALITY MANAGEMENT SYSTEM
CERTIFIED BY DNV
== ISO/TS 16949:2002 ==

Microchip received ISO/TS-16949:2002 quality system certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona and Mountain View, California in October 2003. The Company's quality system processes and procedures are for its PICmicro® 8-bit MCUs, KEELoQ® code hopping devices, Serial EEPROMs, microperipherals, nonvolatile memory and analog products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001:2000 certified.



WORLDWIDE SALES AND SERVICE

AMERICAS

Corporate Office
2355 West Chandler Blvd.
Chandler, AZ 85224-6199
Tel: 480-792-7200
Fax: 480-792-7277
Technical Support:
<http://support.microchip.com>
Web Address:
www.microchip.com

Atlanta

Alpharetta, GA
Tel: 770-640-0034
Fax: 770-640-0307

Boston

Westborough, MA
Tel: 774-760-0087
Fax: 774-760-0088

Chicago

Itasca, IL
Tel: 630-285-0071
Fax: 630-285-0075

Dallas

Addison, TX
Tel: 972-818-7423
Fax: 972-818-2924

Detroit

Farmington Hills, MI
Tel: 248-538-2250
Fax: 248-538-2260

Kokomo

Kokomo, IN
Tel: 765-864-8360
Fax: 765-864-8387

Los Angeles

Mission Viejo, CA
Tel: 949-462-9523
Fax: 949-462-9608

San Jose

Mountain View, CA
Tel: 650-215-1444
Fax: 650-961-0286

Toronto

Mississauga, Ontario,
Canada
Tel: 905-673-0699
Fax: 905-673-6509

ASIA/PACIFIC

Australia - Sydney
Tel: 61-2-9868-6733
Fax: 61-2-9868-6755

China - Beijing
Tel: 86-10-8528-2100
Fax: 86-10-8528-2104

China - Chengdu
Tel: 86-28-8676-6200
Fax: 86-28-8676-6599

China - Fuzhou
Tel: 86-591-8750-3506
Fax: 86-591-8750-3521

China - Hong Kong SAR

Tel: 852-2401-1200
Fax: 852-2401-3431

China - Qingdao
Tel: 86-532-8502-7355
Fax: 86-532-8502-7205

China - Shanghai
Tel: 86-21-5407-5533
Fax: 86-21-5407-5066

China - Shenyang
Tel: 86-24-2334-2829
Fax: 86-24-2334-2393

China - Shenzhen
Tel: 86-755-8203-2660
Fax: 86-755-8203-1760

China - Shunde
Tel: 86-757-2839-5507
Fax: 86-757-2839-5571

China - Wuhan
Tel: 86-27-5980-5300
Fax: 86-27-5980-5118

China - Xian
Tel: 86-29-8833-7250
Fax: 86-29-8833-7256

ASIA/PACIFIC

India - Bangalore
Tel: 91-80-4182-8400
Fax: 91-80-4182-8422

India - New Delhi
Tel: 91-11-5160-8631
Fax: 91-11-5160-8632

India - Pune
Tel: 91-20-2566-1512
Fax: 91-20-2566-1513

Japan - Yokohama
Tel: 81-45-471- 6166
Fax: 81-45-471-6122

Korea - Gumi
Tel: 82-54-473-4301
Fax: 82-54-473-4302

Korea - Seoul
Tel: 82-2-554-7200
Fax: 82-2-558-5932 or
82-2-558-5934

Malaysia - Penang
Tel: 60-4-646-8870
Fax: 60-4-646-5086

Philippines - Manila
Tel: 63-2-634-9065
Fax: 63-2-634-9069

Singapore
Tel: 65-6334-8870
Fax: 65-6334-8850

Taiwan - Hsin Chu
Tel: 886-3-572-9526
Fax: 886-3-572-6459

Taiwan - Kaohsiung
Tel: 886-7-536-4818
Fax: 886-7-536-4803

Taiwan - Taipei
Tel: 886-2-2500-6610
Fax: 886-2-2508-0102

Thailand - Bangkok
Tel: 66-2-694-1351
Fax: 66-2-694-1350

EUROPE

Austria - Wels
Tel: 43-7242-2244-399
Fax: 43-7242-2244-393

Denmark - Copenhagen
Tel: 45-4450-2828
Fax: 45-4485-2829

France - Paris
Tel: 33-1-69-53-63-20
Fax: 33-1-69-30-90-79

Germany - Munich
Tel: 49-89-627-144-0
Fax: 49-89-627-144-44

Italy - Milan
Tel: 39-0331-742611
Fax: 39-0331-466781

Netherlands - Drunen
Tel: 31-416-690399
Fax: 31-416-690340

Spain - Madrid
Tel: 34-91-708-08-90
Fax: 34-91-708-08-91

UK - Wokingham
Tel: 44-118-921-5869
Fax: 44-118-921-5820