

SCH3227/SCH3226/SCH3224/SCH3222

Silicon Errata and Data Sheet Clarifications

TABLE 1: SILICON DEV/REV VALUES

Part Number	STRAPOPT ⁽³⁾	Device ID ⁽¹⁾	Revision ID for Silicon Revision ⁽²⁾
			A
SCH3222	--	7Fh	02h
SCH3224	--	7Fh	02h
SCH3226	0 (low)	7Dh	02h
SCH3226	1 (high)	7Fh	02h
SCH3227	0 (low)	7Dh	02h
SCH3227	1 (high)	7Fh	02h

Note 1: The Device ID is visible as an 8-bit number at Plug and Play Configuration Index 20h.

2: The HW Revision Number is visible as an 8-bit number at Plug and Play Configuration Index 21h and Version/Stepping Number Register 3Fh.

3: STRAPOPT is a pin that is present on the SCH3226 and SCH3227 devices only. It affects the pinout and also the Device ID code, as shown above.

TABLE 2: SILICON ISSUE SUMMARY

Module	Feature	Item Number	Issue Summary	Affected Revisions ⁽¹⁾
				A
Serial Port	Reset	1.	Resetting UART 3 and UART 4 with PCI_RST	X

Note 1: If there are multiple revision-letter columns under this one, only those issues indicated in the last column apply to the current silicon revision.

SCH322x

Silicon Errata Issues

1. Module: Serial Port

UART 3 and UART 4 do not tri-state their outputs on a PCI_RESET as do UART 1 and UART 2.


UART 3 and UART 4 outputs are not controlled by the Configuration Register 0x30 ACTIVATE bit.

END USER IMPLICATIONS

UART 3 and UART 4 outputs will drive High when PCI_RESET goes active or when the ACTIVATE bit is cleared, and if the platform uses RTS to control an RS485 transceiver this may interrupt communication.

Work Around

Use GPIO pin to disable RS485 transceiver when ACTIVATE bit is cleared.

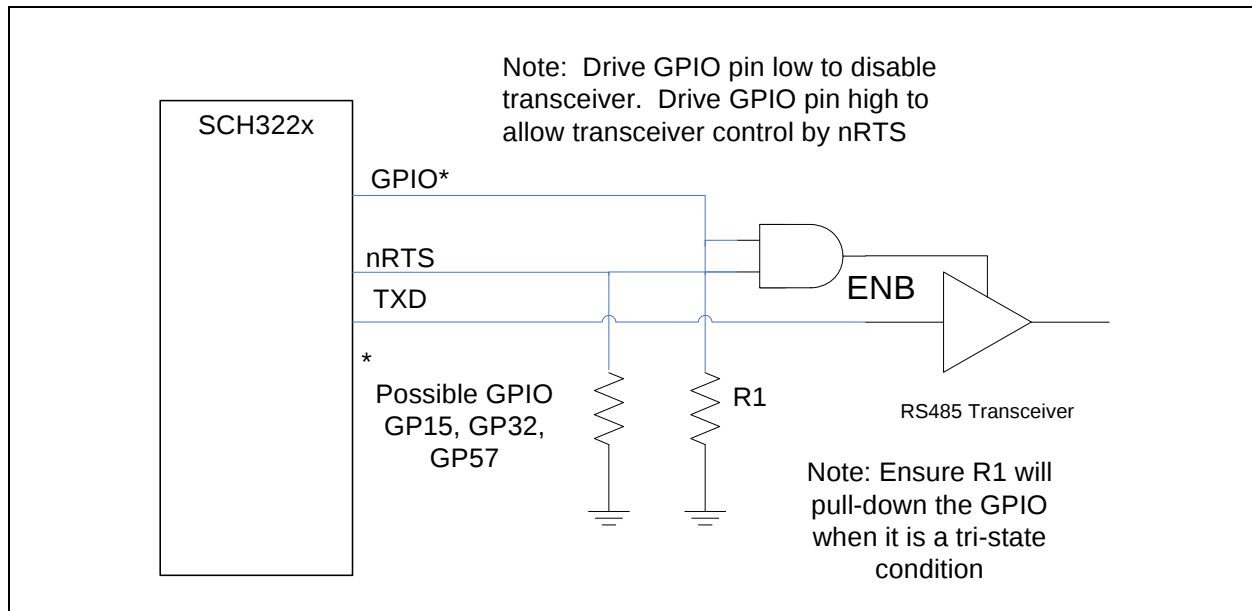

Data Sheet Clarifications

Note: The following typographic corrections and clarifications apply to Data Sheet Document #00002121A, which is at Revision A, and specifies only the family members SCH3222, SCH3224, SCH3226 and SCH3227. Other members of the SCH322x family have separate data sheets, and separate errata sheets.

TABLE 3: DATA SHEET CLARIFICATION SUMMARY

Module	Item Number	Issue Summary
Temp Monitor and Fan Control	1.	Incorrect offset for PME_EN1
Temp Monitor and Fan Control	2.	No Support for HWM SMI Events
Power Control	3.	32KHz Clock Required for PB_IN# and PB_OUT#
8042 Keyboard Controller	4.	Incorrect Register for Keyboard/Mouse Swap
Programmable Clock Output	5.	Misleading Label in Figure
Temp Monitor and Fan Control	6.	Incorrect Values in Table
Temp Monitor and Fan Control	7.	No Hardware Monitor Interrupt Event on SERIRQ
Runtime Registers	8.	Inconsistent Default for Keyboard PWRBTN Runtime Register
Runtime Registers	9.	Inconsistent Default for Runtime Registers
LPC Timing Diagrams	10.	Inconsistent PCI Clock Max Period

1. Module: Temperature Monitoring and Fan Control

The section “Interrupt as a PME Event,” refers to the PME_EN1 register at offset 0Ah. The offset for PME_EN1 is 08h.

2. Module: Temperature Monitoring and Fan Control

The section “Interrupt as an SMI Event,” is incorrect. Hardware monitoring interrupts are not routed to the SMI block and do not generate SMI events. The section will be removed in its entirety.

3. Module: Power Control Features

A clock is required on CLKI32 (pin 99) to clock in and debounce PB_IN# and to assert PB_OUT#. If CLKI32 is either not connected or is not connected to an active clock, PB_OUT# will not be asserted. CLKI32 should be connected to a 32KHz clock. A clock can be provided for PB_IN# by connecting CLKI32 to the SUSCLK output from the core logic south bridge.

4. Module: 8042 Keyboard Controller

The section “Keyboard/Mouse Swap Bit” says that there is a bit in the Keyboard Select configuration register at 0xF1 in logical device 7, used for swapping the keyboard and mouse pins. There is no such register. The keyboard/mouse swap bit is located in bit[6] of Runtime Register 0x5C, which is correctly documented.

5. Module: Programmable Clock Output

In the figure “Reset Generation Circuit”, there is a signal labeled “RESETB”. The figure implies that the signal comes in from an input pin. This is incorrect. The figure should indicate that the signal is an internally generated Power On Reset signal.

6. Module: Temperature Monitoring and Fan Control

The Nominal Voltage and Maximum Voltage numbers in the table "Voltage Limits vs. Register Setting" are incorrect for the row labeled 2.5V. The table indicates the nominal voltage is 5.0V and the maximum voltage is 6.64V. These two values are incorrect.

The correct nominal voltage is 2.5V, matching the signal name. The maximum voltage is 3.32V.

7. Module: Temperature Monitoring and Fan Control

In the subsection titled "Interrupt Event on Serial IRQ", in chapter "Temperature Monitoring and Fan Control", it is stated that the interrupt can be routed to the SERIRQ using configuration register 0x70 in Logical Device A. This is not correct. The Hardware Monitor Interrupt cannot be directly routed to a SERIRQ and there is no configuration register 0x70 in Logical Device A. This subsection will be deleted in subsequent releases of the data sheet.

As described in the subsections that precede this one, the Hardware Monitor interrupt can be routed onto a pin, onto an SMI or onto a PME. If it is required to route the HWM interrupt to a SERIRQ, it can be routed to an SMI, which can in turn be routed on SERIRQ2.

8. Module: Runtime Registers

The Description column of the Keyboard PWRBTN/SPEKEY runtime register specification states that the default value for bits[5:4], Keyboard Power Button Release, is 00b (De-assert KB_PB_STS 0.5sec after it is asserted).

This is inconsistent with the Name column, which states that the VBAT POR default value for bits[5:4] is 10b.

The actual default value is 10b. The system must set bits[5:4] to 00b if that is the desired behavior.

9. Module: Runtime Registers

The default POR values listed in the table "Runtime Register POR Summary" are incorrect in two cases. In addition, the default POR value for an additional register is incorrect in both this Summary table and also in the table "Detailed Runtime Register Description". Also, this Register table incorrectly states that register 0x10, PME_STS7, is reset on VBAT POR. The PME_STS7 register is reset on VTR POR, as stated in Summary table.

The following table shows the correct POR values for the registers in question:

Runtime Register	Description	VTR POR Default, Summary Table	VTR POR Default, Register Table	Actual VTR POR Default
0x10	PME_EN7	0x00	VBAT POR 0x00	0x00
0x13	SP34	0x00	0x44	0x44
0x4E	GP4	0x00	0xF0	0x05
0x6E	GP44	0x00	0x80	0x80

10. Module: LPC Timing Diagrams

In the chapter "Timing Diagrams", section "LPC Interface Timing":

In the table underneath the first figure "PCI Clock Timing", the parameter t1 (Period) is given an incorrect value in the MAX column. It shows 33.3ns, and should instead be 52.6ns, which represents the lowest tested LPC frequency of 19MHz.

APPENDIX A: DOCUMENT REVISION HISTORY

Revision Level and Date	Section	Description
DS80000694B (09-25-19)	Data Sheet Clarifications, Module #4 - 8042 Keyboard Controller	"Runtime Register 0x5" changed to "Runtime Register 0x5C".
DS80000694A (04-11-16)	Initial Draft Version	

THE MICROCHIP WEB SITE

Microchip provides online support via our WWW site at www.microchip.com. This web site is used as a means to make files and information easily available to customers. Accessible by using your favorite Internet browser, the web site contains the following information:

- **Product Support** – Data sheets and errata, application notes and sample programs, design resources, user's guides and hardware support documents, latest software releases and archived software
- **General Technical Support** – Frequently Asked Questions (FAQ), technical support requests, online discussion groups, Microchip consultant program member listing
- **Business of Microchip** – Product selector and ordering guides, latest Microchip press releases, listing of seminars and events, listings of Microchip sales offices, distributors and factory representatives

CUSTOMER CHANGE NOTIFICATION SERVICE

Microchip's customer notification service helps keep customers current on Microchip products. Subscribers will receive e-mail notification whenever there are changes, updates, revisions or errata related to a specified product family or development tool of interest.

To register, access the Microchip web site at www.microchip.com. Under "Support", click on "Customer Change Notification" and follow the registration instructions.

CUSTOMER SUPPORT

Users of Microchip products can receive assistance through several channels:

- Distributor or Representative
- Local Sales Office
- Field Application Engineer (FAE)
- Technical Support

Customers should contact their distributor, representative or field application engineer (FAE) for support. Local sales offices are also available to help customers. A listing of sales offices and locations is included in the back of this document.

Technical support is available through the web site at: <http://www.microchip.com/support>

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as "unbreakable."

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

Trademarks

The Microchip name and logo, the Microchip logo, Adaptec, AnyRate, AVR, AVR logo, AVR Freaks, BesTime, BitCloud, chipKIT, chipKIT logo, CryptoMemory, CryptoRF, dsPIC, FlashFlex, flexPWR, HELDO, IGLOO, JukeBlox, KeeLoq, Klear, LANCheck, LinkMD, maXStylus, maXTouch, MediaLB, megaAVR, Microsemi, Microsemi logo, MOST, MOST logo, MPLAB, OptoLyzer, PackeTime, PIC, picoPower, PICSTART, PIC32 logo, PolarFire, Prochip Designer, QTouch, SAM-BA, SenGenuity, SpyNIC, SST, SST Logo, SuperFlash, Symmetricom, SyncServer, Tachyon, TempTrackr, TimeSource, tinyAVR, UNI/O, Vectron, and XMEGA are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

APT, ClockWorks, The Embedded Control Solutions Company, EtherSynch, FlashTec, Hyper Speed Control, HyperLight Load, IntelliMOS, Libero, motorBench, mTouch, Powermite 3, Precision Edge, ProASIC, ProASIC Plus, ProASIC Plus logo, Quiet-Wire, SmartFusion, SyncWorld, Temux, TimeCesium, TimeHub, TimePictra, TimeProvider, Vite, WinPath, and ZL are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Adjacent Key Suppression, AKS, Analog-for-the-Digital Age, Any Capacitor, AnyIn, AnyOut, BlueSky, BodyCom, CodeGuard, CryptoAuthentication, CryptoAutomotive, CryptoCompanion, CryptoController, dsPICDEM, dsPICDEM.net, Dynamic Average Matching, DAM, ECAN, EtherGREEN, In-Circuit Serial Programming, ICSP, INICnet, Inter-Chip Connectivity, JitterBlocker, KlearNet, KlearNet logo, memBrain, Mindi, MiWi, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach, Omniscient Code Generation, PICDEM, PICDEM.net, PICkit, PICtail, PowerSmart, PureSilicon, QMatrix, REAL ICE, Ripple Blocker, SAM-ICE, Serial Quad I/O, SMART-I.S., SQT, SuperSwitcher, SuperSwitcher II, Total Endurance, TSHARC, USBCheck, VariSense, ViewSpan, WiperLock, Wireless DNA, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

The Adaptec logo, Frequency on Demand, Silicon Storage Technology, and Symmcom are registered trademarks of Microchip Technology Inc. in other countries.

GestIC is a registered trademark of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2016-2019, Microchip Technology Incorporated, All Rights Reserved.

ISBN: 9781522450818

For information regarding Microchip's Quality Management Systems, please visit www.microchip.com/quality.



Worldwide Sales and Service

AMERICAS

Corporate Office
2355 West Chandler Blvd.
Chandler, AZ 85224-6199
Tel: 480-792-7200
Fax: 480-792-7277
Technical Support:
<http://www.microchip.com/support>
Web Address:
www.microchip.com

Atlanta
Duluth, GA
Tel: 678-957-9614
Fax: 678-957-1455

Austin, TX
Tel: 512-257-3370

Boston
Westborough, MA
Tel: 774-760-0087
Fax: 774-760-0088

Chicago
Itasca, IL
Tel: 630-285-0071
Fax: 630-285-0075

Dallas
Addison, TX
Tel: 972-818-7423
Fax: 972-818-2924

Detroit
Novi, MI
Tel: 248-848-4000

Houston, TX
Tel: 281-894-5983

Indianapolis
Noblesville, IN
Tel: 317-773-8323
Fax: 317-773-5453
Tel: 317-536-2380

Los Angeles
Mission Viejo, CA
Tel: 949-462-9523
Fax: 949-462-9608
Tel: 951-273-7800

Raleigh, NC
Tel: 919-844-7510

New York, NY
Tel: 631-435-6000

San Jose, CA
Tel: 408-735-9110
Tel: 408-436-4270

Canada - Toronto
Tel: 905-695-1980
Fax: 905-695-2078

ASIA/PACIFIC

Australia - Sydney
Tel: 61-2-9868-6733

China - Beijing
Tel: 86-10-8569-7000

China - Chengdu
Tel: 86-28-8665-5511

China - Chongqing
Tel: 86-23-8980-9588

China - Dongguan
Tel: 86-769-8702-9880

China - Guangzhou
Tel: 86-20-8755-8029

China - Hangzhou
Tel: 86-571-8792-8115

China - Hong Kong SAR
Tel: 852-2943-5100

China - Nanjing
Tel: 86-25-8473-2460

China - Qingdao
Tel: 86-532-8502-7355

China - Shanghai
Tel: 86-21-3326-8000

China - Shenyang
Tel: 86-24-2334-2829

China - Shenzhen
Tel: 86-755-8864-2200

China - Suzhou
Tel: 86-186-6233-1526

China - Wuhan
Tel: 86-27-5980-5300

China - Xian
Tel: 86-29-8833-7252

China - Xiamen
Tel: 86-592-2388138

China - Zhuhai
Tel: 86-756-3210040

ASIA/PACIFIC

India - Bangalore
Tel: 91-80-3090-4444

India - New Delhi
Tel: 91-11-4160-8631

India - Pune
Tel: 91-20-4121-0141

Japan - Osaka
Tel: 81-6-6152-7160

Japan - Tokyo
Tel: 81-3-6880-3770

Korea - Daegu
Tel: 82-53-744-4301

Korea - Seoul
Tel: 82-2-554-7200

Malaysia - Kuala Lumpur
Tel: 60-3-7651-7906

Malaysia - Penang
Tel: 60-4-227-8870

Philippines - Manila
Tel: 63-2-634-9065

Singapore
Tel: 65-6334-8870

Taiwan - Hsin Chu
Tel: 886-3-577-8366

Taiwan - Kaohsiung
Tel: 886-7-213-7830

Taiwan - Taipei
Tel: 886-2-2508-8600

Thailand - Bangkok
Tel: 66-2-694-1351

Vietnam - Ho Chi Minh
Tel: 84-28-5448-2100

EUROPE

Austria - Wels
Tel: 43-7242-2244-39
Fax: 43-7242-2244-393

Denmark - Copenhagen
Tel: 45-4450-2828
Fax: 45-4485-2829

Finland - Espoo
Tel: 358-9-4520-820

France - Paris
Tel: 33-1-69-53-63-20
Fax: 33-1-69-30-90-79

Germany - Garching
Tel: 49-8931-9700

Germany - Haan
Tel: 49-2129-3766400

Germany - Heilbronn
Tel: 49-7131-72400

Germany - Karlsruhe
Tel: 49-721-625370

Germany - Munich
Tel: 49-89-627-144-0
Fax: 49-89-627-144-44

Germany - Rosenheim
Tel: 49-8031-354-560

Israel - Ra'anana
Tel: 972-9-744-7705

Italy - Milan
Tel: 39-0331-742611
Fax: 39-0331-466781

Italy - Padova
Tel: 39-049-7625286

Netherlands - Drunen
Tel: 31-416-690399
Fax: 31-416-690340

Norway - Trondheim
Tel: 47-7288-4388

Poland - Warsaw
Tel: 48-22-3325737

Romania - Bucharest
Tel: 40-21-407-87-50

Spain - Madrid
Tel: 34-91-708-08-90
Fax: 34-91-708-08-91

Sweden - Gothenberg
Tel: 46-31-704-60-40

Sweden - Stockholm
Tel: 46-8-5090-4654

UK - Wokingham
Tel: 44-118-921-5800
Fax: 44-118-921-5820