



dsPIC33FJXXXGPXXX/ dsPIC33FJXXXMCXXX

dsPIC33F Engineering Samples Rev. A0 Silicon Errata

dsPIC33FJXXXGPXXX, dsPIC33FJXXXMCXXX (Rev. A0) Silicon Errata

The dsPIC33F Engineering Samples (Rev. A0) you received were found to conform to the specifications and functionality described in the following documents:

- DS70165 – “dsPIC33F Family Data Sheet”
- DS70157 – “dsPIC30F/dsPIC33F Programmer’s Reference Manual”
- DS70046 – “dsPIC30F Family Reference Manual”

The exceptions to the specifications in the documents listed above are described in this section. The specific devices for which these exceptions are described are listed below:

- dsPIC33FJ64GP706
- dsPIC33FJ64GP708
- dsPIC33FJ64GP710
- dsPIC33FJ128GP706
- dsPIC33FJ128GP708
- dsPIC33FJ256GP506
- dsPIC33FJ256GP710
- dsPIC33FJ64MC706
- dsPIC33FJ64MC508
- dsPIC33FJ64MC710
- dsPIC33FJ128MC706
- dsPIC33FJ128MC708
- dsPIC33FJ256MC710

dsPIC33F Rev. A0 silicon is identified by performing a “Reset and Connect” operation to the device using MPLAB® ICD 2 with MPLAB IDE v7.31 or later. The following text is then visible under the MPLAB ICD 2 section in the output window in MPLAB IDE:

```
Setting Vdd source to target
Target Device dsPIC33FJ256GP710
found, revision = Rev 0x3000
...Reading ICD Product ID
Running ICD Self Test
...Passed
MPLAB ICD 2 Ready
```

The errata described in this section will be addressed in future revisions of silicon.

Silicon Errata Summary

The following list summarizes the errata described in further detail through the remainder of this document:

1. SPI with 1:1 Prescaler
The SPI modules do not function correctly when the SPI clock prescale ratio is set to 1:1.
2. SPI Master Reception for Bit Rates above 8 Mbps
SPI Master reception does not function correctly at bit rates higher than 8 Mbps, if the data is sampled at the middle of the serial clock period.
3. ADC with Sample/Hold CH3
Sample/Hold amplifier CH3 does not function correctly for the Analog-to-Digital Converter modules.
4. LATC and LATD Reads
The LATC and LATD register reads do not function.
5. DMA Single-Shot Mode
The Direct Memory Access Single-Shot mode does not function correctly.

The following sections will describe the errata and work around to these errata, where they may apply.

dsPIC33F ENGINEERING SAMPLES

1. Module: SPI with 1:1 Prescaler

The SPI1 and SPI2 modules do not generate any serial clock signals and, therefore, do not function correctly for the following values of the PPRE<1:0> (SPIxCON1<1:0>) and the SPRE<2:0> (SPIxCON1<4:2>) bits:

- PPRE = 11, SPRE = 111

Work around

Users may set up the SPI module with any prescale ratio other than 1:1.

2. Module: SPI Master Reception for Bit Rates above 8 Mbps

Master mode receptions using the SPI1 and SPI2 module do not function correctly for bit rates above 8 Mbps if the Master has the SMP bit (SPIxCON1<9>) cleared (Master samples data at the middle of the serial clock period).

In this case, the data transmitted by the Slave is received shifted right by one bit by the Master. For example, if the data transmitted by the Slave was 0xAAAA, the data received by the Master would be 0x5555 (0xAAAA shifted right by one bit).

Work around

Users may set up the SPI module so that the bit rate is 8 Mbps or lower.

Alternatively, the bit rate can be configured higher than 8 Mbps, but the SMP bit (SPIxCON1<9>) of the SPI Master must be set (Master samples data at the end of the serial clock period).

3. Module: ADC with Sample/Hold CH3

The Sample/Hold amplifier CH3 does not function correctly when used with the Analog-to-Digital Converter (ADC) modules. The corresponding conversion result is always read as 0x0000.

Work around

Do not use the Sample/Hold amplifier CH3 with the ADC1 or ADC2 module. You may use CH0, CH1 and CH2.

4. Module: LATC and LATD Reads

The LATC and LATD register reads do not function. Performing a read or read-modify-write operation on the LATC register or the LATD register will not function.

Do not perform read or read-modify-write operations on the LATC and LATD registers. Inspect the disassembly listing of any user application software that may be accessing the LATC or LATD register, to ensure that read or read-modify-write operations are not being performed on these registers.

To verify the contents of the LATC register, perform the following steps:

- Write to LATC
- Make a PORTC pin an output
- Read the PORTC register

The same steps can be performed to verify the contents of the LATD register.

Note: The Port pin state, and therefore the read value, depends on the load attached to the Port pin.

5. Module: DMA Single-Shot Mode

The DMA Single-Shot mode does not function correctly for more than one block transfer. After one block transfer, the DMA channel becomes unusable until a device reset occurs.

Work around

If more than one DMA data block transfers are required during the entire program execution, the user application may set up the required DMA channel to operate in Continuous mode, and disable the DMA channel every time the corresponding DMA interrupt has occurred.

However, if only one DMA data block transfer is required for a particular DMA channel during the entire program execution, the Single-Shot mode may be used.

dsPIC33F ENGINEERING SAMPLES

APPENDIX A: REVISION HISTORY

Revision A (2/2006)

First release of the document.

dsPIC33F ENGINEERING SAMPLES

NOTES:

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as "unbreakable."

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights.

Trademarks

The Microchip name and logo, the Microchip logo, Accuron, dsPIC, KEELoQ, microID, MPLAB, PIC, PICmicro, PICSTART, PRO MATE, PowerSmart, rPIC, and SmartShunt are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.


AmpLab, FilterLab, Migratable Memory, MXDEV, MXLAB, SEEVAL, SmartSensor and The Embedded Control Solutions Company are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Analog-for-the-Digital Age, Application Maestro, dsPICDEM, dsPICDEM.net, dsPICworks, ECAN, ECONOMONITOR, FanSense, FlexROM, fuzzyLAB, In-Circuit Serial Programming, ICSP, ICEPIC, Linear Active Thermistor, MPASM, MPLIB, MPLINK, MPSIM, PICkit, PICDEM, PICDEM.net, PICLAB, PICtail, PowerCal, PowerInfo, PowerMate, PowerTool, Real ICE, rLAB, rPICDEM, Select Mode, Smart Serial, SmartTel, Total Endurance, UNI/O, WiperLock and Zena are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

All other trademarks mentioned herein are property of their respective companies.

© 2006, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.

 Printed on recycled paper.

**QUALITY MANAGEMENT SYSTEM
CERTIFIED BY DNV
== ISO/TS 16949:2002 ==**

Microchip received ISO/TS-16949:2002 quality system certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona and Mountain View, California in October 2003. The Company's quality system processes and procedures are for its PICmicro® 8-bit MCUs, KEELoQ® code hopping devices, Serial EEPROMs, microperipherals, nonvolatile memory and analog products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001:2000 certified.



WORLDWIDE SALES AND SERVICE

AMERICAS

Corporate Office
2355 West Chandler Blvd.
Chandler, AZ 85224-6199
Tel: 480-792-7200
Fax: 480-792-7277
Technical Support:
<http://support.microchip.com>
Web Address:
www.microchip.com

Atlanta
Alpharetta, GA
Tel: 770-640-0034
Fax: 770-640-0307

Boston
Westborough, MA
Tel: 774-760-0087
Fax: 774-760-0088

Chicago
Itasca, IL
Tel: 630-285-0071
Fax: 630-285-0075

Dallas
Addison, TX
Tel: 972-818-7423
Fax: 972-818-2924

Detroit
Farmington Hills, MI
Tel: 248-538-2250
Fax: 248-538-2260

Kokomo
Kokomo, IN
Tel: 765-864-8360
Fax: 765-864-8387

Los Angeles
Mission Viejo, CA
Tel: 949-462-9523
Fax: 949-462-9608

San Jose
Mountain View, CA
Tel: 650-215-1444
Fax: 650-961-0286

Toronto
Mississauga, Ontario,
Canada
Tel: 905-673-0699
Fax: 905-673-6509

ASIA/PACIFIC

Australia - Sydney
Tel: 61-2-9868-6733
Fax: 61-2-9868-6755

China - Beijing
Tel: 86-10-8528-2100
Fax: 86-10-8528-2104

China - Chengdu
Tel: 86-28-8676-6200
Fax: 86-28-8676-6599

China - Fuzhou
Tel: 86-591-8750-3506
Fax: 86-591-8750-3521

China - Hong Kong SAR
Tel: 852-2401-1200
Fax: 852-2401-3431

China - Qingdao
Tel: 86-532-8502-7355
Fax: 86-532-8502-7205

China - Shanghai
Tel: 86-21-5407-5533
Fax: 86-21-5407-5066

China - Shenyang
Tel: 86-24-2334-2829
Fax: 86-24-2334-2393

China - Shenzhen
Tel: 86-755-8203-2660
Fax: 86-755-8203-1760

China - Shunde
Tel: 86-757-2839-5507
Fax: 86-757-2839-5571

China - Wuhan
Tel: 86-27-5980-5300
Fax: 86-27-5980-5118

China - Xian
Tel: 86-29-8833-7250
Fax: 86-29-8833-7256

ASIA/PACIFIC

India - Bangalore
Tel: 91-80-2229-0061
Fax: 91-80-2229-0062

India - New Delhi
Tel: 91-11-5160-8631
Fax: 91-11-5160-8632

India - Pune
Tel: 91-20-2566-1512
Fax: 91-20-2566-1513

Japan - Yokohama
Tel: 81-45-471-6166
Fax: 81-45-471-6122

Korea - Gumi
Tel: 82-54-473-4301
Fax: 82-54-473-4302

Korea - Seoul
Tel: 82-2-554-7200
Fax: 82-2-558-5932 or
82-2-558-5934

Malaysia - Penang
Tel: 60-4-646-8870
Fax: 60-4-646-5086

Philippines - Manila
Tel: 63-2-634-9065
Fax: 63-2-634-9069

Singapore
Tel: 65-6334-8870
Fax: 65-6334-8850

Taiwan - Hsin Chu
Tel: 886-3-572-9526
Fax: 886-3-572-6459

Taiwan - Kaohsiung
Tel: 886-7-536-4818
Fax: 886-7-536-4803

Taiwan - Taipei
Tel: 886-2-2500-6610
Fax: 886-2-2508-0102

Thailand - Bangkok
Tel: 66-2-694-1351
Fax: 66-2-694-1350

EUROPE

Austria - Wels
Tel: 43-7242-2244-399
Fax: 43-7242-2244-393

Denmark - Copenhagen
Tel: 45-4450-2828
Fax: 45-4485-2829

France - Paris
Tel: 33-1-69-53-63-20
Fax: 33-1-69-30-90-79

Germany - Munich
Tel: 49-89-627-144-0
Fax: 49-89-627-144-44

Italy - Milan
Tel: 39-0331-742611
Fax: 39-0331-466781

Netherlands - Drunen
Tel: 31-416-690399
Fax: 31-416-690340

Spain - Madrid
Tel: 34-91-708-08-90
Fax: 34-91-708-08-91

UK - Wokingham
Tel: 44-118-921-5869
Fax: 44-118-921-5820



10/31/05