



ATmega808/809/1608/1609 Silicon Errata and Data Sheet Clarification

ATmega808/809/1608/1609 Silicon Errata and Data Sheet Clarification

The ATmega808/809/1608/1609 devices of the megaAVR® 0-series you have received conform functionally to the current device data sheet (www.microchip.com/DS40002172), except for the anomalies described in this document. The errata described in this document will likely be addressed in future revisions of the ATmega808/809/1608/1609 devices.

Note: This document summarizes all the silicon errata issues from all revisions of silicon, previous as well as current.

Note: Refer to the Device/Revision ID section in the current device data sheet (www.microchip.com/DS40002172) for more detailed information on Device Identification and Revision IDs for your specific device, or contact your local Microchip sales office for assistance.

Table of Contents

| | |
|--|----|
| | 1 |
| 1. Silicon Issue Summary..... | 3 |
| 2. Silicon Errata..... | 4 |
| 2.1. Errata Details..... | 4 |
| 2.2. PORTMUX..... | 4 |
| 2.3. ADC..... | 4 |
| 2.4. TCB..... | 5 |
| 2.5. USART..... | 5 |
| 3. Data Sheet Clarifications..... | 7 |
| 4. Document Revision History..... | 8 |
| 4.1. Revision History..... | 8 |
| 4.2. Appendix - Obsolete Revision History..... | 8 |
| The Microchip Website..... | 9 |
| Product Change Notification Service..... | 9 |
| Customer Support..... | 9 |
| Microchip Devices Code Protection Feature..... | 9 |
| Legal Notice..... | 9 |
| Trademarks..... | 10 |
| Quality Management System..... | 10 |
| Worldwide Sales and Service..... | 11 |

1. Silicon Issue Summary

Legend

- Erratum is not applicable.
- X** Erratum is applicable.
- * This silicon revision was never released to production.

Errata Overview

| Peripheral | Short Description | Valid for Silicon Revision |
|------------|---|----------------------------|
| | | Rev. A |
| PORTMUX | 2.2.1 SPI SS Pin is Connected to Pin Even if SPI is Configured to Have No Port Connection | X |
| ADC | 2.3.1 One Extra Measurement Performed After Disabling ADC Free-Running Mode | X |
| | 2.3.2 ADC Functionality Cannot be Ensured with CLKADC Above 1.5 MHz and a Setting of 25% Duty Cycle | X |
| | 2.3.3 ADC Performance Degrades with CLKADC Above 1.5 MHz and VDD < 2.7V | X |
| TCB | 2.4.1 TCA Restart Command Does Not Force a Restart of TCB | X |
| | 2.4.2 Minimum Event Duration Must Exceed Selected Clock Period | X |
| USART | 2.5.1 TXD Pin Override Not Released When Disabling the Transmitter | X |

2. Silicon Errata

2.1 Errata Details

- Erratum is not applicable.
- X** Erratum is applicable.
- * This silicon revision was never released to production.

2.2 PORTMUX

2.2.1 SPI \overline{SS} Pin is Connected to Pin Even if SPI is Configured to Have No Port Connection

The SPIn \overline{SS} pin is connected even if NONE is selected in the SPIn field in PORTMUX.TWISPIROUTE. If SPIn is operating in Master mode and the \overline{SS} pin goes low, or input is disabled, the SPIn will exit Master mode.

Work around

Write the SSD bit in SPIn.CTRLB to '1' to ignore the \overline{SS} signal.

Affected Silicon Revisions

| Rev. A | | | | | | | |
|--------|--|--|--|--|--|--|--|
| X | | | | | | | |

2.3 ADC

2.3.1 One Extra Measurement Performed After Disabling ADC Free-Running Mode

The ADC may perform one additional measurement after clearing ADCn.CTRLA.FREERUN.

Work around

Write ADCn.CTRLA.ENABLE to '0' to stop the free-running mode immediately.

Affected Silicon Revisions

| Rev. A | | | | | | | |
|--------|--|--|--|--|--|--|--|
| X | | | | | | | |

2.3.2 ADC Functionality Cannot be Ensured with CLK_{ADC} Above 1.5 MHz and a Setting of 25% Duty Cycle

The ADC functionality cannot be ensured if $CLK_{ADC} > 1.5$ MHz with ADCn.CALIB.DUTYCYC set to '1'.

Work around

If ADC is operated with $CLK_{ADC} > 1.5$ MHz, ADCn.CALIB.DUTYCYC must be set to '0' (50% duty cycle).

Affected Silicon Revisions

| Rev. A | | | | | | | |
|--------|--|--|--|--|--|--|--|
| | | | | | | | |

| | | | | | | | |
|---|--|--|--|--|--|--|--|
| X | | | | | | | |
|---|--|--|--|--|--|--|--|

2.3.3 ADC Performance Degrades with CLK_{ADC} Above 1.5 MHz and V_{DD} < 2.7V

The ADC INL performance degrades if CLK_{ADC} > 1.5 MHz and ADCn.CALIB.DUTYCYC set to '0' for V_{DD} < 2.7V.

Work around

None.

Affected Silicon Revisions

| Rev. A | | | | | | | |
|--------|--|--|--|--|--|--|--|
| X | | | | | | | |

2.4 TCB

2.4.1 TCA Restart Command Does Not Force a Restart of TCB

The TCA restart command does not force a restart of the TCB when TCB is running in SYNCUPD mode. TCB is only restarted after a TCA OVF.

Work around

None.

Affected Silicon Revisions

| Rev. A | | | | | | | |
|--------|--|--|--|--|--|--|--|
| X | | | | | | | |

2.4.2 Minimum Event Duration Must Exceed Selected Clock Period

Event detection will fail if TCBn receives an input event with a high/low period shorter than the period of the selected clock source (CLKSEL in TCBn.CTRLA).

This applies to the TCB modes (CNTMODE in TCBn.CTRLB) *Time-out check* and *Input Capture Frequency and Pulse-Width Measurement* mode.

Work around

Ensure that the high/low period of the input events is equal to or longer than the period of the selected clock source (CLKSEL in TCBn.CTRLA).

Affected Silicon Revisions

| Rev. A | | | | | | | |
|--------|--|--|--|--|--|--|--|
| X | | | | | | | |

2.5 USART

2.5.1 TXD Pin Override Not Released When Disabling the Transmitter

Event detection will fail if TCBn receives an input event with a high/low period shorter than the period of the selected clock source (CLKSEL in TCBn.CTRLA).

The USART will not release the TXD pin override if:

1. The USART transmitter is disabled by writing the TXEN bit in USART.CTRLB to '0' while the USART receiver is disabled (RXEN in USART.CTRLB is '0').
2. Both the USART transmitter and receiver are disabled at the same time by writing the TXEN and RXEN bits in USART.CTRLB to '0'.

Work around

There are two possible workarounds:

- Make sure the receiver is enabled (RXEN in USART.CTRLB is '1') while disabling the transmitter (writing TXEN in USART.CTRLB to '0')
- Write to any register in the USART after disabling the transmitter. This will start the USART for long enough to release the pin override of the TXD pin

Affected Silicon Revisions

| Rev. A | | | | | | | |
|--------|--|--|--|--|--|--|--|
| X | | | | | | | |

3. Data Sheet Clarifications

None.

4. Document Revision History

Note: The data sheet clarification document revision is independent of the die revision and the device variant (last letter of the ordering number).

4.1 Revision History

| Doc Rev. | Date | Comments |
|----------|---------|---|
| A | 01/2020 | <ul style="list-style-type: none"> • Document <ul style="list-style-type: none"> – Change document structure from one document for the entire megaAVR 0-series to one document per data sheet: <ul style="list-style-type: none"> • from: megaAVR-0-series-Errata-and-Clarification-80000777C.pdf • to: ATmega808_809_1608_1609-Errata-and-Clarification-DS80000868A.pdf – Updated document template • Errata <ul style="list-style-type: none"> – The ADC errata, ADC Functionality Cannot be Ensured with ADCCLK Above 1.5 MHz for All Conditions, has been split into two separate erratas and rewritten |

4.2 Appendix - Obsolete Revision History

Note: Due to document structure change from a single megaAVR 0-series to one document per data sheet, the following history from www.microchip.com/DS80000777 is provided as reference.

| Doc Rev. | Date | Comments |
|----------|---------|--|
| C | 08/2019 | <ul style="list-style-type: none"> • New Errata: <ul style="list-style-type: none"> – CPUINT: Interrupt Level 1 Does Not Work <p>Note: Only applicable to ATmega4808/4809 for specific date codes.</p> |
| B | 07/2019 | <ul style="list-style-type: none"> • Document <ul style="list-style-type: none"> – Adding variants with 16 KB and 8 KB Flash – Adding 40-pin variant of ATmega4809 – Changing document title – Adding section "Data Sheet Clarifications" • New Errata: <ul style="list-style-type: none"> – PORTMUX: SPI SS is Connected to Pin Even if SPI is Configured to Have No Port Connection – TCB: Minimum Event Duration Must Exceed Selected Clock Period – USART: TXD Pin Override Not Released When Disabling the Transmitter • Erratum for TCA removed: Issuing a restart will clear the direction bit - the data sheet is describing this correctly. |
| A | 02/2018 | <ul style="list-style-type: none"> • Initial document release. |

The Microchip Website

Microchip provides online support via our website at <http://www.microchip.com/>. This website is used to make files and information easily available to customers. Some of the content available includes:

- **Product Support** – Data sheets and errata, application notes and sample programs, design resources, user's guides and hardware support documents, latest software releases and archived software
- **General Technical Support** – Frequently Asked Questions (FAQs), technical support requests, online discussion groups, Microchip design partner program member listing
- **Business of Microchip** – Product selector and ordering guides, latest Microchip press releases, listing of seminars and events, listings of Microchip sales offices, distributors and factory representatives

Product Change Notification Service

Microchip's product change notification service helps keep customers current on Microchip products. Subscribers will receive email notification whenever there are changes, updates, revisions or errata related to a specified product family or development tool of interest.

To register, go to <http://www.microchip.com/pcn> and follow the registration instructions.

Customer Support

Users of Microchip products can receive assistance through several channels:

- Distributor or Representative
- Local Sales Office
- Embedded Solutions Engineer (ESE)
- Technical Support

Customers should contact their distributor, representative or ESE for support. Local sales offices are also available to help customers. A listing of sales offices and locations is included in this document.

Technical support is available through the website at: <http://www.microchip.com/support>

Microchip Devices Code Protection Feature

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as "unbreakable."

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

Legal Notice

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with

your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

Trademarks

The Microchip name and logo, the Microchip logo, Adaptec, AnyRate, AVR, AVR logo, AVR Freaks, BesTime, BitCloud, chipKIT, chipKIT logo, CryptoMemory, CryptoRF, dsPIC, FlashFlex, flexPWR, HELDO, IGLOO, JukeBlox, KeeLoq, Kleer, LANCheck, LinkMD, maXStylus, maXTouch, MediaLB, megaAVR, Microsemi, Microsemi logo, MOST, MOST logo, MPLAB, OptoLyzer, PackeTime, PIC, picoPower, PICSTART, PIC32 logo, PolarFire, Prochip Designer, QTouch, SAM-BA, SenGenuity, SpyNIC, SST, SST Logo, SuperFlash, Symmetricom, SyncServer, Tachyon, TempTrackr, TimeSource, tinyAVR, UNI/O, Vectron, and XMEGA are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

APT, ClockWorks, The Embedded Control Solutions Company, EtherSynch, FlashTec, Hyper Speed Control, HyperLight Load, IntelliMOS, Libero, motorBench, mTouch, Powermite 3, Precision Edge, ProASIC, ProASIC Plus, ProASIC Plus logo, Quiet-Wire, SmartFusion, SyncWorld, Temux, TimeCesium, TimeHub, TimePictra, TimeProvider, Vite, WinPath, and ZL are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Adjacent Key Suppression, AKS, Analog-for-the-Digital Age, Any Capacitor, AnyIn, AnyOut, BlueSky, BodyCom, CodeGuard, CryptoAuthentication, CryptoAutomotive, CryptoCompanion, CryptoController, dsPICDEM, dsPICDEM.net, Dynamic Average Matching, DAM, ECAN, EtherGREEN, In-Circuit Serial Programming, ICSP, INICnet, Inter-Chip Connectivity, JitterBlocker, KleerNet, KleerNet logo, memBrain, Mindi, MiWi, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach, Omniscient Code Generation, PICDEM, PICDEM.net, PICkit, PICtail, PowerSmart, PureSilicon, QMatrix, REAL ICE, Ripple Blocker, SAM-ICE, Serial Quad I/O, SMART-I.S., SQI, SuperSwitcher, SuperSwitcher II, Total Endurance, TSHARC, USBCheck, VariSense, ViewSpan, WiperLock, Wireless DNA, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

The Adaptec logo, Frequency on Demand, Silicon Storage Technology, and Symmcom are registered trademarks of Microchip Technology Inc. in other countries.

GestIC is a registered trademark of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2020, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.

ISBN: 978-1-5224-5385-7

Quality Management System

For information regarding Microchip's Quality Management Systems, please visit <http://www.microchip.com/quality>.

Worldwide Sales and Service

| AMERICAS | ASIA/PACIFIC | ASIA/PACIFIC | EUROPE |
|---|---|--|---|
| <p>Corporate Office 2355 West Chandler Blvd. Chandler, AZ 85224-6199 Tel: 480-792-7200 Tel: 480-792-7277 Technical Support: http://www.microchip.com/support Web Address: http://www.microchip.com</p> <p>Atlanta Duluth, GA Tel: 678-957-9614 Fax: 678-957-1455</p> <p>Austin, TX Tel: 512-257-3370</p> <p>Boston Westborough, MA Tel: 774-760-0087 Fax: 774-760-0088</p> <p>Chicago Itasca, IL Tel: 630-285-0071 Fax: 630-285-0075</p> <p>Dallas Addison, TX Tel: 972-818-7423 Fax: 972-818-2924</p> <p>Detroit Novi, MI Tel: 248-848-4000</p> <p>Houston, TX Tel: 281-894-5983</p> <p>Indianapolis Noblesville, IN Tel: 317-773-8323 Fax: 317-773-5453 Tel: 317-536-2380</p> <p>Los Angeles Mission Viejo, CA Tel: 949-462-9523 Fax: 949-462-9608 Tel: 951-273-7800</p> <p>Raleigh, NC Tel: 919-844-7510</p> <p>New York, NY Tel: 631-435-6000</p> <p>San Jose, CA Tel: 408-735-9110 Tel: 408-436-4270</p> <p>Canada - Toronto Tel: 905-695-1980 Fax: 905-695-2078</p> | <p>Australia - Sydney Tel: 61-2-9868-6733</p> <p>China - Beijing Tel: 86-10-8569-7000</p> <p>China - Chengdu Tel: 86-28-8665-5511</p> <p>China - Chongqing Tel: 86-23-8980-9588</p> <p>China - Dongguan Tel: 86-769-8702-9880</p> <p>China - Guangzhou Tel: 86-20-8755-8029</p> <p>China - Hangzhou Tel: 86-571-8792-8115</p> <p>China - Hong Kong SAR Tel: 852-2943-5100</p> <p>China - Nanjing Tel: 86-25-8473-2460</p> <p>China - Qingdao Tel: 86-532-8502-7355</p> <p>China - Shanghai Tel: 86-21-3326-8000</p> <p>China - Shenyang Tel: 86-24-2334-2829</p> <p>China - Shenzhen Tel: 86-755-8864-2200</p> <p>China - Suzhou Tel: 86-186-6233-1526</p> <p>China - Wuhan Tel: 86-27-5980-5300</p> <p>China - Xian Tel: 86-29-8833-7252</p> <p>China - Xiamen Tel: 86-592-2388138</p> <p>China - Zhuhai Tel: 86-756-3210040</p> | <p>India - Bangalore Tel: 91-80-3090-4444</p> <p>India - New Delhi Tel: 91-11-4160-8631</p> <p>India - Pune Tel: 91-20-4121-0141</p> <p>Japan - Osaka Tel: 81-6-6152-7160</p> <p>Japan - Tokyo Tel: 81-3-6880-3770</p> <p>Korea - Daegu Tel: 82-53-744-4301</p> <p>Korea - Seoul Tel: 82-2-554-7200</p> <p>Malaysia - Kuala Lumpur Tel: 60-3-7651-7906</p> <p>Malaysia - Penang Tel: 60-4-227-8870</p> <p>Philippines - Manila Tel: 63-2-634-9065</p> <p>Singapore Tel: 65-6334-8870</p> <p>Taiwan - Hsin Chu Tel: 886-3-577-8366</p> <p>Taiwan - Kaohsiung Tel: 886-7-213-7830</p> <p>Taiwan - Taipei Tel: 886-2-2508-8600</p> <p>Thailand - Bangkok Tel: 66-2-694-1351</p> <p>Vietnam - Ho Chi Minh Tel: 84-28-5448-2100</p> | <p>Austria - Wels Tel: 43-7242-2244-39 Fax: 43-7242-2244-393</p> <p>Denmark - Copenhagen Tel: 45-4450-2828 Fax: 45-4485-2829</p> <p>Finland - Espoo Tel: 358-9-4520-820</p> <p>France - Paris Tel: 33-1-69-53-63-20 Fax: 33-1-69-30-90-79</p> <p>Germany - Garching Tel: 49-8931-9700</p> <p>Germany - Haan Tel: 49-2129-3766400</p> <p>Germany - Heilbronn Tel: 49-7131-72400</p> <p>Germany - Karlsruhe Tel: 49-721-625370</p> <p>Germany - Munich Tel: 49-89-627-144-0 Fax: 49-89-627-144-44</p> <p>Germany - Rosenheim Tel: 49-8031-354-560</p> <p>Israel - Ra'anana Tel: 972-9-744-7705</p> <p>Italy - Milan Tel: 39-0331-742611 Fax: 39-0331-466781</p> <p>Italy - Padova Tel: 39-049-7625286</p> <p>Netherlands - Drunen Tel: 31-416-690399 Fax: 31-416-690340</p> <p>Norway - Trondheim Tel: 47-72884388</p> <p>Poland - Warsaw Tel: 48-22-3325737</p> <p>Romania - Bucharest Tel: 40-21-407-87-50</p> <p>Spain - Madrid Tel: 34-91-708-08-90 Fax: 34-91-708-08-91</p> <p>Sweden - Gothenberg Tel: 46-31-704-60-40</p> <p>Sweden - Stockholm Tel: 46-8-5090-4654</p> <p>UK - Wokingham Tel: 44-118-921-5800 Fax: 44-118-921-5820</p> |