
MRF24J40 Silicon Errata

The MRF24J40 RF transceiver you have received conforms functionally to the Device Data Sheet (DS30009776C), except for the anomalies described in this document.

1. Module: RX MAC

If the RX filter is configured for Promiscuous mode, packets with a reserved packet type in the MAC frame type field may cause the RX module to put an incorrect packet length in the RX buffer.

Work around

When operating in Promiscuous mode, flush the RX buffer by setting the RXFLUSH bit (RXFLUSH<0>) after every RX interrupt.

Date Codes that pertain to this issue

All engineering and production devices.

2. Module: Security Module

When the device is performing encryption or decryption, there is a very small chance that the encryption or decryption result may be incorrect.

Work around

During decryption operations, repeat the decryption one or more times if a MIC error is indicated on the first attempt.

During encryption operations, verify the encryption by immediately decrypting the packet and checking it against the original for errors. If an error is found, repeat the encryption and verification.

Date Codes that pertain to this issue

All engineering and production devices.

3. Module: RX MAC

Under certain conditions, such as channel scanning, unexpected packets may be received at alternative channels spaced at 20 MHz intervals. This occurs when the interfering sources contain sufficient intensity and proximity to the receiver.

For example, if the device is tuned to the 2,425 MHz channel, spurious signals can be detected at 2,405 MHz, 2,445 MHz and 2,465 MHz.

Work around

To prevent this system degradation, do one of the following:

- Add a “Channel ID” to the “Frame Payload” of the MAC layer.
This enables the firmware to filter out unexpected packets.
- Increase the distance between the nodes.
- Reduce the transmitted power of the other nodes.

Date Codes that pertain to this issue

All engineering and production devices.

4. Module: RX MAC

After initializing the MRF24J40 and after successful reception and transmission of packets, the module suddenly stops receiving packets. At this stage, all register settings, SPI operations, and interrupts appear normal. Performing a reset on the module restores communications.

This issue is seen on a very small percentage (<1%) of MRF24J40 modules (MRF24J40MA, MB, MC, MD, and ME). The issue is random and intermittent, which means that the time of the apparent issue only occurs at random times. A deterministic test has not been found to isolate the issue.

Work around

Please ensure that the Initialization settings for MRF24J40 are used as described in section 3.2 of the MRF24J40 Data Sheet (DS30009776C). Specifically, use the following settings for the registers as these control the internal frequency synthesizer in the MRF24J40:

RFCON0 (0x200) = 0x03 - Initialize RFOPT = 0x03

RFCON1 (0x201) = 0x02 - Initialize VCOOPT = 0x02

If the issue persists after performing the settings, one of the following workarounds can be implemented based on the type of customer application:

- Reprogram the channel information (refer to the steps in Programming Channel Information) if the receiver is dormant (without receiving any packets). For example, if the device must receive a packet in a determined amount of time but no packet is received during the specified period, the host MCU can reprogram the channel information to resume packet reception.
- In the customer main application while loop, continuously reprogram the channel information.

Reprogramming channel information resets the internal RF State Machine and enables the module to start communicating with other devices.

Programming Channel Information

Perform the following steps:

1. Program RFCON0 (0x200 <7:4>)
2. Reset RF State Machine
RFRST (RFCTL 0x36<2>) = 1
RFRST (RFCTL 0x36<2>) = 0
3. Delay at least 192 μ s before attempting to transmit a packet to enable the RF circuitry to calibrate. For more information, refer to Section 3.4 of the MRF24J40 Data Sheet.

Applications using MiWi™ Stack can call the MiApp function to perform the programming channel information:

```
MiApp_SetChannel(uint8_t channelNum)
```

Date Codes that pertain to this issue

Issue appears in modules with MRF24J40 date codes from the year 2013 to present.

5. Module: RX MAC SLEEP

Transmission and reception of packets may not be successful under certain conditions, if the WAKE pin on the device is used to wake up the device from sleep.

For example: performing a *sleep* → *Wake-up (using the WAKE pin)* → *Transmission of Packet* on MRF24J40.

Work around

The following is the work around for such scenarios:

1. Perform an external hardware reset, by asserting the $\overline{\text{RESET}}$ pin 13 low. The MRF24J40 will be released from reset approximately 250 us after the $\overline{\text{RESET}}$ pin is released.
2. Perform a Software Reset on MRF24J40, SOFTRST (0x2A) = 0x07.
3. Re-initialize the RF configuration in the Application.

Applications using MiWi Stack can call the MiApp function to perform the preceding work around by enabling a macro, which enables the wake up of MRF24J40 using $\overline{\text{RESET}}$ pin 13.

In the “bool MiMAC_PowerState(uint8_t PowerState)” function, modify the case POWER_STATE_OPERATE to disable wake up from WAKE pin and enable the wake up from the $\overline{\text{RESET}}$ pin.

6. Module: Operating Voltage

Device may not reliably operate at operating voltage <3.0V across the entire operating temperature range (-40 to +85 °C).

Work around

Operating voltage must be $\geq 3.0\text{V}$ for reliable operation. Minimum operating voltage of the device is revised to 3.0V.

APPENDIX A: DOCUMENT REVISION HISTORY

Rev A Document (12/2006)

Original revision. Silicon errata issues 1 (RX MAC), 2 (SPI Interface), 3 (Security Module) and 4 (TX/RX PHY).

Rev B Document (4/2007)

Added silicon issue 5 (SPI Interface).

Rev C Document (3/2009)

Removed silicon issues 2 (SPI Interface, SDO pin) and 4 (TX/RX PHY) which were assimilated into the data sheet. Deleted issue 5 (SPI Interface). Added issue 3 (RX MAC).

Rev D Document (6/2015)

Added silicon issue 4 (RX MAC).

Rev E Document (5/2019)

Added silicon issue 5 (RX MAC)

Rev F Document (8/2019)

- Added silicon issue 6 (Operating Voltage)
- Updated referenced data sheet DS number

THE MICROCHIP WEBSITE

Microchip provides online support via our WWW site at www.microchip.com. This website is used as a means to make files and information easily available to customers. Accessible by using your favorite Internet browser, the website contains the following information:

- **Product Support** – Data sheets and errata, application notes and sample programs, design resources, user's guides and hardware support documents, latest software releases and archived software
- **General Technical Support** – Frequently Asked Questions (FAQ), technical support requests, online discussion groups, Microchip consultant program member listing
- **Business of Microchip** – Product selector and ordering guides, latest Microchip press releases, listing of seminars and events, listings of Microchip sales offices, distributors and factory representatives

CUSTOMER CHANGE NOTIFICATION SERVICE

Microchip's customer notification service helps keep customers current on Microchip products. Subscribers will receive e-mail notification whenever there are changes, updates, revisions or errata related to a specified product family or development tool of interest.

To register, access the Microchip website at www.microchip.com. Under "Support", click on "Customer Change Notification" and follow the registration instructions.

CUSTOMER SUPPORT

Users of Microchip products can receive assistance through several channels:

- Distributor or Representative
- Local Sales Office
- Field Application Engineer (FAE)
- Technical Support

Customers should contact their distributor, representative or Field Application Engineer (FAE) for support. Local sales offices are also available to help customers. A listing of sales offices and locations is included in the back of this document.

Technical support is available through the website at: <http://microchip.com/support>

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as “unbreakable.”

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

Trademarks

The Microchip name and logo, the Microchip logo, Adaptec, AnyRate, AVR, AVR logo, AVR Freaks, BesTime, BitCloud, chipKIT, chipKIT logo, CryptoMemory, CryptoRF, dsPIC, FlashFlex, flexPWR, HELDO, IGLOO, JukeBlox, KeeLoq, Klear, LANCheck, LinkMD, maXStylus, maXTouch, MediaLB, megaAVR, Microsemi, Microsemi logo, MOST, MOST logo, MPLAB, OptoLyzer, PackeTime, PIC, picoPower, PICSTART, PIC32 logo, PolarFire, Prochip Designer, QTouch, SAM-BA, SenGenuity, SpyNIC, SST, SST Logo, SuperFlash, Symmetricom, SyncServer, Tachyon, TempTrackr, TimeSource, tinyAVR, UNI/O, Vectron, and XMEGA are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

APT, ClockWorks, The Embedded Control Solutions Company, EtherSynch, FlashTec, Hyper Speed Control, HyperLight Load, IntelliMOS, Libero, motorBench, mTouch, Powermite 3, Precision Edge, ProASIC, ProASIC Plus, ProASIC Plus logo, Quiet-Wire, SmartFusion, SyncWorld, Temux, TimeCesium, TimeHub, TimePictra, TimeProvider, Vite, WinPath, and ZL are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Adjacent Key Suppression, AKS, Analog-for-the-Digital Age, Any Capacitor, AnyIn, AnyOut, BlueSky, BodyCom, CodeGuard, CryptoAuthentication, CryptoAutomotive, CryptoCompanion, CryptoController, dsPICDEM, dsPICDEM.net, Dynamic Average Matching, DAM, ECAN, EtherGREEN, In-Circuit Serial Programming, ICSP, INICnet, Inter-Chip Connectivity, JitterBlocker, KlearNet, KlearNet logo, memBrain, Mindi, MiWi, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach, Omniscient Code Generation, PICDEM, PICDEM.net, PICKit, PICtail, PowerSmart, PureSilicon, QMatrix, REAL ICE, Ripple Blocker, SAM-ICE, Serial Quad I/O, SMART-I.S., SQI, SuperSwitcher, SuperSwitcher II, Total Endurance, TSHARC, USBCheck, VariSense, ViewSpan, WiperLock, Wireless DNA, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

The Adaptec logo, Frequency on Demand, Silicon Storage Technology, and Symmcom are registered trademarks of Microchip Technology Inc. in other countries.

GestIC is a registered trademark of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2019, Microchip Technology Incorporated, All Rights Reserved.

ISBN: 978-1-5224-4927-0

For information regarding Microchip's Quality Management Systems, please visit www.microchip.com/quality.



MICROCHIP

Worldwide Sales and Service

AMERICAS

Corporate Office
2355 West Chandler Blvd.
Chandler, AZ 85224-6199
Tel: 480-792-7200
Fax: 480-792-7277
Technical Support:
<http://www.microchip.com/support>
Web Address:
www.microchip.com

Atlanta

Duluth, GA
Tel: 678-957-9614
Fax: 678-957-1455

Austin, TX

Tel: 512-257-3370

Boston

Westborough, MA
Tel: 774-760-0087
Fax: 774-760-0088

Chicago

Itasca, IL
Tel: 630-285-0071
Fax: 630-285-0075

Dallas

Addison, TX
Tel: 972-818-7423
Fax: 972-818-2924

Detroit

Novi, MI
Tel: 248-848-4000

Houston, TX

Tel: 281-894-5983

Indianapolis

Noblesville, IN
Tel: 317-773-8323
Fax: 317-773-5453
Tel: 317-536-2380

Los Angeles

Mission Viejo, CA
Tel: 949-462-9523
Fax: 949-462-9608
Tel: 951-273-7800

Raleigh, NC

Tel: 919-844-7510

New York, NY

Tel: 631-435-6000

San Jose, CA

Tel: 408-735-9110
Tel: 408-436-4270

Canada - Toronto

Tel: 905-695-1980
Fax: 905-695-2078

ASIA/PACIFIC

Australia - Sydney
Tel: 61-2-9868-6733

China - Beijing
Tel: 86-10-8569-7000

China - Chengdu
Tel: 86-28-8665-5511

China - Chongqing
Tel: 86-23-8980-9588

China - Dongguan
Tel: 86-769-8702-9880

China - Guangzhou
Tel: 86-20-8755-8029

China - Hangzhou
Tel: 86-571-8792-8115

China - Hong Kong SAR
Tel: 852-2943-5100

China - Nanjing
Tel: 86-25-8473-2460

China - Qingdao
Tel: 86-532-8502-7355

China - Shanghai
Tel: 86-21-3326-8000

China - Shenyang
Tel: 86-24-2334-2829

China - Shenzhen
Tel: 86-755-8864-2200

China - Suzhou
Tel: 86-186-6233-1526

China - Wuhan
Tel: 86-27-5980-5300

China - Xian
Tel: 86-29-8833-7252

China - Xiamen
Tel: 86-592-2388138

China - Zhuhai
Tel: 86-756-3210040

ASIA/PACIFIC

India - Bangalore
Tel: 91-80-3090-4444

India - New Delhi
Tel: 91-11-4160-8631

India - Pune
Tel: 91-20-4121-0141

Japan - Osaka
Tel: 81-6-6152-7160

Japan - Tokyo
Tel: 81-3-6880-3770

Korea - Daegu
Tel: 82-53-744-4301

Korea - Seoul
Tel: 82-2-554-7200

Malaysia - Kuala Lumpur
Tel: 60-3-7651-7906

Malaysia - Penang
Tel: 60-4-227-8870

Philippines - Manila
Tel: 63-2-634-9065

Singapore
Tel: 65-6334-8870

Taiwan - Hsin Chu
Tel: 886-3-577-8366

Taiwan - Kaohsiung
Tel: 886-7-213-7830

Taiwan - Taipei
Tel: 886-2-2508-8600

Thailand - Bangkok
Tel: 66-2-694-1351

Vietnam - Ho Chi Minh
Tel: 84-28-5448-2100

EUROPE

Austria - Wels
Tel: 43-7242-2244-39
Fax: 43-7242-2244-393

Denmark - Copenhagen
Tel: 45-4450-2828
Fax: 45-4485-2829

Finland - Espoo
Tel: 358-9-4520-820

France - Paris
Tel: 33-1-69-53-63-20
Fax: 33-1-69-30-90-79

Germany - Garching
Tel: 49-8931-9700

Germany - Haan
Tel: 49-2129-3766400

Germany - Heilbronn
Tel: 49-7131-72400

Germany - Karlsruhe
Tel: 49-721-625370

Germany - Munich
Tel: 49-89-627-144-0
Fax: 49-89-627-144-44

Germany - Rosenheim
Tel: 49-8031-354-560

Israel - Ra'anana
Tel: 972-9-744-7705

Italy - Milan
Tel: 39-0331-742611
Fax: 39-0331-466781

Italy - Padova
Tel: 39-049-7625286

Netherlands - Drunen
Tel: 31-416-690399
Fax: 31-416-690340

Norway - Trondheim
Tel: 47-7288-4388

Poland - Warsaw
Tel: 48-22-3325737

Romania - Bucharest
Tel: 40-21-407-87-50

Spain - Madrid
Tel: 34-91-708-08-90
Fax: 34-91-708-08-91

Sweden - Gothenberg
Tel: 46-31-704-60-40

Sweden - Stockholm
Tel: 46-8-5090-4654

UK - Wokingham
Tel: 44-118-921-5800
Fax: 44-118-921-5820