

MCP2140

MCP2140 Rev. A Silicon/Data Sheet Errata

The MCP2140 Rev. A parts you have received conform functionally to the MCP2140 device data sheets (DS21790**A**), with the exception of the anomaly described below.

These issues has been addressed in the MCP2140 Rev. B devices.

1. IR Protocol Handler

Increased number of BOF characters to 11 when in Normal Disconnect Mode (NDM). The IrDA® standard required delay was met, but there were reports of some Primary devices desiring to "see" 11 BOF characters.

Work around

None.

2. IR Protocol Handler

During IR communication from the MCP2140 to the Primary device, if a frame with "data" is corrupted, the IR link will be dropped.

Work around

None.

If the link is dropped, have a method to reconnect the IR link.


To minimize the IR link being dropped, have the embedded system (MCP2140) and the Primary device held stable. Also minimize any obstructions occurring between the Primary device and Secondary device IR transceivers.

Clarifications/Corrections to the Data Sheet:

In the MCP2140 device data sheet (DS21790**A**), the following clarifications and corrections should be noted:

1. Figure 2-12 should be corrected to the circuit shown in Figure 1.

FIGURE 1: CIRCUIT FOR AN INTEGRATED OPTICAL TRANSCEIVER

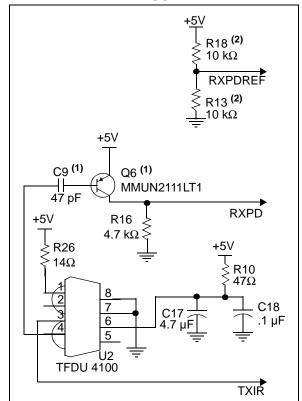

Note 1: These components are used to control the width of the TFDU 4100 RXD output signal

2: These components are used to set the reference voltage that the RXPD signal needs to cross to detect a bit.

MCP2140

APPENDIX A: REVISION HISTORY

Revision A (May 2005)

• Initial Release of this Document.

APPENDIX B: SILICON REVISION HISTORY

The following table and package marking information illustrates how to determine the revision of the MCP2140 device. The revision information can be determined by the Year and Week Code of the manufacture, printed on the device as shown in Table B-1. The revision information is also available via the IrDA standard device ID.

TABLE B-1: SILICON REVISION/DEVICE MARKING

Silicon Revision	YYWWNNN		Device ID	
	Start Date	End Date	Device iD	
Rev B	0512NNN ⁽²⁾	_	"MCP2140 Bx" (Note 1)	
Rev A	_	0515NNN	"MCP2140 Ax" (Note 1)	


Legend: "N" is any alphanumeric character.

Note 1: The "x" indicates the sub rev of the devices (such as A5 or B0).


2: For this small overlap, the easiest way to determine the device revision is with the device ID that the device transmits during the NDM/Discover modes of the connection sequence. A PC with an IR port will display this information when the mouse cursor is placed over the IR icon in the system tray.

Package Marking Information

18-Lead PDIP

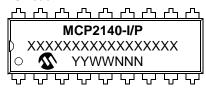

18-Lead SOIC

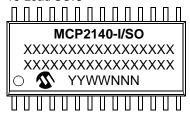

20-Lead SSOP



Legend:	XXX	Customer-specific information*	
	Υ	Year code	
		(last digit of calendar year)	
	YY	Year code	
		(last 2 digits of calendar year)	
	WW	Week code	
		(week of January 1 is week '01')	
	NNN	Alphanumeric traceability code	
		Pb-free JEDEC designator for	
		Matte Tin (Sn)	
	(e3)	This package is Pb-free.	
		The Pb-free JEDEC designator	
		(e3) can be found on the outer	
		packaging for this package.	

Note: In the event the full Microchip part number cannot be marked on one line, it will be carried over to the next line, thus limiting the number of available characters for customer-specific information.

MCP2140

NOTES:

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not
 mean that we are guaranteeing the product as "unbreakable."

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WAR-RANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip's products as critical components in life support systems is not authorized except with express written approval by Microchip. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights.

Trademarks

The Microchip name and logo, the Microchip logo, Accuron, dsPIC, KEELOQ, microID, MPLAB, PIC, PICmicro, PICSTART, PRO MATE, PowerSmart, rfPIC, and SmartShunt are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

AmpLab, FilterLab, Migratable Memory, MXDEV, MXLAB, PICMASTER, SEEVAL, SmartSensor and The Embedded Control Solutions Company are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Analog-for-the-Digital Age, Application Maestro, dsPICDEM, dsPICDEM.net, dsPICworks, ECAN, ECONOMONITOR, FanSense, FlexROM, fuzzyLAB, In-Circuit Serial Programming, ICSP, ICEPIC, Linear Active Thermistor, MPASM, MPLIB, MPLINK, MPSIM, PICkit, PICDEM, PICDEM.net, PICLAB, PICtail, PowerCal, PowerInfo, PowerMate, PowerTool, rfLAB, rfPICDEM, Select Mode, Smart Serial, SmartTel, Total Endurance and WiperLock are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the $\mbox{U.S.A.}$

All other trademarks mentioned herein are property of their respective companies.

© 2005, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.

Printed on recycled paper.

QUALITY MANAGEMENT SYSTEM
CERTIFIED BY DNV

ISO/TS 16949:2002

Microchip received ISO/TS-16949:2002 quality system certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona and Mountain View, California in October 2003. The Company's quality system processes and procedures are for its PICmicro® 8-bit MCUs, KEELoo® code hopping devices, Serial EEPROMs, microperipherals, nonvolatile memory and analog products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001:2000 certified.



WORLDWIDE SALES AND SERVICE

AMERICAS

Corporate Office

2355 West Chandler Blvd. Chandler, AZ 85224-6199 Tel: 480-792-7200

Fax: 480-792-7277 Technical Support:

http://support.microchip.com

Web Address: www.microchip.com

Atlanta

Alpharetta, GA Tel: 770-640-0034 Fax: 770-640-0307

Boston

Westborough, MA Tel: 774-760-0087 Fax: 774-760-0088

Chicago Itasca, IL

Tel: 630-285-0071 Fax: 630-285-0075

Dallas

Addison, TX Tel: 972-818-7423 Fax: 972-818-2924

Detroit

Farmington Hills, MI Tel: 248-538-2250 Fax: 248-538-2260

Kokomo

Kokomo, IN Tel: 765-864-8360 Fax: 765-864-8387

Los Angeles

Mission Viejo, CA Tel: 949-462-9523 Fax: 949-462-9608

San Jose

Mountain View, CA Tel: 650-215-1444 Fax: 650-961-0286

Toronto

Mississauga, Ontario,

Canada

Tel: 905-673-0699 Fax: 905-673-6509

ASIA/PACIFIC

Australia - Sydney

Tel: 61-2-9868-6733 Fax: 61-2-9868-6755

China - Beijing

Tel: 86-10-8528-2100 Fax: 86-10-8528-2104

China - Chengdu

Tel: 86-28-8676-6200 Fax: 86-28-8676-6599

China - Fuzhou

Tel: 86-591-8750-3506 Fax: 86-591-8750-3521

China - Hong Kong SAR

Tel: 852-2401-1200 Fax: 852-2401-3431

China - Shanghai Tel: 86-21-5407-5533 Fax: 86-21-5407-5066

China - Shenyang Tel: 86-24-2334-2829 Fax: 86-24-2334-2393

China - Shenzhen

Tel: 86-755-8203-2660 Fax: 86-755-8203-1760

China - Shunde

Tel: 86-757-2839-5507 Fax: 86-757-2839-5571

China - Qingdao

Tel: 86-532-502-7355 Fax: 86-532-502-7205

ASIA/PACIFIC

India - Bangalore

Tel: 91-80-2229-0061 Fax: 91-80-2229-0062

India - New Delhi

Tel: 91-11-5160-8631 Fax: 91-11-5160-8632

Japan - Kanagawa

Tel: 81-45-471- 6166 Fax: 81-45-471-6122

Korea - Seoul

Tel: 82-2-554-7200 Fax: 82-2-558-5932 or 82-2-558-5934

Malaysia - Penang

Tel:011-604-646-8870 Fax:011-604-646-5086

Philippines - Manila

Tel: 011-632-634-9065 Fax: 011-632-634-9069

Singapore

Tel: 65-6334-8870 Fax: 65-6334-8850

Taiwan - Kaohsiung

Tel: 886-7-536-4818 Fax: 886-7-536-4803 Taiwan - Taipei

Tel: 886-2-2500-6610

Fax: 886-2-2508-0102 **Taiwan - Hsinchu** Tel: 886-3-572-9526

Fax: 886-3-572-6459

EUROPE

Austria - Weis

Tel: 43-7242-2244-399 Fax: 43-7242-2244-393 **Denmark - Ballerup**

Tel: 45-4450-2828 Fax: 45-4485-2829

France - Massy

Tel: 33-1-69-53-63-20 Fax: 33-1-69-30-90-79

Germany - Ismaning

Tel: 49-89-627-144-0 Fax: 49-89-627-144-44

Italy - Milan

Tel: 39-0331-742611 Fax: 39-0331-466781

Netherlands - Drunen Tel: 31-416-690399

Fax: 31-416-690340 England - Berkshire

Tel: 44-118-921-5869 Fax: 44-118-921-5820

04/20/05