

# **AM571x (SR 2.0, 1.0) and AM570x (SR 2.0) Sitara™ Processors**

**Texas Instruments Sitara™ Family of Products**

## **Silicon Errata**



Literature Number: SPRZ436C  
October 2015–Revised February 2017

---

---

---

|                            |    |
|----------------------------|----|
| Revision History .....     | 4  |
| 1 Introduction.....        | 7  |
| 2 Silicon Advisories ..... | 12 |
| 3 Silicon Limitations..... | 80 |
| 4 Silicon Cautions .....   | 93 |

## List of Figures

|      |                |    |
|------|----------------|----|
| 4-1. | PAB_RevA ..... | 98 |
|------|----------------|----|

## List of Tables

|      |                                                               |    |
|------|---------------------------------------------------------------|----|
| 1-1. | Silicon Advisories, Limitations, and Cautions by Module ..... | 9  |
| 2-1. | Workaround/Load mode settings .....                           | 24 |
| 2-2. | ConnID Values.....                                            | 54 |

## Revision History

| Changes from B Revision (January 2017) to C Revision                                                                                             | Page |
|--------------------------------------------------------------------------------------------------------------------------------------------------|------|
| • Updated Title page and Related Documents section to include information about AM570x. ....                                                     | 1    |
| • Updated to add Revisions Impacted of AM570x i202: MDR1 Access Can Freeze UART Module .....                                                     | 14   |
| • Updated to add Revisions Impacted of AM570x i378: sDMA Channel Is Not Disabled after a Transaction Error .....                                 | 15   |
| • Updated to add Revisions Impacted of AM570x i631: Wrong Access in 1D Burst for YUV4:2:0-NV12 Format .....                                      | 16   |
| • Updated to add Revisions Impacted of AM570x i694: System I2C Hang Due to Miss of Bus Clear Support.....                                        | 17   |
| • Updated to add Revisions Impacted of AM570x i698: DMA4 Generates Unexpected Transaction on WR Port .....                                       | 18   |
| • Updated to add Revisions Impacted of AM570x i699: DMA4 Channel Fails to Continue with Descriptor Load When Pause Bit Is Cleared .....          | 20   |
| • Updated to add Revisions Impacted of AM570x i709: CSI-2 Receiver Executes Software Reset Unconditionally .....                                 | 21   |
| • Updated i727: Refresh Rate Issue after Warm Reset .....                                                                                        | 22   |
| • Updated to add Revisions Impacted of AM570x i727: Refresh Rate Issue after Warm Reset.....                                                     | 22   |
| • Updated i729: DDR Access Hang after Warm Reset .....                                                                                           | 23   |
| • Updated to add Revisions Impacted of AM570x i729: DDR Access Hang after Warm Reset .....                                                       | 23   |
| • Updated to add Revisions Impacted of AM570x i734: LCD1 Gamma Correction Is Not Working When GFX Pipe Is Disabled.....                          | 24   |
| • Updated to add Revisions Impacted of AM570x i767: Delay Needed to Read Some Timer Registers after Wakeup .....                                 | 25   |
| • Updated to add Revisions Impacted of AM570x i802: MMCHS DCRC Errors During Tuning Procedure .....                                              | 28   |
| • Updated to add Revisions Impacted of AM570x i803: MMCHS Read Transfer with CMD23 Never Complete When BCE=0 And ADMA Used .....                 | 29   |
| • Updated to add Revisions Impacted of AM570x i810: DPLL Controller Can Get Stuck While Transitioning to a Power Saving State .....              | 33   |
| • Updated to add Revisions Impacted of AM570x i813: Spurious Thermal Alert Generation When Temperature Remains in Expected Range .....           | 34   |
| • Updated to add Revisions Impacted of AM570x i814: Bandgap Temperature Read Dtemp Can Be Corrupted .....                                        | 35   |
| • Updated to add Revisions Impacted of AM570x i815: Power Management Enhancement Implemented Inside DSS Leads to DSS Underflows .....            | 36   |
| • Updated to add Revisions Impacted of AM570x i819: A Device Control Bit Meta-Stability for USB3.0 Controller in USB2.0 Mode.....                | 38   |
| • Updated to add Revisions Impacted of AM570x i820: Unexpected USB Link State Value upon U3 Exit by USB3.0 Link .....                            | 39   |
| • Updated to add Revisions Impacted of AM570x i824: USB3.0 Link Cannot Be Established When Suspend Mode Is Enabled .....                         | 40   |
| • Updated to add Revisions Impacted of AM570x i826: HSDIVIDER1 CLKOUT4 Could Glitch During On-the-Fly Divider Change to/from Divide-by-2.5 ..... | 41   |
| • Updated to add Revisions Impacted of AM570x i829: Reusing Pipe Connected to Writeback Pipeline On -the-Fly to an Active Panel .....            | 42   |
| • Updated to add Revisions Impacted of AM570x i834: MMCHS HS200 and SDR104 Command Timeout Window Too Small.....                                 | 43   |
| • Updated to add Revisions Impacted of AM570x i849: UART2_RXD Is Not Working for MUXMODE=0 .....                                                 | 44   |
| • Updated to add Revisions Impacted of AM570x i856: 32k Oscillator Fails to Start-Up at POR.....                                                 | 45   |
| • Added Note about AM570x specific feature i856: 32k Oscillator Fails to Start-Up at POR.....                                                    | 45   |
| • Updated i862: Reset Should Use PORz.....                                                                                                       | 46   |
| • Updated to add Revisions Impacted of AM570x i862: Reset Should Use PORz .....                                                                  | 46   |
| • Updated i863: MMC2 Has PU/PD Contention Immediately after Release from Reset.....                                                              | 48   |
| • Updated to add Revisions Impacted of AM570x i863: MMC2 Has PU/PD Contention Immediately after Release from Reset .....                         | 48   |
| • Updated to add Revisions Impacted of AM570x i869: IO Glitches Can Occur When Changing IO Settings .....                                        | 52   |
| • Updated to add Revisions Impacted of AM570x i870: PCIe Unaligned Read Access Issue .....                                                       | 53   |
| • Updated to add Revisions Impacted of AM570x i871: L4_PER3 Firewall Initiator ConnID Value Left-Shift 1-Bit .....                               | 54   |
| • Updated to add Revisions Impacted of AM570x i872: DSP MFlag Output Not Initialized .....                                                       | 55   |
| • Updated to add Revisions Impacted of AM570x i874: TIMER5/6/7/8 Interrupts Not Propagated .....                                                 | 56   |
| • Updated to add Revisions Impacted of AM570x i878: MPU Lockup with Concurrent DMM and EMIF Accesses.....                                        | 58   |

|                                                                                                                                                        |     |
|--------------------------------------------------------------------------------------------------------------------------------------------------------|-----|
| • Updated to add Revisions Impacted of AM570x i879: DSP MStandby Requires CD_EMU in SW_WKUP .....                                                      | 59  |
| • Updated to add Revisions Impacted of AM570x i883: DSP Doesn't Wake from Subsystem Internal Interrupts.....                                           | 62  |
| • Updated to add Revisions Impacted of AM570x i887: MMC3 Speed Limited to 64 MHz.....                                                                  | 63  |
| • Updated to add Revisions Impacted of AM570x i889: UART Does Not Acknowledge Idle Request after DMA Has Been Enabled .....                            | 64  |
| • Updated to add Revisions Impacted of AM570x i890: MMC1 IOs and PBIAS Must Be Powered-Up Before Isolation ....                                        | 65  |
| • Updated to add Revisions Impacted of AM570x i893: DCAN Initialization Sequence .....                                                                 | 66  |
| • Updated to add Revisions Impacted of AM570x i896: USB xHCI Port Disable Feature Does Not Work.....                                                   | 68  |
| • Updated to add Revisions Impacted of AM570x i897: USB xHCI Stop Endpoint Command Does Not Work In Certain Circumstances .....                        | 69  |
| • Updated to add Revisions Impacted of AM570x i898: DSP Pre-fetch Should Be Disabled before Entering Power Down Mode.....                              | 70  |
| • Updated to add Revisions Impacted of AM570x i899: Ethernet DLR Is Not Supported .....                                                                | 71  |
| • Updated to add Revisions Impacted of AM570x i900: SoC Will Hang If Region 5 Accessed While CTRL_CORE_MMR_LOCK_5 Is Locked.....                       | 72  |
| • Updated to add Revisions Impacted of AM570x i903: Ethernet RMII Interface RMII_MHZ_50_CLK Not Supported as Output Reference Clock .....              | 73  |
| • Updated to add Revisions Impacted of AM570x i904: CSI Interface Setup/Hold Timing Does Not Meet MIPI DPHY Spec above 600MHz .....                    | 74  |
| • Added Note about AM570x specific feature i904: CSI Interface Setup/Hold Timing Does Not Meet MIPI DPHY Spec above 600MHz .....                       | 74  |
| • Updated to add Revisions Impacted of AM570x i916: QSPI Reads Can Fail For Flash Devices with HOLD Function ...                                       | 78  |
| • Updated to add Revisions Impacted of AM570x i927: SoC Doesn't Read Redundant ONFI Parameter Pages in NAND Boot .....                                 | 79  |
| • Updated to add Revisions Impacted of AM570x i596: BITMAP1-2-4 Formats Not Supported by The Graphics Pipeline                                         | 81  |
| • Updated to add Revisions Impacted of AM570x i641: Overlay Optimization Limitations .....                                                             | 82  |
| • Updated to add Revisions Impacted of AM570x i833: I2C Module in Multislave Mode Potentially Acknowledges Wrong Address .....                         | 83  |
| • Updated to add Revisions Impacted of AM570x i838: DSS BT.656/BT.1120 Max Horizontal Blanking is Non Compliant .....                                  | 84  |
| • Added Note about AM570x specific feature i838: DSS BT.656/BT.1120 Max Horizontal Blanking is Non Compliant ....                                      | 84  |
| • Updated to add Revisions Impacted of AM570x i845: USB2.0 False Detection of Disconnect Condition.....                                                | 85  |
| • Updated to add Revisions Impacted of AM570x i848: McASP IO Pad Loopback Not Functional .....                                                         | 86  |
| • Updated to add Revisions Impacted of AM570x i876: DVFS Only Supported on MPU .....                                                                   | 87  |
| • Updated to add Revisions Impacted of AM570x i877: RGMII Clocks Should Be Enabled at Boot Time .....                                                  | 88  |
| • Updated to add Revisions Impacted of AM570xd i892: L3 Clocks Should Be Enabled at All Times.....                                                     | 89  |
| • Updated to add Revisions Impacted of AM570x i909: PCIe Unintentional Translation of Outbound Message TLPs.....                                       | 90  |
| • Updated to add Revisions Impacted of AM570x i922: Usability of ECC Feature in the DDR Controller is Limited .....                                    | 91  |
| • Updated to add Revisions Impacted of AM570x i925: PCI-Express Gen2 (5.0 GT/s) Operation Not Supported When Operating Junction Temperature <0°C ..... | 92  |
| • Updated i827: Thermal Alert Will Not Be Generated When Bandgap Is Configured in "Smart Idle" Mode .....                                              | 94  |
| • Updated to add Revisions Impacted of AM570x i827: Thermal Alert Will Not Be Generated When Bandgap Is Configured in "Smart Idle" Mode .....          | 94  |
| • Updated to add Revisions Impacted of AM570x i832: DLL SW Reset Bit Does Not Reset to 0 after Execution .....                                         | 95  |
| • Updated to add Revisions Impacted of AM570x i836: Bus Testing Commands CMD19 Incorrectly Waits for CRC Status Return .....                           | 96  |
| • Updated to add Revisions Impacted of AM570x i839: Some RGB and YUV Formats Have Non-Standard Ordering .....                                          | 97  |
| • Updated to add Revisions Impacted of AM570x i864: VDD518V to VDDSHVn Current Path .....                                                              | 98  |
| • Updated to add Revisions Impacted of AM570x i885: Software Requirements for Data Manual IO Timing .....                                              | 100 |
| • Updated to add Revisions Impacted of AM570x i886: FPDLink PLL Unlocks with Certain SoC PLL M/N Values.....                                           | 101 |
| • Updated to add Revisions Impacted of AM570x i912: QSPI_SPI_CMD_REG [25:24] Masked from Read in RTL.....                                              | 102 |
| • Updated to add Revisions Impacted of AM570x i918: Dual-rank DDR with Twin Die Configuration is Not Supported ..                                      | 103 |
| • Added Note about AM570x specific feature i918: Dual-rank DDR with Twin Die Configuration is Not Supported.....                                       | 103 |
| • Updated to add Revisions Impacted of AM570x i920: DSS VOUT1, VOUT2, and VOUT3 Supported Only at 1.8V.....                                            | 104 |
| • Added Note about AM570x specific feature i920: DSS VOUT1, VOUT2, and VOUT3 Supported Only at 1.8V .....                                              | 104 |
| • Updated to add Revisions Impacted of AM570x i921: Limited GPMC Use Case Supported at 3.3V.....                                                       | 105 |

- 
- Updated to add Revisions Impacted of AM570x i926: PCIe Preferred PCIe\_PHY\_RX SCP Register Settings Updated [106](#)
-

## Introduction

---

This document describes the known exceptions to the functional specifications for the device.

### Related Documentation

*AM571x Sitara™ Processors Silicon Revision 2.0, 1.0 Technical Reference Manual ([SPRUHZ7](#))*

*AM571x Sitara™ Processors Silicon Revision 1.0 Data Manual ([SPRS919](#))*

*AM571x Sitara™ Processors Silicon Revision 2.0 Data Manual ([SPRS957](#))*

*AM571x Pin Mux Tool*

*AM571x Clock Tree Tool*

*AM570x Clock Tree Tool*

*AM571x Code Composer Chip Support Packages*

*AM570x Code Composer Chip Support Packages*

*AM571x Lauterbach Package*

## Trademarks

OMAP and C66x are trademarks of Texas Instruments Incorporated.

Cortex is a trademark of ARM Limited.

SD is a registered trademark of Toshiba Corporation.

MMC and eMMC are trademarks of MultiMediaCard Association.

JTAG is a registered trademark of JTAG Technologies, Inc.

Linux is a registered trademark of Linus Torvalds.

MIPI is a registered trademarks of the Mobile Industry Processor Interface (MIPI) Alliance.

All other trademarks are the property of their respective owners.

## Modules Impacted

**Table 1-1. Silicon Advisories, Limitations, and Cautions by Module**

| Module name    | Silicon Advisories, Limitations, and Cautions                                                                           |
|----------------|-------------------------------------------------------------------------------------------------------------------------|
| NA             | i862: <a href="#">Reset Should Use PORz</a>                                                                             |
|                | i864: <a href="#">VDDS18V to VDDSHVn Current Path</a>                                                                   |
| BOOT           | i875: <a href="#">Power-on-Reset (PORz) Warm Boot Hang</a>                                                              |
|                | i927: <a href="#">SoC Doesn't Read Redundant ONFI Parameter Pages in NAND Boot Mode</a>                                 |
| CAMSS          | i709: <a href="#">CSI-2 Receiver Executes Software Reset Unconditionally</a>                                            |
|                | i904: <a href="#">CSI Interface Setup/Hold Timing Does Not Meet MIPI DPHY Spec above 600MHz</a>                         |
|                | i913: <a href="#">CSI2 LDO Needs to Be Disabled when Module Is Powered On</a>                                           |
| Control Module | i813: <a href="#">Spurious Thermal Alert Generation When Temperature Remains in Expected Range</a>                      |
|                | i814: <a href="#">Bandgap Temperature Read Dtemp Can Be Corrupted</a>                                                   |
|                | i827: <a href="#">Thermal Alert Will Not Be Generated When Bandgap Is Configured in "Smart Idle" Mode</a>               |
|                | i863: <a href="#">MMC2 Has PU/PD Contention Immediately after Release from Reset</a>                                    |
|                | i869: <a href="#">IO Glitches Can Occur When Changing IO Settings</a>                                                   |
|                | i870: <a href="#">PCIe Unaligned Read Access Issue</a>                                                                  |
|                | i885: <a href="#">Software Requirements for Data Manual IO Timing</a>                                                   |
|                | i900: <a href="#">SoC Will Hang If Region 5 Accessed While CTRL_CORE_MMR_LOCK_5 Is Locked</a>                           |
| DCAN           | i893: <a href="#">DCAN Initialization Sequence</a>                                                                      |
| DEBUG          | i879: <a href="#">DSP MStandby Requires CD_EMU in SW_WKUP</a>                                                           |
| DMA            | i378: <a href="#">sDMA Channel Is Not Disabled after a Transaction Error</a>                                            |
|                | i698: <a href="#">DMA4 Generates Unexpected Transaction on WR Port</a>                                                  |
|                | i699: <a href="#">DMA4 Channel Fails to Continue with Descriptor Load When Pause Bit Is Cleared</a>                     |
|                | i868: <a href="#">McASP to EDMA Synchronization Level Event Can Be Lost</a>                                             |
| DSP            | i872: <a href="#">DSP MFlag Output Not Initialized</a>                                                                  |
|                | i879: <a href="#">DSP MStandby Requires CD_EMU in SW_WKUP</a>                                                           |
|                | i883: <a href="#">DSP Doesn't Wake from Subsystem Internal Interrupts</a>                                               |
|                | i898: <a href="#">DSP Pre-fetch Should Be Disabled before Entering Power Down Mode</a>                                  |
| DSS            | i596: <a href="#">BITMAP1-2-4 Formats Not Supported by The Graphics Pipeline</a>                                        |
|                | i631: <a href="#">Wrong Access in 1D Burst for YUV4:2:0-NV12 Format</a>                                                 |
|                | i641: <a href="#">Overlay Optimization Limitations</a>                                                                  |
|                | i734: <a href="#">LCD1 Gamma Correction Is Not Working When GFX Pipe Is Disabled</a>                                    |
|                | i815: <a href="#">Power Management Enhancement Implemented Inside DSS Leads to DSS Underflows</a>                       |
|                | i829: <a href="#">Reusing Pipe Connected to Writeback Pipeline On -the-Fly to an Active Panel</a>                       |
|                | i838: <a href="#">DSS BT.656/BT.1120 Max Horizontal Blanking is Non Compliant</a>                                       |
|                | i920: <a href="#">DSS VOUT1, VOUT2, and VOUT3 Supported Only at 1.8V</a>                                                |
|                | i921: <a href="#">Limited GPMC Use Case Supported at 3.3V</a>                                                           |
| EDMA           | i868: <a href="#">McASP to EDMA Synchronization Level Event Can Be Lost</a>                                             |
| EMIF           | i727: <a href="#">Refresh Rate Issue after Warm Reset</a>                                                               |
|                | i729: <a href="#">DDR Access Hang after Warm Reset</a>                                                                  |
|                | i878: <a href="#">MPU Lockup with Concurrent DMM and EMIF Accesses</a>                                                  |
|                | i882: <a href="#">EMIF: DDR ECC Corrupted Read/Write Status Response</a>                                                |
|                | i895: <a href="#">EMIF_FW: System Hang When EMIF Firewall Is Reconfigured While There Is Activity on EMIF Interface</a> |
|                | i918: <a href="#">Dual-rank DDR with Twin Die Configuration is Not Supported</a>                                        |
|                | i922: <a href="#">Usability of ECC Feature in the DDR Controller is Limited</a>                                         |
| eMMC/SD/SDIO   | i802: <a href="#">MMCHS DCRC Errors During Tuning Procedure</a>                                                         |
|                | i803: <a href="#">MMCHS Read Transfer with CMD23 Never Complete When BCE=0 And ADMA Used</a>                            |
|                | i832: <a href="#">DLL SW Reset Bit Does Not Reset to 0 after Execution</a>                                              |

**Table 1-1. Silicon Advisories, Limitations, and Cautions by Module (continued)**

| Module name   | Silicon Advisories, Limitations, and Cautions                                                                                        |
|---------------|--------------------------------------------------------------------------------------------------------------------------------------|
|               | i834: <a href="#">MMCHS HS200 and SDR104 Command Timeout Window Too Small</a>                                                        |
|               | i836: <a href="#">Bus Testing Commands CMD19 Incorrectly Waits for CRC Status Return</a>                                             |
|               | i856: <a href="#">32k Oscillator Fails to Start-Up at POR</a>                                                                        |
|               | i863: <a href="#">MMC2 Has PU/PD Contention Immediately after Release from Reset</a>                                                 |
|               | i887: <a href="#">MMC3 Speed Limited to 64 MHz</a>                                                                                   |
|               | i890: <a href="#">MMC1 IOs and PBIAS Must Be Powered-Up Before Isolation</a>                                                         |
| GMAC_SW       | i877: <a href="#">RGMII Clocks Should Be Enabled at Boot Time</a>                                                                    |
|               | i880: <a href="#">Ethernet RGMII2 Limited to 10/100 Mbps</a>                                                                         |
|               | i899: <a href="#">Ethernet DLR Is Not Supported</a>                                                                                  |
|               | i903: <a href="#">Ethernet RMII Interface RMII_MHZ_50_CLK Not Supported as Output Reference Clock</a>                                |
| GPIO          | i856: <a href="#">32k Oscillator Fails to Start-Up at POR</a>                                                                        |
| GPMC          | i927: <a href="#">SoC Doesn't Read Redundant ONFI Parameter Pages in NAND Boot Mode</a>                                              |
| I2C           | i694: <a href="#">System I2C Hang Due to Miss of Bus Clear Support</a>                                                               |
|               | i833: <a href="#">I2C Module in Multislave Mode Potentially Acknowledges Wrong Address</a>                                           |
| INTC          | i883: <a href="#">DSP Doesn't Wake from Subsystem Internal Interrupts</a>                                                            |
| Interconnect  | i871: <a href="#">L4_PER3 Firewall Initiator ConnID Value Left-Shift 1-Bit</a>                                                       |
| McASP         | i848: <a href="#">McASP IO Pad Loopback Not Functional</a>                                                                           |
|               | i868: <a href="#">McASP to EDMA Synchronization Level Event Can Be Lost</a>                                                          |
| MPU           | i878: <a href="#">MPU Lockup with Concurrent DMM and EMIF Accesses</a>                                                               |
| PCIe          | i870: <a href="#">PCIe Unaligned Read Access Issue</a>                                                                               |
|               | i906: <a href="#">USB3.0 and PCIe Gen2 Electrical Compliance</a>                                                                     |
|               | i909: <a href="#">PCIe Unintentional Translation of Outbound Message TLPs</a>                                                        |
|               | i925: <a href="#">PCI-Express Gen2 (5.0 GT/s) Operation Not Supported When Operating Junction Temperature less than 0 deg C</a>      |
|               | i926: <a href="#">PCIe Preferred PCIe_PHY_RX SCP Register Settings Updated</a>                                                       |
| PRCM          | i810: <a href="#">DPLL Controller Can Get Stuck While Transitioning to a Power Saving State</a>                                      |
|               | i826: <a href="#">HSDIVIDER1 CLKOUT4 Could Glitch During On-the-Fly Divider Change to/from Divide-by-2.5</a>                         |
|               | i876: <a href="#">DVFS Only Supported on MPU</a>                                                                                     |
|               | i886: <a href="#">FPDLink PLL Unlocks with Certain SoC PLL M/N Values</a>                                                            |
|               | i892: <a href="#">L3 Clocks Should Be Enabled at All Times</a>                                                                       |
| PRU-ICSS      | i907: <a href="#">PRU-ICSS2 MII1 Port Is Not Supported When PRU-ICSS PRU1 Internal Wrapper Multiplexing Configured for MII2 Mode</a> |
| QSPI          | i912: <a href="#">QSPI_SPI_CMD_REG [25:24] Masked from Read in RTL</a>                                                               |
|               | i916: <a href="#">QSPI Reads Can Fail For Flash Devices with HOLD Function</a>                                                       |
| SATA          | i782: <a href="#">SATA AHCI Command Issue Order</a>                                                                                  |
|               | i783: <a href="#">SATA Lockup after SATA DPLL Unlock/Relock</a>                                                                      |
|               | i807: <a href="#">SATA Host Controller Locks up If PIO Setup FIS Is Received and Bus Busy and Data Request Bits Are Cleared</a>      |
|               | i808: <a href="#">SATA Link Locks up under Certain Conditions</a>                                                                    |
|               | i809: <a href="#">SATA Command Does Not Complete and Software Must Issue a Port Reset Under Certain Conditions</a>                   |
|               | i818: <a href="#">SATA PHY Reset Required Following SATA PLL Unlock</a>                                                              |
| TIMERS        | i767: <a href="#">Delay Needed to Read Some Timer Registers After Wakeup</a>                                                         |
|               | i856: <a href="#">32k Oscillator Fails to Start-Up at POR</a>                                                                        |
|               | i874: <a href="#">TIMER5/6/7/8 Interrupts Not Propagated</a>                                                                         |
| UART/IrDA/CIR | i202: <a href="#">MDR1 Access Can Freeze UART Module</a>                                                                             |
|               | i849: <a href="#">UART2_RXD Is Not Working for MUXMODE=0</a>                                                                         |
|               | i889: <a href="#">UART Does Not Acknowledge Idle Request after DMA Has Been Enabled</a>                                              |
| USB           | i819: <a href="#">A Device Control Bit Meta-Stability for USB3.0 Controller in USB2.0 Mode</a>                                       |

**Table 1-1. Silicon Advisories, Limitations, and Cautions by Module (continued)**

| Module name | Silicon Advisories, Limitations, and Cautions                                               |
|-------------|---------------------------------------------------------------------------------------------|
|             | i820: <a href="#">Unexpected USB Link State Value upon U3 Exit by USB3.0 Link</a>           |
|             | i824: <a href="#">USB3.0 Link Cannot Be Established When Suspend Mode Is Enabled</a>        |
|             | i845: <a href="#">USB2.0 False Detection of Disconnect Condition</a>                        |
|             | i867: <a href="#">USB SuperSpeed LFPS Signal Is Not Compliant with the USB3.0 Standard</a>  |
|             | i896: <a href="#">USB xHCI Port Disable Feature Does Not Work</a>                           |
|             | i897: <a href="#">USB xHCI Stop Endpoint Command Does Not Work in Certain Circumstances</a> |
|             | i906: <a href="#">USB3.0 and PCIe Gen2 Electrical Compliance</a>                            |
| VIP         | i839: <a href="#">Some RGB and YUV Formats Have Non-Standard Ordering</a>                   |
| VPE         | i839: <a href="#">Some RGB and YUV Formats Have Non-Standard Ordering</a>                   |

## Silicon Advisories

This Chapter describes advisories for the given architecture and provides information for working with those issues.

### Revisions SR 2.0, 1.0 - Advisories List

| Title                                                                                                                         | Page |
|-------------------------------------------------------------------------------------------------------------------------------|------|
| <b>i202</b> — MDR1 Access Can Freeze UART Module .....                                                                        | 14   |
| <b>i378</b> — sDMA Channel Is Not Disabled after a Transaction Error .....                                                    | 15   |
| <b>i631</b> — Wrong Access in 1D Burst for YUV4:2:0-NV12 Format .....                                                         | 16   |
| <b>i694</b> — System I2C Hang Due to Miss of Bus Clear Support .....                                                          | 17   |
| <b>i698</b> — DMA4 Generates Unexpected Transaction on WR Port .....                                                          | 18   |
| <b>i699</b> — DMA4 Channel Fails to Continue with Descriptor Load When Pause Bit Is Cleared.....                              | 20   |
| <b>i709</b> — CSI-2 Receiver Executes Software Reset Unconditionally .....                                                    | 21   |
| <b>i727</b> — Refresh Rate Issue after Warm Reset .....                                                                       | 22   |
| <b>i729</b> — DDR Access Hang after Warm Reset .....                                                                          | 23   |
| <b>i734</b> — LCD1 Gamma Correction Is Not Working When GFX Pipe Is Disabled .....                                            | 24   |
| <b>i767</b> — Delay Needed to Read Some Timer Registers After Wakeup.....                                                     | 25   |
| <b>i782</b> — SATA AHCI Command Issue Order.....                                                                              | 26   |
| <b>i783</b> — SATA Lockup after SATA DPLL Unlock/Relock.....                                                                  | 27   |
| <b>i802</b> — MMCHS DCRC Errors During Tuning Procedure .....                                                                 | 28   |
| <b>i803</b> — MMCHS Read Transfer with CMD23 Never Complete When BCE=0 And ADMA Used .....                                    | 29   |
| <b>i807</b> — SATA Host Controller Locks up If PIO Setup FIS Is Received and Bus Busy and Data Request Bits Are Cleared ..... | 30   |
| <b>i808</b> — SATA Link Locks up under Certain Conditions.....                                                                | 31   |
| <b>i809</b> — SATA Command Does Not Complete and Software Must Issue a Port Reset Under Certain Conditions .....              | 32   |
| <b>i810</b> — DPLL Controller Can Get Stuck While Transitioning to a Power Saving State.....                                  | 33   |
| <b>i813</b> — Spurious Thermal Alert Generation When Temperature Remains in Expected Range .....                              | 34   |
| <b>i814</b> — Bandgap Temperature Read Dtemp Can Be Corrupted .....                                                           | 35   |
| <b>i815</b> — Power Management Enhancement Implemented Inside DSS Leads to DSS Underflows.....                                | 36   |
| <b>i818</b> — SATA PHY Reset Required Following SATA PLL Unlock .....                                                         | 37   |
| <b>i819</b> — A Device Control Bit Meta-Stability for USB3.0 Controller in USB2.0 Mode .....                                  | 38   |
| <b>i820</b> — Unexpected USB Link State Value upon U3 Exit by USB3.0 Link.....                                                | 39   |
| <b>i824</b> — USB3.0 Link Cannot Be Established When Suspend Mode Is Enabled .....                                            | 40   |
| <b>i826</b> — HSDIVIDER1 CLKOUT4 Could Glitch During On-the-Fly Divider Change to/from Divide-by-2.5 .....                    | 41   |
| <b>i829</b> — Reusing Pipe Connected to Writeback Pipeline On -the-Fly to an Active Panel.....                                | 42   |
| <b>i834</b> — MMCHS HS200 and SDR104 Command Timeout Window Too Small .....                                                   | 43   |
| <b>i849</b> — UART2_RXD Is Not Working for MUXMODE=0 .....                                                                    | 44   |
| <b>i856</b> — 32k Oscillator Fails to Start-Up at POR .....                                                                   | 45   |
| <b>i862</b> — Reset Should Use PORz .....                                                                                     | 46   |
| <b>i863</b> — MMC2 Has PU/PD Contention Immediately after Release from Reset .....                                            | 48   |
| <b>i867</b> — USB SuperSpeed LFPS Signal Is Not Compliant with the USB3.0 Standard .....                                      | 50   |
| <b>i868</b> — McASP to EDMA Synchronization Level Event Can Be Lost .....                                                     | 51   |
| <b>i869</b> — IO Glitches Can Occur When Changing IO Settings .....                                                           | 52   |
| <b>i870</b> — PCIe Unaligned Read Access Issue .....                                                                          | 53   |
| <b>i871</b> — L4_PER3 Firewall Initiator ConnID Value Left-Shift 1-Bit .....                                                  | 54   |

## Revisions SR 2.0, 1.0 - Advisories List (continued)

|             |                                                                                                                      |           |
|-------------|----------------------------------------------------------------------------------------------------------------------|-----------|
| <b>i872</b> | —DSP MFlag Output Not Initialized .....                                                                              | <b>55</b> |
| <b>i874</b> | —TIMER5/6/7/8 Interrupts Not Propagated .....                                                                        | <b>56</b> |
| <b>i875</b> | —Power-on-Reset (PORz) Warm Boot Hang .....                                                                          | <b>57</b> |
| <b>i878</b> | —MPU Lockup with Concurrent DMM and EMIF Accesses.....                                                               | <b>58</b> |
| <b>i879</b> | —DSP MStandby Requires CD_EMU in SW_WKUP .....                                                                       | <b>59</b> |
| <b>i880</b> | —Ethernet RGMII2 Limited to 10/100 Mbps.....                                                                         | <b>60</b> |
| <b>i882</b> | —EMIF: DDR ECC Corrupted Read/Write Status Response .....                                                            | <b>61</b> |
| <b>i883</b> | —DSP Doesn't Wake from Subsystem Internal Interrupts.....                                                            | <b>62</b> |
| <b>i887</b> | —MMC3 Speed Limited to 64 MHz.....                                                                                   | <b>63</b> |
| <b>i889</b> | —UART Does Not Acknowledge Idle Request after DMA Has Been Enabled .....                                             | <b>64</b> |
| <b>i890</b> | —MMC1 IOs and PBIAS Must Be Powered-Up Before Isolation.....                                                         | <b>65</b> |
| <b>i893</b> | —DCAN Initialization Sequence.....                                                                                   | <b>66</b> |
| <b>i895</b> | —EMIF_FW: System Hang When EMIF Firewall Is Reconfigured While There Is Activity on EMIF Interface ...               | <b>67</b> |
| <b>i896</b> | —USB xHCI Port Disable Feature Does Not Work.....                                                                    | <b>68</b> |
| <b>i897</b> | —USB xHCI Stop Endpoint Command Does Not Work in Certain Circumstances .....                                         | <b>69</b> |
| <b>i898</b> | —DSP Pre-fetch Should Be Disabled before Entering Power Down Mode .....                                              | <b>70</b> |
| <b>i899</b> | —Ethernet DLR Is Not Supported .....                                                                                 | <b>71</b> |
| <b>i900</b> | —SoC Will Hang If Region 5 Accessed While CTRL_CORE_MMR_LOCK_5 Is Locked .....                                       | <b>72</b> |
| <b>i903</b> | —Ethernet RMII Interface RMII_MHZ_50_CLK Not Supported as Output Reference Clock .....                               | <b>73</b> |
| <b>i904</b> | —CSI Interface Setup/Hold Timing Does Not Meet MIPI DPHY Spec above 600MHz.....                                      | <b>74</b> |
| <b>i906</b> | —USB3.0 and PCIe Gen2 Electrical Compliance .....                                                                    | <b>75</b> |
| <b>i907</b> | —PRU-ICSS2 MII1 Port Is Not Supported When PRU-ICSS PRU1 Internal Wrapper Multiplexing Configured for MII2 Mode..... | <b>76</b> |
| <b>i913</b> | —CSI2 LDO Needs to Be Disabled when Module Is Powered On .....                                                       | <b>77</b> |
| <b>i916</b> | —QSPI Reads Can Fail For Flash Devices with HOLD Function .....                                                      | <b>78</b> |
| <b>i927</b> | —SoC Doesn't Read Redundant ONFI Parameter Pages in NAND Boot Mode .....                                             | <b>79</b> |

|                           |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              |
|---------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i202</b>               | <b><i>MDR1 Access Can Freeze UART Module</i></b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             |
| <b>CRITICALITY</b>        | Medium                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |
| <b>DESCRIPTION</b>        | Because of a glitchy structure inside the UART module, accessing the MDR1 register may create a dummy underrun condition and freeze the UART in IrDa transmission. In UART mode, this may corrupt the transferred data(received or transmitted).                                                                                                                                                                                                                                                                                                                                                             |
| <b>WORKAROUND</b>         | <p>To ensure this problem does not occur, the following software initialization sequence must be used each time MDR1 must be changed:</p> <ol style="list-style-type: none"> <li>1. If needed, setup the UART by writing the required registers, except MDR1</li> <li>2. Set appropriately the bit field</li> <li>3. Wait for 5 L4 clock cycles + 5 UART functional clock cycles</li> <li>4. Clear TX and RX FIFO in FCR register to reset its counter logic</li> <li>5. Read RESUME register to resume the halted operation</li> </ol> <p>Step 5 is for IrDA mode only and can be omitted in UART mode.</p> |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                          |

|                           |                                                                                                                                                                                                                                                             |
|---------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i378</b>               | <b><i>sDMA Channel Is Not Disabled after a Transaction Error</i></b>                                                                                                                                                                                        |
| <b>CRITICALITY</b>        | Medium                                                                                                                                                                                                                                                      |
| <b>DESCRIPTION</b>        | In case of destination synchronized transfer on the write port (or source sync with SDMA.DMA4_CCRI[25] BUFFERING_DISABLE = 1), if a transaction error is reported at the last element of the transaction, the channel is not automatically disabled by DMA. |
| <b>WORKAROUND</b>         | Whenever a transaction error is detected on a transaction on the write side of the channel i, software must disable the channel(i) by setting the DMA4_CCRI[7] ENABLE bit to 0.                                                                             |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                                         |

---

**i631**                      ***Wrong Access in 1D Burst for YUV4:2:0-NV12 Format***


---

**CRITICALITY**                      Low

**DESCRIPTION**                      When in YUV4:2:0 format in 1D burst, the DISPC DMA skips lines when fetching Chroma sampling.

**WORKAROUND**                      If YUV4:2:0-1D burst is required:

**REVISIONS IMPACTED**                      AM571x SR 2.0, 1.0  
AM570x SR 2.0

|                           |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     |
|---------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i694</b>               | <b><i>System I2C Hang Due to Miss of Bus Clear Support</i></b>                                                                                                                                                                                                                                                                                                                                                                                                                      |
| <b>CRITICALITY</b>        | Low                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 |
| <b>DESCRIPTION</b>        | <p>There is no H/W mechanism preventing violating below I2C Bus clear standard requirement.</p> <p>If the data line (SDA) is stuck LOW, the master should send 9 clock pulses. The device that held the bus LOW should release it sometime within those 9 clocks. If not, then use the HW reset or cycle power to clear the bus.</p> <p>Sys_Warmreset doesn't reset the I2C IP it does at IC level.</p> <p>So, once the situation is reached, IC is seeing bus busy status bit.</p> |
| <b>WORKAROUND</b>         | I2C SW handler could be programmed to detect such a locked situation. In this case, it will check the Bus Busy bit and issue the needed clock pulses.                                                                                                                                                                                                                                                                                                                               |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                                                                                                                                                                                                                                                                 |

**i698**
**DMA4 Generates Unexpected Transaction on WR Port**
**CRITICALITY**

Medium

**DESCRIPTION**

The DMA4 channel generates an unexpected transaction on WR port under the following 2 scenarios:

- Scenario 1
  1. Software synchronization: Bit fields SYNCHRO\_CONTROL and SYNCHRO\_CONTROL\_UPPER are set to 0 in register DMA4\_CCRi
    - Channel element number: Bit field CHANNEL\_ELMNT\_NBR is set to 0x9 in register DMA4\_CENi
    - Channel frame number: Bit field CHANNEL\_FRAME\_NBR is set to 0x1 in register DMA4\_CFNi
    - Element size: Bit field DATA\_TYPE is set to 0x2 in register DMA4\_CSDPi
    - Destination addressing mode: Bit field DST\_AMODE is set to 0x1 in register DMA4\_CCRi
    - Destination is packed: Bit field DST\_PACKED is set to 0x1 in register DMA4\_CSDPi
    - Destination endianness: Bit field DST\_ENDIAN is set to 0x0 in register DMA4\_CSDPi
    - Destination burst enable: Bit field DST\_BURST\_EN is set to 0x1 in register DMA4\_CSDPi
    - Destination start address: Register DMA4\_CDSAi is set to 0xabcd0000
    - Disable graphics operation: Bit fields CONSTANT\_FILL\_ENABLE and TRANSPARENT\_COPY\_ENABLE are set to 0x0 in register DMA4\_CCRi

The channel has got an ERR response on the WR port before the end of block transfer. The channel has gone for clean abort and got disabled. The same channel has been configured with soft-sync and included in the channel chaining (This channel is not the head of the chain). When this channel gets enabled through the link, the channel is writing the data out as soon as it fetches the data from Read side. It is expected that the channel should go with burst transfer, but it is going for single transfers.

This results in a performance issue as DMA is executing single transfers instead of burst transfers. This performance issue is also observed while using the channel with destination synchronization and prefetch enabled.
  2. Destination sync with Prefetch enabled: Bit field SEL\_SRC\_DST\_SYNC is set to 0x0; Bit fields SYNCHRO\_CONTROL\_UPPER and SYNCHRO\_CONTROL should not be set to 0x0; Bit field PREFETCH is set to 0x1 in register DMA4\_CCRi. The other settings remain same as in use case #1 described above
- Scenario 2
  - The channel has got an ERR response on the WR port before the end of block transfer. The channel has gone for clean abort and got disabled. The same channel has been configured with destination-sync with prefetch enabled and included in the channel chaining (This channel is not the head of the chain). When this channel gets enabled through the link, the read port will start its transaction. If the HWR request to this channel comes before the channel gets its first response, the channel will start a WR transaction with byte enable 0. Also, the internal data counters get updated and the corresponding data will never come out of DMA4. The Data FIFO locations are also not recovered. This results in a Data Integrity issue.

**WORKAROUND**

There is a software workaround to solve this issue

1. Workaround to resolve both Data Integrity and Performance issue:
  - Dummy enable-disable for an aborted Channel. i.e. on abort, configure the

channel as soft sync with No of frames = 0 and enable the channel by writing 0x1 into the ENABLE bitfield of register DMA4\_CCRi. Wait for the Address Misalignment Interrupt. The channel is now ready for reuse.

- Ensure that clean drain happens for a channel that is or is to be used as part of a channel chain. i.e. ensure that the abort conditions never occur for this channel
  - If a channel gets aborted, do not reuse the channel in a chain
  - Don't use channel chaining
2. Workaround to resolve the data integrity only.  
Disable prefetch in all channels that are part of a channel chain

**REVISIONS IMPACTED** AM571x SR 2.0, 1.0  
AM570x SR 2.0

|                           |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    |
|---------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i699</b>               | <b><i>DMA4 Channel Fails to Continue with Descriptor Load When Pause Bit Is Cleared</i></b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        |
| <b>CRITICALITY</b>        | Low                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                |
| <b>DESCRIPTION</b>        | <p>This Bug can occur only in a channel that is part of a channel chain. If channel chaining is not used, this bug is never seen.</p> <p>An exact corner case sequence of events must occur. The sequence is:</p> <ul style="list-style-type: none"> <li>• The channel is enabled and then aborted*.</li> <li>• This same channel is now configured as part of a channel chain (it should not be the head of the channel chain).</li> <li>• The channel is configured as "software synchronized" or "hardware synchronized at destination with prefetch enabled".</li> <li>• The channel gets enabled through linking.</li> </ul> <p>* Following is the subset of abort conditions for this scenario:</p> <ul style="list-style-type: none"> <li>• The channel is disabled in the middle of transaction and channel is not a drain candidate.</li> <li>• The channel gets a transaction error on write port but not at the end-of-block transaction.</li> <li>• The channel gets a read transaction error and is not a drain candidate.</li> </ul> |
| <b>WORKAROUND</b>         | <p>The software workaround is to configure DMA4 to be in no-standby or force-standby mode before clearing the PAUSE bit. The DMA4 can be reverted back to smart-standby mode after a certain period (after detecting DMA4_CSRI[15:15] of corresponding channel to be 0 or ensuring DMA4_CSRI[7:7] bit of corresponding channel to be 0. This ensures descriptor load completion or channel termination.</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                |

| <b>i709</b>               | <b><i>CSI-2 Receiver Executes Software Reset Unconditionally</i></b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |
|---------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>CRITICALITY</b>        | Low                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             |
| <b>DESCRIPTION</b>        | Ongoing transactions may be interrupted when a software reset is performed while there is still active traffic generated by the CSI-2 receiver. Interruption of ongoing transactions typically leads to a general device hang that can only be recovered by a device reset.                                                                                                                                                                                                                                                                                                                     |
| <b>WORKAROUND</b>         | <p>Software must ensure that there is no ongoing traffic before performing a software reset. In particular, the CSI-2 receiver must be reset to resume normal operation after a CSI-2 FIFO overflow. There may be remaining data in the FIFO, and therefore ongoing traffic, when the software driver receives the overflow interrupt. To avoid creating a system hang, software must either:</p> <ul style="list-style-type: none"> <li>• Wait for several 1000s of L3 cycles before performing the software reset after an overflow or</li> <li>• Use the ISS level software reset</li> </ul> |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             |

| <b>i727</b>               | <b><i>Refresh Rate Issue after Warm Reset</i></b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                          |
|---------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>CRITICALITY</b>        | Medium                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     |
| <b>DESCRIPTION</b>        | <p>The refresh rate is programmed in the EMIF_SDRAM_REFRESH_CONTROL[15:0] REFRESH_RATE parameter and is calculated based off of the frequency of the DDR clock during normal operation. When a warm reset is applied to the system, the DDR clock source is set to PLL bypass frequency which is much lower than the functional frequency of operation. Due to this frequency change, upon warm reset de-assertion the refresh rate will be too low until the DDR PLL is set to the functional frequency. This could result in unexpected behavior on the memory side.</p> |
| <b>WORKAROUND</b>         | <p>There are 2 possible work-arounds:</p> <ol style="list-style-type: none"> <li>1. Use workaround as outlined in Errata i862 to convert warm reset to PORz. Warm reset will function the same as cold reset with this approach .</li> <li>2. Use external circuitry to apply reset on DDR RESET# pin when warm reset is asserted. DDR contents will be erased upon warm reset with this approach.</li> </ol>                                                                                                                                                              |
| <b>REVISIONS IMPACTED</b> | <p>AM571x SR 2.0, 1.0<br/>AM570x SR 2.0</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                |

|                           |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                |
|---------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i729</b>               | <b><i>DDR Access Hang after Warm Reset</i></b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 |
| <b>CRITICALITY</b>        | Medium                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         |
| <b>DESCRIPTION</b>        | <p>When warm reset is asserted, EMIF will preserve the contents of the DDR by entering self-refresh. During warm reset the DDR clock source is set to a slower PLL bypass than during normal operation. This causes the following JEDEC spec violations and could result in a DDR access hang after warm reset:</p> <ul style="list-style-type: none"> <li>• DDR clock frequency to the DDR memory is lower than the JEDEC min. clock frequency specified as tCK(avg) min parameter in the JEDEC JESD79-3F DDR3 standard</li> <li>• Upon warm reset de-assertion, DDR is taken out of self-refresh and DDR clock frequency is changed from PLL bypass to normal operating frequency. This violates the JEDEC JESD79-3F DDR3 standard that requires input clock to be stable during normal operation</li> </ul> |
| <b>WORKAROUND</b>         | <p>There are 2 possible work-arounds:</p> <ol style="list-style-type: none"> <li>1. Use workaround as outlined in Errata i862 to convert warm reset to PORz. Warm reset will function the same as cold reset with this approach .</li> <li>2. Use external circuitry to apply reset on DDR RESET# pin when warm reset is asserted. DDR contents will be erased upon warm reset with this approach.</li> </ol>                                                                                                                                                                                                                                                                                                                                                                                                  |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |

**i734** **LCD1 Gamma Correction Is Not Working When GFX Pipe Is Disabled**
**CRITICALITY** High

**DESCRIPTION** LCD1 output supports gamma correction. The color look-up table (CLUT) is shared between the BITMAP to RGB conversion module on GFX pipeline and Gamma correction on the LCD1 output. LUT table can be loaded by SW through DISPC slave port (interconnect) or by DISPC master port using the DISPC DMA.

However, LCD1 gamma correction LUT loading is not working properly and require to enable GFX pipeline for LUT loading. Depending on the load mode (DISPC\_CONFIG1[2:1] LOADMODE) used, GFX pipeline can then be disabled after 1st frame.

**WORKAROUND**
**Table 2-1. Workaround/Load mode settings**

| Load Mode<br>( DISPC_CONFIG1[2:1]LOADMODE) | GFX Enable Condition | Workaround |
|--------------------------------------------|----------------------|------------|
| 0x0 (load LUT and data every frame)        | Always Enabled       | WA1        |

**WA1**

To use gamma correction on LCD1 output, software must:

1. Enable the GFX pipeline by setting DISPC\_GFX\_ATTRIBUTES[0] ENABLE to 0x1.
2. Set the GFX base address (DISPC\_GFX\_BA\_i[31:0] BA) to an accessible frame buffer.
3. Set the GFX window to minimum size by configuring the DISPC\_GFX\_SIZE[27:16] SIZEY and DISPC\_GFX\_SIZE[10:0] SIZEX bits.
4. If the GFX pipeline is not to be displayed, set GFX LYR to bottom LYR in LCD1 overlay by setting appropriate DISPC\_GFX\_ATTRIBUTES[27:26] ZORDER bit field and make GFX fully transparent by setting the global alpha of the GFX to 0x00 in the DISPC\_GLOBAL\_ALPHA[7:0] GFXGLOBALALPHA bit field.

**REVISIONS IMPACTED** AM571x SR 2.0, 1.0  
AM570x SR 2.0

**i767**
***Delay Needed to Read Some Timer Registers After Wakeup***
**CRITICALITY**

Medium

**DESCRIPTION**

For GP timers:

If a General Purpose Timer (GPTimer) is in posted mode (TSICR[2]POSTED=1), due to internal resynchronizations, values read in TCRR, TCAR1 and TCAR2 registers right after the timer interface clock (L4) goes from stopped to active may not return the expected values. The most common event leading to this situation occurs upon wake up from idle.

GP Timer non-posted synchronization mode is not impacted by this limitation.

For watchdog timers:

Due to internal resynchronizations, values read in Watchdog timers WCRR registers right after the timer interface clock (L4) goes from stopped to active may not return the expected values. The most common event leading to this situation occurs upon wake up from idle. All watchdog timers support only POSTED internal synchronization mode. There is no capability to change the internal synchronization scheme to NON-POSTED by software.

**WORKAROUND**

For GP timers:

For reliable counter read upon wakeup from IDLE state, software need to issue a non posted read to get accurate value.

To get this non posted read, TSICR[2]POSTED needs to be set at '0' and TSICR[3]READ\_MODE needs to be set at '1'.

Note: For GP Timers 1/2/10 the TSICR[3]READ\_MODE is a write only bit and reads to this register always return 0.

For watchdog timers:

Software has to wait at least (2 timer interface clock cycles + 1 timer functional clock cycle) after L4 clock wakeup before reading WCRR register of the Watchdog timers.

**REVISIONS IMPACTED**

AM571x SR 2.0, 1.0  
AM570x SR 2.0

|                           |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |
|---------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i782</b>               | <b>SATA AHCI Command Issue Order</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  |
| <b>CRITICALITY</b>        | Low                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   |
| <b>DESCRIPTION</b>        | <p>Advanced host controller Interface (AHCI) specification defines up to 32 command slots per port.</p> <p>AHCI defines the highest priority slot as <math>(pSlotLoc+1) \bmod MaxSlots</math>, where pSlotLoc is the last slot from which a command was issued and MaxSlots is the number of slots per port (32 in this case).</p> <p>The device implementation treats command slot 0 as the highest-priority slot and slot 31 as the lowest-priority slot.</p> <p>Example:</p> <p>Assuming that the last command was issued from slot 17 (and SATA_PxCi[31:0] CI contained 0 at an earlier time), when SATA_PxCi[31:0] CI is set to 0xFFFF FFFF, the command issue order should be 18, 19, 20 ... 31, 0, 1, 2 ... 17.</p> <p>Instead, we observe 0, 1, 2, 3 ... 31.</p> <p>This is a bug in the SATA controller.</p> |
| <b>WORKAROUND</b>         | No workaround is available. Implementation does not conform to AHCI specifications, but it does not affect a major functionality of SATA.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    |

**i783**
***SATA Lockup after SATA DPLL Unlock/Relock***
**CRITICALITY**

Low

**DESCRIPTION**

Consider the following scenario:

1. Initialize SATA.
2. Enable TX/RX PHYs, start controller DMA engine, spin up the device (SATA\_PxCMD[1] SUD = 0x1).
3. Enable aggressive transitions to partial or slumber: SATA\_PxCMD[26] and ALPE = 0x1 and SATA\_PxCMD[27] = 0x0/0x1
4. Perform DMA/PIO transfers.
5. Wait until all commands are finished. Interface (only physical lines) should go to low power mode.
6. Check that transition to partial is complete.
7. Stop all DMA machines, set SATA\_PxCMD[1] SUD bit to 0, power down the PHYs.
8. Unlock SATA DPLL (DPLLCTRL\_SATA.PLL\_GO[0] PLL\_GO = 0x0)
9. Relock SATA DPLL (DPLLCTRL\_SATA.PLL\_GO[0] PLL\_GO = 0x1), go out to low power mode.
10. Go to Step 2.

After the first loop, when re-executing Step 2 and spinning up the device, communication is blocked between the host and the device, and the SATA is locked up.

A simpler scenario can be used to reproduce the issue. In this case, no SATA commands are issued by the host.

1. Initialize the SATA.
2. Enable PHYs, start RX DMA engine, initiate staggered spin-up, and start TX DMA engine.
3. Read SATA status register SATA\_PxTFD.
4. Stop all DMA engine, set SATA\_PxCMD[1] SUD bit to 0, power down the PHYs.
5. Unlock and relock SATA DPLL(DPLLCTRL\_SATA.PLL\_GO[0] PLL\_GO = 0x0 then DPLLCTRL\_SATA.PLL\_GO[0] PLL\_GO = 0x1).
6. Go to Step 2.

These issues are usually encountered immediately after the first loop, although this is not always the case.

**WORKAROUND**

To prevent the SATA Lockup the SATA DPLL Unlock sequence must be performed as follows:

1. Unlock SATA DPLL (SATA DPLL(DPLLCTRL\_SATA.PLL\_GO[0] PLL\_GO = 0x0)
2. Toggle SATA\_PLL\_SOFT\_RESET bit of CTRL\_CORE\_SMA\_SW\_0 register from 0->1
3. Toggle SATA\_PLL\_SOFT\_RESET bit of CTRL\_CORE\_SMA\_SW\_0 register from 1->0

**REVISIONS IMPACTED** AM571x SR 2.0, 1.0

|                           |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     |
|---------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i802</b>               | <b>MMCHS DCRC Errors During Tuning Procedure</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    |
| <b>CRITICALITY</b>        | Low                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 |
| <b>DESCRIPTION</b>        | <p>In UHS-I mode, the SD bus operates in high clock frequency mode and the data windows from card on CMD and DAT lines get smaller. The position of the data windows varies depending on the card and the host system. To adjust the sampling clock when SDR104/HS200 operation mode is used the MMC/SDIO host controller supports a tuning procedure. This tuning circuit is a dedicated DLL which delays the clock signal used, for data sampling.</p> <p>DCRC error interrupts (MMCHS_STAT[21] DCRC=0x1) can occur during the tuning procedure.</p> <p>As explained in SD Host Controller Spec version 3.00 Feb 18, 2010, the controller is supposed to inhibit all interrupts except BRR (block read ready) during the tuning procedure (ET=1).</p> <p>Some DCRC interrupts occur from time to time during tuning upon CMD19 (send tuning block).</p> <p>This DCRC interrupt, occurs when the last tuning block fails (the last ratio tested).</p> <p>The root cause is that the delay from CRC check until the interrupt is asserted is bigger than the delay until assertion of the tuning end flag (which masks the interrupts); therefor, when the interrupt bit toggles, the tuning has already ended.</p> |
| <b>WORKAROUND</b>         | <p>After the DCRC interrupt occurs during the tuning procedure, software should clear the interrupt before the next command is sent: (MMCHS_STAT[21] DCRC=0x1).</p> <p>Another workaround is to disable DCDR interrupt during the tuning procedure: MMCHS_IE [21] DCRC_ENABLE is set to 0x0 (masked).</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           |
| <b>REVISIONS IMPACTED</b> | <p>AM571x SR 2.0, 1.0</p> <p>AM570x SR 2.0</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      |

**i803**
***MMCHS Read Transfer with CMD23 Never Complete When BCE=0 And ADMA Used***
**CRITICALITY**

Low

**DESCRIPTION**

A data time-out (DTO) error interrupt (MMCHS\_STAT[20] DTO=0x1) occurs at the end of reading transfer with CMD23. In this case, transfer completed (TC) interrupt (MMCHS\_STAT[1] TC=0x1) never occurs.

This bug appears only with following restrictive conditions:

- Use CMD23 (command used to specify number of reading and writing block)
- Block count enable BCE (MMCHS\_CMD[1]= 0x0)
- ADMA (integrated controller DMA system engine) used
- Reading transfer (writing transfer is not affected)
- Only finite transfer affected. CMD12 (stop infinite transfer command) command are not affected.
- Issue happens with both large block count ( $>2^{16}$ ) and small block count ( $\leq 2^{16}$ )

Note: These conditions are used typically with UHS SD cards with 32-bit-wide CMD23 capability.

If software is modified to skip TC occurrence and proceed with data comparison, it appears that all data was received correctly.

**WORKAROUND**

If we configure the card to send one more block (through the CMD23 argument) compared to what is configured in the host, then the Read transfer completes correctly (in this case, no DTO, TC occurs and data is correct).

**REVISIONS IMPACTED**

AM571x SR 2.0, 1.0  
AM570x SR 2.0

|                           |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                          |
|---------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i807</b>               | <b><i>SATA Host Controller Locks up If PIO Setup FIS Is Received and Bus Busy and Data Request Bits Are Cleared</i></b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  |
| <b>CRITICALITY</b>        | Low                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      |
| <b>DESCRIPTION</b>        | <p>A bug in the SATA core is integrated into the SATA controller.</p> <p>The host fails to proceed when receiving a D2H PIO setup FIS with bus busy (BSY) and data request (DRQ) bits cleared.</p> <p>When the three following events occur simultaneously, the host controller fails to proceed and locks up:</p> <ul style="list-style-type: none"> <li>• Host controller receives a PIO setup FIS (D=0/write): <ul style="list-style-type: none"> <li>– SATA_PxIS[1] PSS = 0x1</li> </ul> </li> <li>• SATA_PxTFD[7] STS_BSY bit is cleared</li> <li>• SATA_PxTFD[3] STS_DRQ bit is cleared</li> </ul> <p>The bug is due to a state-machine in the SATA core that is not well implemented for this scenario.</p> <p>A reset is required to continue communication between the host and the device.</p> <p>From a user point of view, the impact can be some latency that is seen while proceeding.</p> |
| <b>WORKAROUND</b>         | <p>Implement a software time-out for locks and then issue one of the following two resets, first the least intrusive and/or more intrusive if it does not solve the lock.</p> <p>Least intrusive, software reset:</p> <ul style="list-style-type: none"> <li>• To issue a software reset, the user must prepare two H2D register FISs into the emptied command list of the port: <ul style="list-style-type: none"> <li>– The first FIS must have bits SRST = 0b1 and C = 0b0. The first FIS corresponding command header bits C and R are set as follows: C = 0b1 and R = 0b1.</li> <li>– The second FIS has bits SRST = 0b0 and C = 0b0. The second FIS corresponding command header bits C and R are set as follows: C = 0b0 and R = 0b0.</li> </ul> </li> </ul> <p>More intrusive, Port reset (or COMRESET):</p> <ul style="list-style-type: none"> <li>• SATA_PxSCTL[3:0] DET = 0x1</li> </ul>      |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |

|                           |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  |
|---------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i808</b>               | <b><i>SATA Link Locks up under Certain Conditions</i></b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        |
| <b>CRITICALITY</b>        | Medium                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           |
| <b>DESCRIPTION</b>        | <p>A bug in the SATA core is integrated into the SATA controller.</p> <p>Due to this bug, under certain conditions, the link locks up between the host and the device and the command times out:</p> <ul style="list-style-type: none"> <li>• SATA_PxIS[27] IFS = 0x1 (interface fatal error status)</li> <li>• SATA_PxSERR[23] DIAG_S = 0x1 (link sequence error)</li> </ul> <p>Following cases can bring to these conditions (cases below are not exhaustive):</p> <ul style="list-style-type: none"> <li>• First case: <ul style="list-style-type: none"> <li>– D2H FIS is received;</li> <li>– D2H FIS SYNC-Escape is generated (Link illegal state transition/sequence error);</li> <li>– Link locks ups because this "bad scenario" is not well implemented;</li> <li>– Command times out;</li> <li>– Soft reset will not work because of the bug.</li> </ul> </li> <li>• Second case: <ul style="list-style-type: none"> <li>– D2H FIS PIO Read CONTp primitive is corrupted;</li> <li>– Link locks ups because this "bad scenario" is not well implemented;</li> <li>– Command times out;</li> <li>– Soft reset will not work because of the bug.</li> </ul> </li> </ul> |
| <b>WORKAROUND</b>         | <p>Use a port reset (COMRESET) instead of a software reset when SATA_PxIS[27] IFS = 0x1 and SATA_PxSERR[23] DIAG_S = 0x1.</p> <p>Standard software most likely uses port reset rather than a software reset to recover from such an error.</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |

|                           |                                                                                                                                                                                                                                                                                                                                                                                                                                                          |
|---------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i809</b>               | <b><i>SATA Command Does Not Complete and Software Must Issue a Port Reset Under Certain Conditions</i></b>                                                                                                                                                                                                                                                                                                                                               |
| <b>CRITICALITY</b>        | Medium                                                                                                                                                                                                                                                                                                                                                                                                                                                   |
| <b>DESCRIPTION</b>        | <p>When a Device-to-Host register FIS is received from the device and the FIS length exceeds eight DWORDs, the command may not complete due to an internal receive FIFO overflow condition. As a consequence, the host controller is locked and a latency is seen.</p> <p>The length of the FIS is specified by the specification and having more is a specification violation/error case.</p> <p>The issue is how a host controller is implemented.</p> |
| <b>WORKAROUND</b>         | A port reset (COMRESET) must be done to reestablish the communication between the host and the device.                                                                                                                                                                                                                                                                                                                                                   |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0                                                                                                                                                                                                                                                                                                                                                                                                                                       |

|                           |                                                                                                                                                                                                                                                         |
|---------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i810</b>               | <b><i>DPLL Controller Can Get Stuck While Transitioning to a Power Saving State</i></b>                                                                                                                                                                 |
| <b>CRITICALITY</b>        | Low                                                                                                                                                                                                                                                     |
| <b>DESCRIPTION</b>        | <p>NOTE: The previous title for this advisory was "DPLL Controller Sticks When Left Clock Requests Are Removed"</p> <p>The DPLL Controller can get stuck if it is in transition to a low power state while its M/N ratio is being programmed.</p>       |
| <b>WORKAROUND</b>         | Before re-programming the M/N ratio, SW has to ensure the DPLL cannot start an idle state transition. SW can disable DPLL idling by setting the DPLL AUTO_DPLL_MODE=0 or keeping a clock request active by setting a dependent clock domain in SW_WKUP. |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                                     |

|                           |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              |
|---------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i813</b>               | <b><i>Spurious Thermal Alert Generation When Temperature Remains in Expected Range</i></b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   |
| <b>CRITICALITY</b>        | Medium                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |
| <b>DESCRIPTION</b>        | <p>Spurious Thermal Alert: Talert can happen randomly while the device remains under the temperature limit defined for this event to trig. This spurious event is caused by a incorrect re-synchronization between clock domains. The comparison between configured threshold and current temperature value can happen while the value is transitioning (metastable), thus causing inappropriate event generation.</p> <p>No spurious event occurs as long as the threshold value stays unchanged. Spurious event can be generated while a thermal alert threshold is modified in CTRL_CORE_BANDGAP_THRESHOLD_MPU/GPU/CORE/DSPEVE/IVA_n.</p> |
| <b>WORKAROUND</b>         | <p>Spurious event generation can be avoided by performing following sequence when the threshold is modified:</p> <ol style="list-style-type: none"> <li>1. Disable the alert interrupt: MPU_IRQ_126 into the interrupt handler.</li> <li>2. Modify Threshold.</li> <li>3. Clear the interrupt (cancel potential spurious event).</li> <li>4. Enable the thermal alert interrupt again into the interrupt handler.</li> </ol>                                                                                                                                                                                                                 |
| <b>REVISIONS IMPACTED</b> | <p>AM571x SR 2.0, 1.0<br/>AM570x SR 2.0</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  |

|                           |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     |
|---------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i814</b>               | <b><i>Bandgap Temperature Read Dtemp Can Be Corrupted</i></b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |
| <b>CRITICALITY</b>        | Medium                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              |
| <b>DESCRIPTION</b>        | <p>Read accesses to registers listed below can be corrupted due to incorrect resynchronization between clock domains.</p> <p>Read access to registers below can be corrupted :</p> <ul style="list-style-type: none"> <li>• CTRL_CORE_DTEMP_MPU/GPU/CORE/DSPEVE/IVA_n (n = 0 to 4)</li> <li>• CTRL_CORE_TEMP_SENSOR_MPU/GPU/CORE/DSPEVE/IVA_n</li> </ul>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |
| <b>WORKAROUND</b>         | <p>Multiple reads to CTRL_CORE_TEMP_SENSOR_MPU/GPU/CORE/DSPEVE/IVA[9:0]:</p> <p>BGAP_DTEMPMPU/GPU/CORE/DSPEVE/IVA is needed to discard false value and read right value:</p> <ol style="list-style-type: none"> <li>1. Perform two successive reads to BGAP_DTEMP bit field. <ul style="list-style-type: none"> <li>(a) If read1 returns Val1 and read2 returns Val1, then right value is Val1.</li> <li>(b) If read1 returns Val1, read 2 returns Val2, a third read is needed.</li> </ul> </li> <li>2. Perform third read <ul style="list-style-type: none"> <li>(a) If read3 returns Val2 then right value is Val2.</li> <li>(b) If read3 returns Val3, then right value is Val3.</li> </ul> </li> </ol> <p>Note: A maximum of three reads is required. Those three reads must be performed within the delay between two consecutive measurements, otherwise methodology is not conclusive. This delay is configured in the COUNTER_DELAY field of CTRL_CORE_BANDGAP_MASK_1.</p> |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 |

|                           |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           |
|---------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i815</b>               | <b><i>Power Management Enhancement Implemented Inside DSS Leads to DSS Underflows</i></b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 |
| <b>CRITICALITY</b>        | Medium                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    |
| <b>DESCRIPTION</b>        | <p>An enhanced standby behavior is implemented inside DSS to avoid the usage of SW procedure, calculating the optimal DMA thresholds. This enhanced standby behavior allows DSS to go into standby even for cases where the threshold values programmed are non-optimal.</p> <p>A bug is identified in this implementation, which causes DSS underflows when DSS is in smart-standby mode and when multiple pipelines are enabled.</p> <p>An additional bit (bit 0) has been added to DISABLE_MSTANDBY_ENHANCEMENT register (physical address: 0x58001858) to enable(0x0)/disable(0x1) the enhanced standby behavior.</p> |
| <b>WORKAROUND</b>         | Setting DISABLE_MSTANDBY_ENHANCEMENT[0] bit to '1' (disables the enhanced standby behavior) and prevents the occurrence of this bug.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |

|                           |                                                                                                                                                                                                                                                                                                                                                                                                                      |
|---------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i818</b>               | <b><i>SATA PHY Reset Required Following SATA PLL Unlock</i></b>                                                                                                                                                                                                                                                                                                                                                      |
| <b>CRITICALITY</b>        | Medium                                                                                                                                                                                                                                                                                                                                                                                                               |
| <b>DESCRIPTION</b>        | If SATA controller is in slumber or partial low-power mode, SATA PHY is in low-power mode, and SATA 1.5 GHz PLL is relocked for any reason, the PHY receiver loses lock. In result the receiver / de-serializer is unable to produce parallel data from a correct serial source, and will not detect the attached SATA drive.                                                                                        |
| <b>WORKAROUND</b>         | <p>Workaround is to disable and re-enable both analog LDO of the transceiver, using the corresponding SW programmable bits of power control MMR: The CTRL_CORE_PHY_POWER_SATA[21:14] SATA_PWRCTL_CLK_CMD must be set to 0x0 to power down the SATA PHY TX and RX modules.</p> <p>The rest of the workaround sequence is the same as upon initial SATA PHY power-up, and includes setting above bits back to 0x2.</p> |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0                                                                                                                                                                                                                                                                                                                                                                                                   |

---

**i819**                      ***A Device Control Bit Meta-Stability for USB3.0 Controller in USB2.0 Mode***


---

|                           |                                                                                                                                                                                                                                                    |
|---------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>CRITICALITY</b>        | Medium                                                                                                                                                                                                                                             |
| <b>DESCRIPTION</b>        | When USB3.0 controller core is programmed to be a USB 2.0-only device, possible hardware meta-stability on USB_DCTL[31] RUNSTOP bit causing the core to attempt high speed as well as SuperSpeed connection or completely miss the attach request. |
| <b>WORKAROUND</b>         | If the requirement is to always function in USB 2.0 mode, there is no workaround. Otherwise, you can always program the USB controller core to be SuperSpeed 3.0 capable (USB_DCFG[2:0]DEVSPD = 0x4).                                              |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                                |

| <b>i820</b>               | <b><i>Unexpected USB Link State Value upon U3 Exit by USB3.0 Link</i></b>                                                                                                                                                              |
|---------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>CRITICALITY</b>        | Low                                                                                                                                                                                                                                    |
| <b>DESCRIPTION</b>        | When USB3.0 link is exiting U3 state (as result of link recovery request USB_DCTL[8:5]ULSTCHNGREQ=0x8), the USB_DSTS[21:18]USBLNKST field is updated to 0xF (Reset/Resume State), which state is not a valid LTSSM state in this case. |
| <b>WORKAROUND</b>         | Ignore the Reset/Resume State value (USB_DSTS[21:18]USBLNKST=0xF).                                                                                                                                                                     |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                    |

|                           |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   |
|---------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i824</b>               | <b><i>USB3.0 Link Cannot Be Established When Suspend Mode Is Enabled</i></b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      |
| <b>CRITICALITY</b>        | Medium                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |
| <b>DESCRIPTION</b>        | <p>When suspend mode is enabled (USB_GUSB3PIPECTL[17]SUSPENDENABLE = 0x1), the communication between the host controller and the USB device is broken. This happens in the following two sequences:</p> <p>Sequence 1:</p> <ul style="list-style-type: none"> <li>• Enable and configure the DWC_USB3 controller as host</li> <li>• Set the USB_GUSB3PIPECTL[17]SUSPENDENABLE = 0x1 and USB_GUSB2PHYCFG[6]SUSPHY = 0x1</li> <li>• Connect a USB3.0 device</li> </ul> <p>When USB3.0 device is connected there is not enough time to establish the USB3.0 link so the host controller falls back to USB2.0 mode.</p> <p>Sequence 2:</p> <ul style="list-style-type: none"> <li>• Enable and configure the DWC_USB3 controller as host</li> <li>• Wait until the USB3.0 link is established</li> <li>• Set the USB_GUSB3PIPECTL [17]SUSPENDENABLE = 0x1 and USB_GUSB2PHYCFG [6]SUSPHY = 0x1</li> <li>• Host controller initiates a transition to U3.</li> <li>• Wait until transition U3 is completed successfully</li> <li>• Host controller initiates a transition to U0.</li> </ul> <p>The USB3.0 link cannot be reestablished and the host controller falls back to USB2.0.</p> |
| <b>WORKAROUND</b>         | First set CTRL_CORE_PHY_POWER_USB[21:14]USB_PWRCTL_CLK_CMD to 0x43 then to 0x03 just after U3_EXIT state (setting the PORTSC2 in U0 by Polling on USB_PORTSC2 [8:5]PLS=RESUME) and before Recovery state.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |

|                           |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |
|---------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i826</b>               | <b><i>HSDIVIDER1 CLKOUT4 Could Glitch During On-the-Fly Divider Change to/from Divide-by-2.5</i></b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |
| <b>CRITICALITY</b>        | Low                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        |
| <b>DESCRIPTION</b>        | <p>When HSDIVIDER1/2 CLKOUT4 (CM_DIV_H14_DPLL_PER/CM_DIV_H24_DPLL_CORE[5:0]DIVHS) configuration is changed between an odd divide value and divide-by-2.5 setting, the clock output could glitch. This could result in unexpected behavior of the peripheral receiving the clock. This case impacts GPU clock.</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                          |
| <b>WORKAROUND</b>         | <p>To avoid glitch, the user can always change first to/from an even divider setting, such as divide-by-4, before reconfiguring to divide-by-2.5 or from divide-by-2.5 to an odd divider.</p> <p>Sequence to switch HSDIVIDER1/2 CLKOUT4 from any odd divider to divide-by-2.5:</p> <ul style="list-style-type: none"> <li>• Current divider setting is set to any odd divider</li> <li>• Change divider setting to any even divider not exceeding maximum frequency for that clock (e.g. divide-by-4)</li> <li>• Change divider setting to divide-by-2.5</li> </ul> <p>Sequence to switch HSDIVIDER1/2 CLKOUT4 from divide-by-2.5 to any odd divider:</p> <ul style="list-style-type: none"> <li>• Current divider setting is set divide-by-2.5</li> <li>• Change divider setting to any even divider not exceeding maximum frequency for that clock (e.g. divide-by-4)</li> <li>• Change frequency to the desired odd divider</li> </ul> |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        |

| <b>i829</b>               | <b><i>Reusing Pipe Connected to Writeback Pipeline On -the-Fly to an Active Panel</i></b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      |
|---------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>CRITICALITY</b>        | Low                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |
| <b>DESCRIPTION</b>        | <p>Any pipe connected to writeback (WB) in memory-to-memory (m2m) mode (DISPC_WB_ATTRIBUTES[19] WRITEBACKMODE=0x1) cannot be connected on the fly to an active panel when m2m operation is complete. Trying to attempt this will cause sync-lost interrupt and one corrupted frame.</p> <p>When a pipe is connected to WB pipeline in m2m mode, after m2m operation, it remains enabled. The HW does not disable the pipeline by clearing the enable bit associated with this pipeline(DISPC_VID1/2_ATTRIBUTES[0] ENABLE=0x0), though it disables the writeback by clearing the WB pipeline enable bit (DISPC_WB_ATTRIBUTES[0]ENABLE=0x0). If this pipe is then connected to an active panel, the connection will not be synchronized to a frame start. This will result in current frame getting corrupted and sync-lost.</p> |
| <b>WORKAROUND</b>         | <p>The SW should use following exit sequence from m2m operation:</p> <ol style="list-style-type: none"> <li>1. When m2m operation is completed and hardware is automatically disabled writeback by setting DISPC_WB_ATTRIBUTES[0]ENABLE bit to 0x0, SW should disable the pipe connected to WB in m2m mode: DISPC_VID1/2_ATTRIBUTES[0] ENABLE =0x0;</li> <li>2. Writeback should be re-enabled (DISPC_WB_ATTRIBUTES[0]ENABLE=0x1) and after that disabled by SW (DISPC_WB_ATTRIBUTES[0] ENABLE= 0x0);</li> <li>3. The direction of the pipe to the active panel should be changed and all new programming for the pipe should be made;</li> <li>4. Pipe is enabled again (DISPC_VID1/2_ATTRIBUTES[0] ENABLE=0x1) at the end.</li> </ol>                                                                                        |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |

|                           |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   |
|---------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i834</b>               | <b><i>MMCHS HS200 and SDR104 Command Timeout Window Too Small</i></b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             |
| <b>CRITICALITY</b>        | Medium                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |
| <b>DESCRIPTION</b>        | Under high speed HS200 and SDR104 modes, the functional clock for MMC modules will reach up to 192 MHz. At this frequency, the maximum obtainable timeout through of MMC host controller using MMCHS_SYSCTL[19:16] DTO = 0xE is $(1/192\text{MHz}) \times 2^{27} = 700\text{ms}$ . Commands taking longer than 700ms may be affected by this small window frame.                                                                                                                                                                                                                                                                                                  |
| <b>WORKAROUND</b>         | <p>If the command requires a timeout longer than 700ms, then the MMC host controller command timeout can be disabled (MMCHS_CON[6]MIT=0x1) and a software implementation may be used in its place. Detailed steps as follows (in Linux):</p> <ol style="list-style-type: none"> <li>1. During MMC host controller probe function (omap_hsmmc.c:omap_hsmmc_probe() ), inform processor that the host controller is incapable of supporting all the necessary timeouts.</li> <li>2. Modify the MMC core software layer functionality so the core times out on its own when the underlying MMC host controller is unable to support the required timeout.</li> </ol> |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |

|                           |                                                                                                                                                  |
|---------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i849</b>               | <b><i>UART2_RXD Is Not Working for MUXMODE=0</i></b>                                                                                             |
| <b>CRITICALITY</b>        | Low                                                                                                                                              |
| <b>DESCRIPTION</b>        | The UART2_RXD functionality does not work when the pin is configured at its default of MUXMODE=0x0 in the corresponding CTRL_CORE_PAD* register. |
| <b>WORKAROUND</b>         | Use MUXMODE=0x4 setting to select UART2_RXD function instead of MUXMODE=0x0 setting. The functionality is exactly equivalent.                    |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                              |

**i856** **32k Oscillator Fails to Start-Up at POR**
**CRITICALITY** Medium

**DESCRIPTION** The on-chip 32k oscillator fails to start up after release of power-on-reset input (porz). SYSBOOT[9:8]=00b mode is not usable with internal 32k oscillator as the device will not boot. This means internal only oscillator frequencies of 20MHz, 27MHz or 19.2MHz may be used. Startup of 32k depends on user software writing to RTCSS GZ bit and only RTCSS can use the 32k clock (after writing GZ bit to 0), all other FUNC\_32K\_CLK targets (e.g. timers, mmc and gpio de-bounce) can only use SYSCLK1. Full features of RTC mode are still functional after the 32k software enables the oscillator.

**WORKAROUND**


---

**NOTE:** RTCSS is not supported on AM570x family of devices.

---

Avoid SYSBOOT[9:8]=00b setting. This means internal only oscillator frequencies of 20MHz, 27MHz or 19.2MHz may be used. This also means that the 32k\_FUNC clock within the device (feeding MMC, GPIO, Timers) will always come from SYSCLK1/610 and not the true 32k clock, which will only feed the RTCSS.

NOTE: For legacy systems, if use of 26MHz clock is required, then SYSBOOT[9:8]=00b may be used by feeding a 32kHz clock to the rtc\_osc\_xi\_clking32 pin from an external source. In this case, the 32k clock from the pad will also be used as 32k\_FUNC clock to the device. Note: This operation is not defined by the Data Manual.

**REVISIONS IMPACTED** AM571x SR 2.0, 1.0  
AM570x SR 2.0

**i862**
**Reset Should Use PORz**
**CRITICALITY**

High

**DESCRIPTION**

On SR 1.0, Power-on-reset (porz SoC input signal) is the only 100% reliable reset type. If any reset source other than porz is used, there is a chance the SoC may hang during boot after the reset source is de-asserted. Examples of other reset sources include software resets (global cold, global warm), hardware exception resets (Watchdog, Thermal Shutdown, Security violations), or the Warm Reset input (resetrn SoC input). Entry into reset will be successful with these reset sources, but code execution may hang if reset is initiated by any reset source other than porz.

Two examples: A watchdog reset will indicate a runaway code event has occurred by resetting the SoC and asserting rstoutn. A thermal shutdown reset (TSHUT) will reset the SoC and assert rstoutn which prevents the SoC from overheating. However, code execution may hang when the SoC attempts to reboot from any source other than porz (including a watchdog and thermal shutdown reset).

Power-On-Reset (porz SoC input) is 100% reliable and can recover from the SoC hang. On SR 2.0, all reset types can be used. However, some use cases may still require the workaround described by this erratum. Refer to i727 and i729 for more details.

**WORKAROUND**

PORz should be used for all reset occurrences.

Two recommended implementations are provided below. Note: All reset sources will assert reset to the system via the SoC rstoutn output. This allows external visibility to software or watchdog resets, which would otherwise be invisible to components outside of the SoC. Both recommended implementations will use the rstoutn output.

**Implementation 1: PMIC asserts porz when rstoutn is connected to PMIC NRESWARM input**

- When the rstoutn output from the SoC is connected to the external PMIC's NRESWARM input, the PMIC companion device approved for use with the SoC can be configured to detect the rstoutn/NRESWARM assertion and assert porz/RESET\_OUT. All PMIC companion devices which have been approved for the SoC implement this feature. The feature is bootstrap selectable via one of the PMIC's BOOT pin(s). Refer to PMIC User Guide for additional details. Note: This implementation option has no added cost to the customer since the SoC must be used with one of the approved PMIC devices.
- To implement the workaround:
  - Connect the rstoutn output from the SoC to the PMIC's NRESWARM input (and to any other components that need to reset when the SoC undergoes a reset). Note: When the rstoutn output is operating in 3.3V mode, a 3.3 volt to 1.8 volt level translator will be required to level shift the rstoutn output connected to the PMIC's NRESWARM input to 1.8 volts.
  - Pull-up the appropriate PMIC BOOTx pin, to configure the PMIC's RESET\_OUT to assert porz on warm reset.
  - The PMIC's POWERHOLD (GPIO7) input must be pulled high.
- Example use cases for this implementation include:
  - A switch connected to the PMIC's POWERHOLD input is used to turn the board on/off.
  - The PMIC applies power to the SoC as soon as the board is powered when the POWERHOLD input is tied high to an always-on supply LDOVRTC\_OUT.
  - The PMIC applies power to the SoC once the PWRON input is pulled low by pressing a normally open push-button switch when the POWERHOLD input is pulled high by one of the supplies enabled during device start-up.
- The side effects/risks of this implementation include:
  - This implementation does not allow software to shut down the PMIC outputs that

power the SoC. Only the PMIC RESET\_IN can shut down the PMIC outputs while POWERHOLD is pulled high.

- Risk of exceeding the 200 hour limit defined by Advisory i863, if the PMIC applies power with eMMC in contention longer than 200 hours.

**Implementation 2: Additional circuit implemented that generates porz without PMIC support**

- This implementation enables software shutdown of the PMIC since the PMIC's POWERHOLD input remains low during operation.
- To implement the workaround:
  - Pull-down the appropriate PMIC's BOOTx input.
  - Use an external circuit that generates a finite length active low pulse to porz when the circuit detects the assertion of rstoutn. This feedback path from rstoutn through the pulse generating circuit to porz insures any reset source other than porz generates a valid reset for the SoC.
- Example use cases for this implementation include:
  - A normally open push button switch (on the system board) connected to the PMIC's PWRON input is used to initiate PMIC applying power to the device.
  - Software writes to the PMIC registers to power off the device.
- The benefits/side effects of this implementation include:
  - This implementation allows software to shut down the PMIC since the PMIC's POWERHOLD input remains low during operation.
  - Reduces the risk described in Advisory i863. This implementation will automatically shut-off power to the SoC seven seconds after the PMIC's PWRON event unless software writes to appropriate registers to remove contention from the eMMC signals before writing to appropriate PMIC registers that allows the SoC to remain powered.

Other implementations are also possible. For instance, an external watchdog timer could be implemented to assert porz when the SoC becomes unresponsive.

In general, any valid workaround that generates a porz whenever any reset is initiated has the following side effects:

- Reset status information is lost in PRM\_RSTSTAT register.
  - Visibility into the cause of the last reset is lost. To maintain some visibility software may be able to store information in PMIC BACKUP or other PMIC registers.
- Ethernet Reset isolation feature is not supported.
- Boot device reordering on warm reset is not supported.

The workaround has the advantage of guaranteeing the entire SoC is in a known good and consistent state for every reboot. For example, there are no software residual effects due to watchdog warm reset.

**REVISIONS IMPACTED** AM571x SR 1.0

This erratum is fixed on AM571x SR 2.0 and AM570x SR 2.0. However, the i862 workaround may still be required for some use cases. Refer to i727 and i729 for more details.

## i863 **MMC2 Has PU/PD Contention Immediately after Release from Reset**

### CRITICALITY

High

### DESCRIPTION

On AM571x SR 1.0 which should always set SYSBOOT15=1, the MMC2\_DAT[x] terminals have internal weak pull-down resistors (PD) in the range of 8 k $\Omega$  ~ 36 k $\Omega$  (1.8 V) or 9 k $\Omega$  ~ 82 k $\Omega$  (3.3 V) which are turned on by default immediately after the device has been released from reset. The JEDEC eMMC standard requires external weak pull-up resistors (PU) on eMMC CMD and DAT signals, and internal weak pull-up resistors on DAT[7-0] terminals of eMMC devices to prevent inputs from floating. The external resistors are in the range of 4.7 k $\Omega$  ~ 100 k $\Omega$  and the internal eMMC device resistors are in the range of 10 k $\Omega$  ~ 150 k $\Omega$ . After reset, these weak pull-up resistors contradict the internal pull state of the device and presents a PU/PD contention on the eMMC DAT signals; this may lead to reliability issues if not handled properly.

On AM571x SR 2.0 and AM570x SR 2.0, the MMC2 DAT[x] terminals have internal weak pull-down resistors (PD) which are disabled by default when SYSBOOT15=0 or enabled by default when SYSBOOT15=1. Refer to the TRM section “**Permanent PU/PD disabling**” for details.

PU/PD Contention Reliability Issue:

The PU/PD contention applies a mid-supply voltage to the input buffer which may cause excessive current to flow through the input buffer. In this scenario, both FETs (PMOS/NMOS) in the input buffer are partially turned ON, resulting in a current path from VDD through the input buffer to VSS. Total leakage power during this state may be up to 800  $\mu$ A per input buffer operating at 1.8 V, or up to 2 mA per input buffer operating at 3.3 V. Hysteresis on the input buffers prevents the noise from causing the input logic level to change state, but it does not prevent the current path.

To maintain system reliability, SW should minimize the duration eMMC DAT lines spend in this invalid state.

### WORKAROUND

SW should minimize the time eMMC DAT terminals spend in the PU/PD contention state to a maximum of 200 hours in a device life cycle.

On AM571x SR1.0 (which should always have SYSBOOT15=1) - or AM571x SR 2.0/ AM570x SR 2.0 when SYSBOOT15=1 - this is done by configuring MMC pinmux configuration to turn off the internal pull-down resistors as early as possible in secondary boot loader (SBL, i.e. the initial software image loaded by the device's ROM boot loader; one that is responsible for loading subsequent boot images or the main OS). If external pulls are not implemented on the PCB, then the internal PU on eMMC DAT signals should be enabled simultaneously. Alternately, if external pulls are implemented (as recommended by the JEDEC JESD84- B451) the internal pull resistors can be disabled. SW should take care of writing the below values in the listed registers-bit fields:

```
CTRL_CORE_PAD_GPMC_A24[3:0] = 1 ; mmc2_dat0
CTRL_CORE_PAD_GPMC_A24[16] = 0 ; Enables weak Pull Up/Down
CTRL_CORE_PAD_GPMC_A24[17] = 1 ; Pull Up is selected
CTRL_CORE_PAD_GPMC_A24[18] = 1 ; Receive Mode is Enabled
CTRL_CORE_PAD_GPMC_A24[19] = 0 ; Fast slew is selected

CTRL_CORE_PAD_GPMC_A25[3:0] = 1 ; mmc2_dat1
CTRL_CORE_PAD_GPMC_A25[16] = 0 ; Enables weak Pull Up/Down
CTRL_CORE_PAD_GPMC_A25[17] = 1 ; Pull Up is selected
CTRL_CORE_PAD_GPMC_A25[18] = 1 ; Receive Mode is Enabled
CTRL_CORE_PAD_GPMC_A25[19] = 0 ; Fast slew is selected

CTRL_CORE_PAD_GPMC_A26[3:0] = 1 ; mmc2_dat2
CTRL_CORE_PAD_GPMC_A26[16] = 0 ; Enables weak Pull Up/Down
CTRL_CORE_PAD_GPMC_A26[17] = 1 ; Pull Up is selected
CTRL_CORE_PAD_GPMC_A26[18] = 1 ; Receive Mode is Enabled
```

```

CTRL_CORE_PAD_GPMC_A26[19] = 0      ; Fast slew is selected

CTRL_CORE_PAD_GPMC_A27[3:0] = 1      ; mmc2_dat3
CTRL_CORE_PAD_GPMC_A27[16] = 0      ; Enables weak Pull Up/Down
CTRL_CORE_PAD_GPMC_A27[17] = 1      ; Pull Up is selected
CTRL_CORE_PAD_GPMC_A27[18] = 1      ; Receive Mode is Enabled
CTRL_CORE_PAD_GPMC_A27[19] = 0      ; Fast slew is selected

CTRL_CORE_PAD_GPMC_A19[3:0] = 1      ; mmc2_dat4
CTRL_CORE_PAD_GPMC_A19 [16] = 0      ; Enables weak Pull Up/Down
CTRL_CORE_PAD_GPMC_A19 [17] = 1      ; Pull Up is selected
CTRL_CORE_PAD_GPMC_A19 [18] = 1      ; Receive Mode is Enabled
CTRL_CORE_PAD_GPMC_A19 [19] = 0      ; Fast slew is selected

CTRL_CORE_PAD_GPMC_A20[3:0] = 1      ; mmc2_dat5
CTRL_CORE_PAD_GPMC_A20[16] = 0      ; Enables weak Pull Up/Down
CTRL_CORE_PAD_GPMC_A20[17] = 1      ; Pull Up is selected
CTRL_CORE_PAD_GPMC_A20[18] = 1      ; Receive Mode is Enabled
CTRL_CORE_PAD_GPMC_A20[19] = 0      ; Fast slew is selected

CTRL_CORE_PAD_GPMC_A21[3:0] = 1      ; mmc2_dat6
CTRL_CORE_PAD_GPMC_A21[16] = 0      ; Enables weak Pull Up/Down
CTRL_CORE_PAD_GPMC_A21[17] = 1      ; Pull Up is selected
CTRL_CORE_PAD_GPMC_A21[18] = 1      ; Receive Mode is Enabled
CTRL_CORE_PAD_GPMC_A21[19] = 0      ; Fast slew is selected

CTRL_CORE_PAD_GPMC_A22[3:0] = 1      ; mmc2_dat7
CTRL_CORE_PAD_GPMC_A22[16] = 0      ; Enables weak Pull Up/Down
CTRL_CORE_PAD_GPMC_A22[17] = 1      ; Pull Up is selected
CTRL_CORE_PAD_GPMC_A22[18] = 1      ; Receive Mode is Enabled
CTRL_CORE_PAD_GPMC_A22[19] = 0      ; Fast slew is selected

```

The 200 hours can be distributed any way throughout the lifetime of a device, and can be one instance of 200 hours or any number of occurrences totaling 200 hours.

On AM571x SR 2.0 and AM570x SR 2.0, if SYSBOOT15=0 then no software workaround is required since the internal pulls are permanently disabled. Note that external pull-up resistors on the MMC data bus are mandatory in this case. It is OK if the software workaround remains since accesses to configure the internal pulls has no effect.

**REVISIONS IMPACTED** AM571x SR 2.0 (if SYSBOOT15=1, as described in i863 above)  
 AM571x SR 1.0  
 AM570x SR 2.0 (if SYSBOOT15=1, as described in i863 above)

|                           |                                                                                                                                                                                                                                                                                                                                                 |
|---------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i867</b>               | <b><i>USB SuperSpeed LFPS Signal Is Not Compliant with the USB3.0 Standard</i></b>                                                                                                                                                                                                                                                              |
| <b>CRITICALITY</b>        | Medium                                                                                                                                                                                                                                                                                                                                          |
| <b>DESCRIPTION</b>        | <p>The differential peak-to-peak amplitude of the USB SuperSpeed LFPS signal is normally expected to measure between 800mV and 1200mV. The actual voltage observed on the device can drop below 800mV p-p causing non-compliance with the USB3 standard.</p> <p>This issue may cause interoperability issues with compliant USB3.0 devices.</p> |
| <b>WORKAROUND</b>         | None                                                                                                                                                                                                                                                                                                                                            |
| <b>REVISIONS IMPACTED</b> | AM571x SR 1.0                                                                                                                                                                                                                                                                                                                                   |

**i868**
**McASP to EDMA Synchronization Level Event Can Be Lost**
**CRITICALITY**

Medium

**DESCRIPTION**

The McASP FIFO events to the EDMA or System DMA can be lost depending on the timing between the McASP side activity and the DMA side activity. The problem is most likely to occur in a heavily loaded system which can cause the DMA latency to increase and potentially hit the problematic timing window. When an event is lost, the McASP FIFO Rx path will overflow or the Tx path will underflow. Software intervention is required to recover from this condition.

The issue results due to a state machine boundary condition in the McASP FIFO logic. In normal operation, when "Threshold" (set by the RFIFOCTL[15:8] RNUMEVT and WFIFOCTL[15:8] WNUMEVT registers) words of data are read/written by the DMA then the previous event would be cleared. Similarly, when "Threshold" words of data are written/read from the pins, a new event should be set. If these two conditions occur at the same exact time (within a 2 cycle window), then there is a conflict in the set/clear logic and the event is cleared but is not re-asserted to the DMA.

**WORKAROUND**

Since the McASP is a real time peripheral, any loss of data due to underflow/overflow should be avoided by eliminating the possibility of DMA read/write completing at the same time as a new McASP Event. Software should configure the system to:

1. Maximize time until the deadline for the McASP FIFO
2. Minimize DMA service time for McASP related transfers

In order to maximize time until deadline, the RNUMEVT and WNUMEVT should be set to the largest multiple of "number of serializers active" that is less-than-equal-to 32 words. Since the FIFO is 64-Words deep, this gives the maximum time to avoid the boundary condition.

In order to minimize DMA service time for McASP related transfers multiple options are possible. For example, McASP buffers can be placed in OCMCRAM or DSP's L2 SRAM (since on chip memories provide a more deterministic and lower latency path compared to DDR memory). In addition, a dedicated Queue/TC can be allocated to McASP transfers. At minimum, care should be taken to avoid any long transfers on the same Queue/TC to avoid head-of-line blocking latency.

**REVISIONS IMPACTED** AM571x SR 1.0

|                           |                                                                                                                                                                                                                                                                                                                                                                                                                                    |
|---------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i869</b>               | <b><i>IO Glitches Can Occur When Changing IO Settings</i></b>                                                                                                                                                                                                                                                                                                                                                                      |
| <b>CRITICALITY</b>        | Medium                                                                                                                                                                                                                                                                                                                                                                                                                             |
| <b>DESCRIPTION</b>        | <p>Glitches up to multiple nano-seconds in length can occur on a Device IO when changing the IO setting via either of the below methods:</p> <ol style="list-style-type: none"> <li>1. Changing the value of the MUXMODE, DELAYMODE or MODESELECT fields of the corresponding CTRL_CORE_PAD_* register.</li> <li>2. Changing the value of the CFG_*_IN, CFG_*_OEN, and CFG_*_OUT registers in the IODELAYCONFIG Module.</li> </ol> |
| <b>WORKAROUND</b>         | To workaround this issue, the Device LVCMOS IOs should be placed into Isolation mode when changing the IO settings as described above. Refer to the Device TRM section "Isolation Requirements" for more details.                                                                                                                                                                                                                  |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                                                                                                                                                                                                                |

|                           |                                                                                                                                                                                                                                                                                                                                                                                                                                         |
|---------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i870</b>               | <b><i>PCIe Unaligned Read Access Issue</i></b>                                                                                                                                                                                                                                                                                                                                                                                          |
| <b>CRITICALITY</b>        | Medium                                                                                                                                                                                                                                                                                                                                                                                                                                  |
| <b>DESCRIPTION</b>        | Access to the PCIe slave port that are not 32-bit aligned will result in incorrect mapping to TLP Address and Byte enable fields. Therefore, byte and half-word accesses are not possible to byte offset 0x1, 0x2, or 0x3.                                                                                                                                                                                                              |
| <b>WORKAROUND</b>         | <p>To workaround this issue, there are two options:</p> <ol style="list-style-type: none"> <li>1. Avoid issuing read accesses to the PCIe slave port that are not 32-bit aligned.</li> <li>2. Set the PCIE_SS1_AXI2OCP_LEGACY_MODE_ENABLE and PCIE_SS2_AXI2OCP_LEGACY_MODE_ENABLE bits to 0x1 in the CTRL_CORE_SMA_SW_7 Control Module register. This will make all Read TLPs 32-bit aligned with all byte enables set to 1.</li> </ol> |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                                                                                                                                                                                                                     |

**i871 L4\_PER3 Firewall Initiator ConnID Value Left-Shift 1-Bit**

**CRITICALITY** Low

**DESCRIPTION** The initiator ConnID value is used for configuring Firewall to setup the protection of target IPs. The Technical Reference Manual Table "L4 ConnID Definition" is correct for L4\_CFG, L4\_PER1, L4\_PER2, and L4\_WKUP. However, the L4\_PER3 initiator ConnID value propagated from L3 interconnect is left-shifted by 1-bit comparing to the other L4 instances. As a result, the L4\_PER3 firewall uses ConnIDx2 to determine the permission of each initiator accessing L4\_PER3 targets. L4\_PER3 firewall also logs error with ConnIDx2 value when violations occur.

Due to ConnID value left-shifted by 1-bit, the default Protection Group Member, defined by L4\_AP\_PROT\_GROUP\_MEMBERS\_0\_L register, will only enable the initiators with ConnID < 8 for L4\_PER3 access since the upper 16-bits are all 0s after reset. The initiators with ConnID >= 8 won't be able access L4\_PER3 targets out of reset. User has to program the protection group register to enable the access to L4\_PER3 targets for those initiators.

**WORKAROUND** To configure the L4\_PER3 firewall protection correctly, use ConnIDx2 to program protection group and identify the initiator that caused the error. Refer to the below table for L4\_PER3 ConnID values.

**Table 2-2. ConnID Values**

| ConnID per TRM (hex) | ConnID For L4_PER3 FW (decimal) | CONNID_BIT_VECTOR For L4_PER3 FW | Initiator <sup>(1)</sup>                      |
|----------------------|---------------------------------|----------------------------------|-----------------------------------------------|
| 0                    | 0                               | BIT 0                            | Cortex-A15 MPU subsystem                      |
| 1                    | 2                               | BIT 2                            | Debug subsystem                               |
| 2                    | 4                               | BIT 4                            | DSP1 subsystem (CFG, EDMA, MDMA), DSP2 (EDMA) |
| 3                    | 6                               | BIT 6                            | IVAHD, DSP2 (CGF, MDMA)                       |
| 4                    | 8                               | BIT 8                            | EVE1, EVE2, EVE3, EVE4                        |
| 5                    | 10                              | BIT 10                           | PRUSS1, PRUSS2                                |
| 6                    | 12                              | BIT 12                           | IPU1/2, SYSTEM_DMA                            |
| 7                    | 14                              | BIT 14                           | EDMA                                          |
| 8                    | 16                              | BIT 16                           | DSS, MLB, MMU1, MMU2, PCIE1 and PCIE2         |
| 9                    | 18                              | BIT 18                           | VIP1, VIP2, VIP3, VPE                         |
| A                    | 20                              | BIT 20                           | MMC1, MMC2, GPU, BB2D, GMAC                   |
| B                    | 22                              | BIT 22                           | USB1, USB2, USB3, USB4                        |
| C                    | 24                              | BIT 24                           | SATA                                          |

<sup>(1)</sup> For the list of active initiators, please refer to the specific device TRM.

**REVISIONS IMPACTED** AM571x SR 2.0, 1.0  
AM570x SR 2.0

**i872** ***DSP MFlag Output Not Initialized***
**CRITICALITY** Medium

**DESCRIPTION** The DSP1 Subsystem includes MFlag output signals that are under DSP software control and are used to control arbitration at various points in the system interconnect, including in the DMM and EMIF command queues.

Each DSP subsystem's MFlag output signal is uninitialized in hardware until the DSP is powered up and clocked, and can default to a value of either 0 or 1. This can have unanticipated and non-deterministic effects on system traffic dependent on the power-on state of the MFlag signals.

**WORKAROUND** In order to ensure that a known value is driven by the DSP's MFlag outputs, software should power-up the DSP(s) and enable the clocks for a brief time. After the DSP is enabled, it can immediately be disabled if desired. Once the DSP is enabled and clocked the MFlag output will be 0.

The sequence to perform a DSPn enable and then power down is as below:

```
/* Start a SW force wakeup for DSPSS */
WR_MEM_32(CM_DSPn_CLKSTCTRL, 0x2);

/* Enable DSPSS clock */
WR_MEM_32(CM_DSPn_DSPn_CLKCTRL, 0x1);

/* Reset de-assertion for DSP SS logic */
WR_MEM_32(RM_DSPn_RSTCTRL, 0x1);

/* Wait till module is functional*/
while ((RD_MEM_32(CM_DSPn_DSP_CLKCTRL) & 0x30000) != 0x0 or TIMEOUT(100ms));

/* Make the DSPn CLK CTRL to HW auto */
WR_MEM_32(CM_DSPn_CLKSTCTRL, 0x3);

/* Make the DSPn POWER domain to go to power off mode */
WR_MEM_32(PM_DSPn_PWRSTCTRL, (RD_MEM_32(PM_DSPn_PWRSTCTRL)& 0xFFFFFFFF0));

/* Disable DSPSS clock */
WR_MEM_32(CM_DSPn_DSPn_CLKCTRL, 0x0);

/* Reset assertion for DSP SS logic */
WR_MEM_32(RM_DSPn_RSTCTRL, 0x3);
```

This sequence should be performed even for devices where one or both DSPs are not supported.

The timeout value shown in the while loop is recommended as a software best practice. The poll for completion should always succeed before the timeout expires.

**REVISIONS IMPACTED** AM571x SR 2.0, 1.0  
AM570x SR 2.0

**i874** ***TIMER5/6/7/8 Interrupts Not Propagated***


---

**CRITICALITY** Low

**DESCRIPTION** When TIMER5, TIMER6, TIMER7, or TIMER8 clocks are enabled (CM\_IPU\_TIMER5/6/7/8\_CLKCTRL[0:1]MODULEMODE=0x2:ENABLE) and the CD-IPU is in HW\_AUTO mode (CM\_IPU\_CLKSTCTRL[0:1]CLKTRCTRL=0x3:HW\_AUTO) the corresponding TIMER will continue counting, but enabled interrupts will not be propagated to the destinations (MPU, DSP, etc) in the SoC until the TIMER registers are accessed from the CPUs (MPU, DSP etc.). This can result in missed timer interrupts.

**WORKAROUND** In order for TIMER5/6/7/8 interrupts to be propagated and serviced correctly the CD\_IPU domain should be set to SW\_WKUP mode (CM\_IPU\_CLKSTCTRL[0:1]CLKTRCTRL=0x2:SW\_WKUP).

**REVISIONS IMPACTED** AM571x SR 2.0, 1.0  
AM570x SR 2.0

**i875**
***Power-on-Reset (PORz) Warm Boot Hang***
**CRITICALITY**

High

**DESCRIPTION**

Following a warm Power-on-Reset (PORz) event, in which the supplies to the SoC remain ON throughout the assertion of PORz, the boot process may hang if the SoC is within a narrow temperature range.

The sensitive temperature range can be different on each device, is typically ~5°C wide, and typically occurs below 25°C.

The boot issue occurs only when the PORz signal is asserted to the SoC without turning-off the supplies to the SoC. No issue is observed in normal cold-boot operation in which the SoC boots up from a full power-off condition.

This erratum does not occur in typical use case scenarios. The boot hang may occur only if the PORz event is generated as a consequence of some other issue (e.g., runtime reset from an external MCU, or an SoC watchdog timer expiration resulting in PORz assertion) while the SoC temperature is within a narrow range.

The issue results from improper power sequencing to an internal SRAM that is accessed during execution of the early stages of the boot process. During assertion of PORz, the SoC's on-chip LDO regulator supplying the SRAM tri-states its output, thus allowing internal supplies to the SRAM to drift down uncontrolled. This can result in improper sequencing as the LDO reapplies power to the SRAM upon de-assertion of PORz before internal supplies to the SRAM have fully ramped down. This situation can result in incorrect accesses to the SRAM during boot, causing the boot process to halt.

**WORKAROUND**

A board level workaround requires adding a 220 Ohm (+/- 5%) resistor onto the SRAM LDO supply (Cap\_vddram\_mpu2, ball K19). This resistor provides a controlled discharge path for the charge contained within the external 1uF LDO capacitor during the reset operation. The workaround effectiveness assumes that the active duration of the PORz signal is a typical 3.4ms or greater.

In systems with an MCU present, a second workaround technique can be utilized. The MCU performs a handshake with the device following a warm PORz to ensure that the device is responsive after the reset. On the occasion a hang occurs, the MCU should assert PORZ low for 200 ms. This eliminates the need for an external 220 Ohm resistor.

**REVISIONS IMPACTED**

AM571x SR 1.0

|                           |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           |
|---------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i878</b>               | <b><i>MPU Lockup with Concurrent DMM and EMIF Accesses</i></b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |
| <b>CRITICALITY</b>        | High                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      |
| <b>DESCRIPTION</b>        | <p>The MPU has two primary paths to DDR and system address space via the MPU Memory Adapter (MPU_MA).</p> <p>The Low Latency path is the predominant path for DDR accesses and provides direct/low latency/interleaved access to the two EMIFs.</p> <p>The L3 Interconnect path (via MPU_AXI2OCP bridge) is most typically used for access to non-DDR address space, but is also used for access to DMM and EMIF control registers and to Tiled regions of DDR address space.</p> <p>Issue is seen to come when there is a heavy memory access through the MPU L3 path, if the MPU is concurrently issuing write transactions via the Low Latency path to DDR and via the L3 Interconnect to the DMM/EMIF/Tiler address space then the transactions can hang and the MPU and DMM/DDR become unresponsive. A device reset is required in order to recover from this condition.</p>         |
| <b>WORKAROUND</b>         | <p>In order to completely avoid the issue, the MPU can avoid concurrent accesses to the DMM/EMIF/DDR address space via the Low Latency path and the L3 Interconnect path. In order to accomplish this, the MPU should avoid use of the L3 Interconnect path via the MPU by using DSP, IPU, or DMA to proxy accesses to the EMIF/DMM registers or Tiler DDR address space.</p> <p>In order to greatly reduce the probability of the issue occurring, the MPU_MA register at 0x482AF400 bits 2 and 1 can be set, that is, 0x482AF400  = 0x6. With this setting of MPU_MA register, the 3 different heavily loaded application scenario which earlier reproduced the issue was seen working fine for long duration testing.</p> <p>Note: The MPU_MA register is a valid register address location even though it is located outside the MPU memory space as specified in the device TRM.</p> |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |

|                           |                                                                                                                                                                                                                                                                                                                                                                                                                                                                    |
|---------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i879</b>               | <b><i>DSP MStandby Requires CD_EMU in SW_WKUP</i></b>                                                                                                                                                                                                                                                                                                                                                                                                              |
| <b>CRITICALITY</b>        | Low                                                                                                                                                                                                                                                                                                                                                                                                                                                                |
| <b>DESCRIPTION</b>        | <p>Issue is seen to come when there is need to place the DSP subsystem to a low power state.</p> <p>The DSP requires the internal emulation clock to be actively toggling in order to successfully enter a low power mode via execution of the IDLE instruction and PRCM MStandby/Idle handshake. This assumes that other prerequisites and software sequence are followed.</p>                                                                                    |
| <b>WORKAROUND</b>         | <p>The CD_EMU domain can be set in SW_WKUP mode via the CM_EMU_CLKSTCTRL[1:0]CLKTRCTRL field.</p> <p>The emulation clock to the DSP is free-running anytime CCS is connected via JTAG debugger to the DSP subsystem or when the CD_EMU clock domain is set in SW_WKUP mode.</p> <p><b>Note:</b> If it is sure that the DSP would never enter any low power state (in other words the DSP would never execute IDLE instruction), the workaround can be ignored.</p> |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                                                                                                                                                                                                                                                |

---

**i880** ***Ethernet RGMII2 Limited to 10/100 Mbps***


---

|                           |                                                                                                                                                                                                                                                     |
|---------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>CRITICALITY</b>        | High                                                                                                                                                                                                                                                |
| <b>DESCRIPTION</b>        | RGMII2 (rgmii1_* signals) Switching Characteristics only support 10/100 Mbps operation. RGMII2 Switching Characteristics are not compatible with 1000 Mbps operation. Refer to the device Data Manual for Switching Characteristics timing details. |
| <b>WORKAROUND</b>         | RGMII2 (rgmii1_* signals) should be used at 10/100 Mbps operation only. If 1000 Mbps operation is required, RGMII1 (rgmii0_* signals) can be used instead                                                                                           |
| <b>REVISIONS IMPACTED</b> | AM571x SR 1.0                                                                                                                                                                                                                                       |

|                           |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 |
|---------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i882</b>               | <b><i>EMIF: DDR ECC Corrupted Read/Write Status Response</i></b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                |
| <b>CRITICALITY</b>        | High                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |
| <b>DESCRIPTION</b>        | <p>For ECC-enabled DDR regions, only full quanta aligned writes are allowed (16-b quanta for 16-b data bus, and 32-b quanta for 32-b data bus). The EMIF has a mechanism to detect illegal sub-quanta writes to ECC-enabled space. It has two methods of reporting such errors. In case of such an illegal write:</p> <ol style="list-style-type: none"> <li>1. An error interrupt will be generated to the CPU.</li> <li>2. The EMIF will give an error status response to the offending initiator on the internal bus.</li> </ol> <p>In some corner conditions the internal bus response (method #2 above) may become corrupted and give a false read or write error response in spite of all transactions in the EMIF command fifo being valid/legal. Depending on how each initiator handles the specific internal bus error response, this can result in system instability. For instance, a false error response on an MPU read may result in an abort.</p> <p>The error interrupt behavior (method #1 above) is always correct. No false error interrupts are created, and only true illegal writes to ECC space are reported via interrupt. Access type and initiator for the last offending access will be logged.</p> |
| <b>WORKAROUND</b>         | <p>Disable ECC.</p> <p>OR</p> <p>Enable ECC for desired ranges in EMIF1, and ensure that all DDR write accesses to all of EMIF1 (including ECC protected and unprotected ranges) from all initiators are a multiple of quanta size and are quanta aligned.</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  |
| <b>REVISIONS IMPACTED</b> | AM571x SR 1.0                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   |

|                           |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             |
|---------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i883</b>               | <b><i>DSP Doesn't Wake from Subsystem Internal Interrupts</i></b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           |
| <b>CRITICALITY</b>        | Medium                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      |
| <b>DESCRIPTION</b>        | <p>When the C66x DSP CorePac enters a low power state (via the IDLE instruction and setting the Power-Down Controller Command Register (PDCCMD) bit 16) and the DSP subsystem remains active (e.g., EDMA is still active), the DSP should be able to wake from any interrupt source including EDMA completion interrupts.</p> <p>However, the DSP Internal IRQs (mapped to evt_in[31:16]) are unable to wake the DSP from a sleep/IDLE state, whereas DSP External IRQs (from the SoC IRQ_Crossbar) (mapped to evt_in[95:32]) are able to wake the DSP.</p> |
| <b>WORKAROUND</b>         | <p>The EDMA Completion Interrupts (DSPi_IRQ_TPCC_REGION[7:0] and DSPi_IRQ_TPCC_GLOBAL) are mapped to DSP Internal IRQs, and are also provided as outputs from the DSP subsystem and are mapped as inputs to the IRQ_CROSSBAR.</p> <p>In order to allow the C66x DSP CorePac to wake from a low power state when a subsystem EDMA interrupt is asserted, the desired interrupt can be mapped via the IRQ_CROSSBAR to one of the DSP External IRQs.</p>                                                                                                       |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         |

|                           |                                                                                                                                                                      |
|---------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i887</b>               | <b><i>MMC3 Speed Limited to 64 MHz</i></b>                                                                                                                           |
| <b>CRITICALITY</b>        | Low                                                                                                                                                                  |
| <b>DESCRIPTION</b>        | MMC3 Switching Characteristics only support 64 MHz, not 96 MHz as per original target. Refer to the device Data Manual for Switching Characteristics timing details. |
| <b>WORKAROUND</b>         | MMC3 interface should be used at a maximum of 64 MHz. The other MMC interfaces [2,1] support higher clock rates.                                                     |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                  |

|                           |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    |
|---------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i889</b>               | <b><i>UART Does Not Acknowledge Idle Request after DMA Has Been Enabled</i></b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    |
| <b>CRITICALITY</b>        | Medium                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             |
| <b>DESCRIPTION</b>        | <p>All UART modules in the SoC do not acknowledge an idle request after enabling the module's DMA feature, even if the DMA is subsequently disabled. Thus, the UART module cannot be clock idled after enabling DMA with</p> <ul style="list-style-type: none"> <li>• UART_SCR.DMA_MODE_CTL = 1 and UART_SCR.DMA_MODE_2 != 0</li> <li>OR</li> <li>• UART_SCR.DMA_MODE_CTL = 0 and UART_FCR.DMA_MODE = 1</li> </ul> <p>A consequence of this is that UARTx_CLKCTRL will remain in transition when trying to disable the module (UARTx_CLKCTRL = 0x10000) and the associated CLKACTIVITY bit will remain active.</p> |
| <b>WORKAROUND</b>         | Initiating a soft reset (UART_SYSC.SOFTRESET = 1) will allow the module to acknowledge the idle request.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                |

|                           |                                                                                                                                                                                                                    |
|---------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i890</b>               | <b><i>MMC1 IOs and PBIAS Must Be Powered-Up Before Isolation</i></b>                                                                                                                                               |
| <b>CRITICALITY</b>        | Medium                                                                                                                                                                                                             |
| <b>DESCRIPTION</b>        | IO Isolation, as described in TRM section “Isolation Requirements”, may fail if the MMC1 IOs and PBIAS are not powered-up.                                                                                         |
| <b>WORKAROUND</b>         | Power-up the MMC1 IOs and PBIAS before starting the Isolation Sequence. This can be done by setting the CTRL_CORE_CONTROL_PBIAS[27] SDCARD_BIAS_PWRDNZ and CTRL_CORE_CONTROL_PBIAS[26] SDCARD_IO_PWRDNZ bits to 1. |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                |

|                           |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         |
|---------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i893</b>               | <b>DCAN Initialization Sequence</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     |
| <b>CRITICALITY</b>        | Low                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     |
| <b>DESCRIPTION</b>        | If the DCAN module is allowed to enter/exit clock-gated mode dynamically while traffic is present on the DCAN interface (even if the traffic is not to/from the SoC) then the DCAN module and PRCM handshake state machines can become out of sync resulting in the DCAN module hanging.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                |
| <b>WORKAROUND</b>         | <p>In order to cleanly initialize the DCAN module the following sequence should be followed. Steps 1 and 2 can happen in any order, but should occur before Step 3.</p> <ol style="list-style-type: none"> <li>Configure the DCAN module's clock domain in SW_WKUP mode <ul style="list-style-type: none"> <li>DCAN1: CM_WKUPAON_CLKSTCTRL. CLKTRCTRL = 0x2</li> <li>DCAN2: CM_L4PER2_CLKSTCTRL. CLKTRCTRL= 0x2</li> </ul> </li> <li>Configure CD_L4_CFG for NO_SLEEP mode <ul style="list-style-type: none"> <li>CM_L4CFG_CLKSTCTRL. CLKTRCTRL = 0x0</li> </ul> </li> <li>Execute RAM Init Sequence: <ul style="list-style-type: none"> <li>Mask the RX input via pinmux configuration <ul style="list-style-type: none"> <li>Select default/gpio function instead of dcan rx. Specific register and MUXMODE value depends on pin-mux used on the board</li> <li>For DCAN1 muxed with WAKEUP0:<br/>CTRL_CORE_PAD_WAKEUP0.MUXMODE = 0xF</li> </ul> </li> <li>Enable DCAN module <ul style="list-style-type: none"> <li>DCAN1: CM_WKUPAON_DCAN1_CLKCTRL.MODULEMODE = 0x2</li> <li>DCAN2: CM_L4PER2_DCAN2_CLKCTRL.MODULEMODE = 0x2</li> </ul> </li> <li>Perform RAM_INIT sequence <ul style="list-style-type: none"> <li>DCAN1: CTRL_CORE_CONTROL_IO_2. DCAN1_RAMINIT_START = 0x1</li> <li>DCAN2: CTRL_CORE_CONTROL_IO_2. DCAN2_RAMINIT_START = 0x1</li> <li>Poll for CTRL_CORE_CONTROL_IO_2. DCAN1_RAMINIT_DONE and DCAN2_RAMINIT_DONE</li> </ul> </li> <li>Enable RX input via pin mux configuration <ul style="list-style-type: none"> <li>Select dcan_rx function</li> <li>Specific register and MUXMODE value depends on pin-mux used on the board</li> <li>For DCAN1 muxed with WAKEUP0:<br/>CTRL_CORE_PAD_WAKEUP0.MUXMODE = 0x1</li> </ul> </li> </ul> </li> </ol> |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     |

|                           |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  |
|---------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i895</b>               | <b><i>EMIF_FW: System Hang When EMIF Firewall Is Reconfigured While There Is Activity on EMIF Interface</i></b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  |
| <b>CRITICALITY</b>        | High                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             |
| <b>DESCRIPTION</b>        | <p>If there is ongoing activity on the EMIF interface via the DMM path, any reconfiguration of EMIF_FW firewall instance can result in a system hang. This applies only to the EMIF_FW firewall instance. All other firewall instances can be safely re-configured at run-time using the sequence mentioned in TRM.</p> <p>To reconfigure the firewall configuration at run-time, following sequence is to be followed:</p> <ol style="list-style-type: none"> <li>1. Set the REGUPDATE_CONTROL[0] BUSY_REQ bit to 0x1 to ensure that no transaction can reach the slave NIU (suspend).</li> <li>2. Update the firewall registers as required.</li> <li>3. Set the REGUPDATE_CONTROL[0] BUSY_REQ bit to 0x0 to resume the transactions.</li> </ol> <p>In case of EMIF_FW firewall instance, the transactions to the slave (EMIF) are not blocked correctly in step 1 mentioned above. Initiator remains unaware that EMIF is not accepting commands and waits indefinitely for a response resulting in a system hang.</p>                                                        |
| <b>WORKAROUND</b>         | <p>EMIF_FW firewall instance should not be reconfigured when there is on-going activity on the EMIF interface.</p> <p>Following choices can be made based on practical constraints in the system.</p> <ol style="list-style-type: none"> <li>1. All firewall configurations are done one-time during the initial boot-up phase where EMIF transactions can be easily guaranteed to be not active. This will typically be done by a secondary boot loader or any other initialization software.</li> <li>2. Using inter-processor communication between all the cores in the system, ensure that there is no activity on the EMIF interface. At this point, firewall can be reconfigured safely.</li> <li>3. For some use-cases, to achieve same effect as changing firewall configuration at run-time, user can use a combination of DMM/MMU/Firewalls. In this case, firewall configuration is done only once during boot. Access permissions are controlled using aliased memory map created using DMM and controlling access to this aliased memory map using MMU.</li> </ol> |
| <b>REVISIONS IMPACTED</b> | AM571x SR 1.0                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    |

|                           |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  |
|---------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i896</b>               | <b><i>USB xHCI Port Disable Feature Does Not Work</i></b>                                                                                                                                                                                                                                                                                                                                                                                                                                        |
| <b>CRITICALITY</b>        | Low                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              |
| <b>DESCRIPTION</b>        | <p>USB software would typically disable the port if the attached device is behaving incorrectly or has become unresponsive. Due to the bug if the port is disabled using the PED bit in the PORTSC register, it subsequently fails to detect any detach/attach events. In other words, if the attached device were to be disconnected after it has been disabled using PED bit, the USB controller will be unable to detect and report it. This issue only applies to HighSpeed mode.</p>        |
| <b>WORKAROUND</b>         | <p>Option 1: If possible, use of Port Disable should be completely avoided. Since its use is only in error scenarios for eg. unresponsive devices, this is feasible.</p> <p>Option 2: Instead of disabling the port, power off the port using PP and then power it back on. Now the port can detect attach/detach events again. To ensure that same scenario does not occur over and over, the erroneous device must be removed before attempting to recognize and enumerate a device again.</p> |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                                                                                                                                                                                                                                                                              |

**i897**
**USB xHCI Stop Endpoint Command Does Not Work in Certain Circumstances**
**CRITICALITY**

Low

**DESCRIPTION**

USB xHCI Stop Endpoint feature can, in addition to other scenarios, be used to recover from a situation where a particular endpoint of the attached device has become unresponsive due to various reasons. By stopping the endpoint, the xHCI host would normally stop all ongoing communication with the said endpoint. Other endpoints are not affected.

Due to the bug, in the following scenario, the Stop Endpoint will not function correctly:

- USB Controller connected to a Highspeed hub through zero or more hubs.
- FullSpeed device connected to any of the above hubs.
- Assume the USB Controller has already enumerated the Hub.
- USB Controller now starts to enumerate the FullSpeed device. In the Address Device step, BSR is set to 1.
- Next it performs GetDescriptor (device not addressed yet since BSR=1).
- - Suppose that the FullSpeed device has is faulty and does not respond to the GetDescriptor Setup stage.
- The GetDescriptor is now stuck in CSPLIT-SETUP-NYET.
- At this point the application intends to recover from this error.

The Stop Endpoint when issued at this point never completes and the xHCI Controller will continuous send the CSPLIT-SETUP command since it never receives an ACK. In addition an attempt to abort the command using the CA bit in CRCR register also does not succeed.

**WORKAROUND**

Option 1: In the Address Device command set BSR=0 so that SET\_ADDRESS command is actually executed before GetDescriptor.

Option 2: Instead of Stop Endpoint, perform the Disable Slot command. The difference from Stop Endpoint is that this command shall stop all endpoints and interfaces associated with the device.

**REVISIONS IMPACTED**

AM571x SR 2.0, 1.0  
AM570x SR 2.0

|                           |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              |
|---------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i898</b>               | <b><i>DSP Pre-fetch Should Be Disabled before Entering Power Down Mode</i></b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |
| <b>CRITICALITY</b>        | Medium                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |
| <b>DESCRIPTION</b>        | <p>The DSP may hang after multiple iterations of going into C66x Corepac Power Down and wake up from external events.</p> <p>The C66x XMC (External Memory Controller) can have outstanding pre-fetch requests when C66x Corepac transitions to a Power Down state. The XMC clocks are gated internally during this transition. While XMC clocks are gated, outstanding pre-fetch request responses are not seen by the XMC which leads to an inconsistent state between the XMC and the L3 Interconnect. When the DSP wakes up, this can manifest as different symptoms within the DSP subsystem, including Cache corruption, incorrect data being returned to the CPU, and can eventually lead to a DSP hang condition.</p>                                                                                                                                                                                                                                                                                                                                                                                                                |
| <b>WORKAROUND</b>         | <p>The steps to avoid this issue are as given below:</p> <ol style="list-style-type: none"> <li>1. Ensure the code which places the DSP C66x Corepac to Power Down State (power down entry procedure shown below) is placed in the DSP C66x L2 RAM memory.</li> <li>2. Set the IDLE bit in PDCCMD register during initialization.</li> <li>3. Inside the power down entry procedure include the following software sequence: <ol style="list-style-type: none"> <li>(a) Execute MFENCE instruction.</li> <li>(b) Write 1 to XPF_CMD.INV (address 0x0800_0300).</li> <li>(c) Read XPFACS (address 0x0800_0304).</li> <li>(d) Execute IDLE instruction.</li> </ol> </li> </ol> <p>While executing multi-threaded DSP software with C66x Corepac Power Down caution should be observed to not allow the power down entry sequence to be preempted and switch context.</p> <p>The software developer can choose to not perform the above software sequence by never enabling the DSP C66x Pre-fetch. The developer should understand the impact of not enabling DSP Pre-fetch on the DSP CPU memory access performance in their application.</p> |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                          |

**i899**
***Ethernet DLR Is Not Supported***
**CRITICALITY**

Low

**DESCRIPTION**

The DLR function is comprised of two separate functions that act together to implement DLR. The first is DLR packet detection and priority escalation. The second is DLR unicast address detection and packet forwarding.

DLR packet detection should correctly detect that a DLR packet with no VLAN, a single VLAN, or two VLAN's has a DLR LTYPE. The packet should then be sent to the highest transmit FIFO priority of each destination egress port FIFO. In the case that the host port is the egress port, the packet should also be transferred to memory on the DLR channel.

DLR unicast address detection should match a unicast destination address and flood the packet to the VLAN minus the receive port and minus the host port. For a 3-port switch, a DLR unicast packet that is received (ingress) on an Ethernet port would be sent to the other Ethernet port. A DLR unicast packet that was received via the host port would be flooded to both Ethernet ports.

DLR cannot be enabled because the switch will enter an unknown state upon detection of a DLR packet. DLR unicast addresses can be added to the address table and will correctly flood to the VLAN minus the receive port and minus the host port. However, since DLR detection is dependent on enabling DLR (DLR\_EN bit) and such enablement is precluded due to the bug, no DLR packet detection or priority escalation can occur.

**WORKAROUND**

None.

**REVISIONS IMPACTED**

AM571x SR 2.0, 1.0  
AM570x SR 2.0

|                           |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             |
|---------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i900</b>               | <b><i>SoC Will Hang If Region 5 Accessed While CTRL_CORE_MMR_LOCK_5 Is Locked</i></b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |
| <b>CRITICALITY</b>        | Medium                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      |
| <b>DESCRIPTION</b>        | <p>CTRL_CORE_MMR_LOCK_5 register has unexpected behavior.</p> <p>There are five registers used to lock different memory regions of CTRL_MODULE_CORE memory space. A memory region is locked, means that all write accesses to this region are ignored. Writing a value unique for each register will lock certain memory region and writing another unique value results in unlocking of the same region.</p> <p>The functionality of CTRL_CORE_MMR_LOCK_5 register is different than the other 4 registers.</p> <p>If a write access to “locked” registers, which belong to MMR_LOCK_5 region is performed, all of the Control Module registers become inaccessible. Any write access to locked registers in MMR_LOCK_5 region leads to an error in Control Module interface bus.</p> <p>Therefore, the write access is not only ignored but also blocks further access to the Control Module forever.</p> |
| <b>WORKAROUND</b>         | <p>For accessing Control Module's configuration registers belonging to MMR_LOCK_5 region by CTRL_CORE_MMR_LOCK_5 register the following sequence must be used:</p> <ol style="list-style-type: none"> <li>1. Check if CTRL_CORE_MMR_LOCK_5 is locked - 0x143F832C. If yes, unlock CTRL_CORE_MMR_LOCK_5 as write 0x6F361E05.</li> <li>2. Modify the selected CTRL_CORE_PAD_x registers.</li> <li>3. Lock the CTRL_CORE_MMR_LOCK_5. The register is locked as write 0x143F832C.</li> <li>4. Do not write CTRL_CORE_PAD_x registers when CTRL_CORE_MMR_LOCK_5 is locked. This leads to an error in Control Module interface bus.</li> </ol>                                                                                                                                                                                                                                                                    |
| <b>REVISIONS IMPACTED</b> | <p>AM571x SR 2.0, 1.0</p> <p>AM570x SR 2.0</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              |

|                           |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  |
|---------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i903</b>               | <b><i>Ethernet RMII Interface RMII_MHZ_50_CLK Not Supported as Output Reference Clock</i></b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    |
| <b>CRITICALITY</b>        | High                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             |
| <b>DESCRIPTION</b>        | <p>The Ethernet EMAC module when operating in RMII mode has two clocking modes. In one case, a clock is generated externally and is an input to the SoC via the RMII_MHZ_50_CLK pin. This mode of operation functions properly and the timing specified in the Data Manual is valid.</p> <p>In the second case, the SoC drives a 50 MHz clock as an output on the RMII_MHZ_50_CLK pin. This output drives the clock to the external PHY. This mode of operation does not meet the timing specified in the Data Manual; and the resulting timing is not compatible with the RMII standard.</p>                                                                                                                                                                                    |
| <b>WORKAROUND</b>         | <p>When using either of the Ethernet ports in RMII mode (pins rmii0* or rmii1*) the RMII_MHZ_50_CLK signal must be configured as an input, and the clock must be generated external to the SoC. The internal clock generation mode is not supported.</p> <p>The following registers should be set to configure RMII_MHZ_50_CLK as an input:</p> <p>CM_GMAC_GMAC_CLKCTRL[CLKSEL_REF] = 1</p> <p>CTRL_CORE_SMA_SW_6[RMII_CLK_SETTING] = 1</p> <p>Alternatively, the Ethernet EMAC module supports MII or RGMII protocols/pins on both ports. Those modes can be used if the selected PHY supports them. The typical clocking modes for those interfaces are able to meet the timing specified in the Data Manual for 100 Mbps operation (which is the rate supported by RMII).</p> |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              |

|                           |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  |
|---------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i904</b>               | <b><i>CSI Interface Setup/Hold Timing Does Not Meet MIPI DPHY Spec above 600MHz</i></b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                          |
| <b>CRITICALITY</b>        | Medium                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           |
| <b>DESCRIPTION</b>        | When running the CSI2 interface at greater than 600MHz (1.2Gbps per lane), setup/hold times are not compliant with limits required by the MIPI CSI2 DPHY specification. Systems using the CSI2 interface at less than or equal to 600MHz are not affected.                                                                                                                                                                                                                                                                                                                                                                                                       |
| <b>WORKAROUND</b>         | <p>Since the CSI2 interface includes up to 4 data lanes (plus 1 clock lane), data can be distributed across multiple lanes in order to keep the clock rate lower. Otherwise, the output delay timings of the external CSI2 transmitter device should be analyzed in comparison with the setup/hold timing requirements of the CSI2 receiver to confirm timing compatibility before attempting to run the interface at frequencies above 600MHz. Consult your local TI representative for more information on CSI2 receiver setup/hold timings at frequencies above 600MHz.</p> <hr/> <p><b>NOTE:</b> AM570x CSI2 interface includes only 2 data lanes.</p> <hr/> |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              |

**i906**
***USB3.0 and PCIe Gen2 Electrical Compliance***


---

**CRITICALITY**

Low

**DESCRIPTION**

PCIe Gen2 transmitted signals may slightly exceed the jitter requirements of the electrical specification. USB3.0 transmitted signals may be slightly marginal to the eye height requirement of the USB3.0 transmitter electrical specification.

**WORKAROUND**

None.

**REVISIONS IMPACTED**

AM571x SR 1.0

**i907** — *PRU-ICSS2 MII1 Port Is Not Supported When PRU-ICSS PRU1 Internal Wrapper Multiplexing Configured for MII2 Mode* www.ti.com

|                           |                                                                                                                                                                                                                                                                                                                                                                                                        |
|---------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i907</b>               | <b><i>PRU-ICSS2 MII1 Port Is Not Supported When PRU-ICSS PRU1 Internal Wrapper Multiplexing Configured for MII2 Mode</i></b>                                                                                                                                                                                                                                                                           |
| <b>CRITICALITY</b>        | Low                                                                                                                                                                                                                                                                                                                                                                                                    |
| <b>DESCRIPTION</b>        | <p>The PRU-ICSS2 MII1 port is not supported when the PRU-ICSS Internal Wrapper Multiplexing for the PRU1 core of either PRU-ICSS1 or PRU-ICSS2 is set to MII2 mode. This mode is configured when:</p> <ul style="list-style-type: none"> <li>• PRUSS_GPCFG1.PR1_PRU1_GP_MUX_SEL = MII2 mode (Value:0x4)</li> </ul> <p>No other PRU-ICSS MII ports or PRU-ICSS Internal Wrapper modes are affected.</p> |
| <b>WORKAROUND</b>         | None.                                                                                                                                                                                                                                                                                                                                                                                                  |
| <b>REVISIONS IMPACTED</b> | AM571x SR 1.0                                                                                                                                                                                                                                                                                                                                                                                          |

|                           |                                                                                                                                                                                                                                                                                                                                                                                                                                         |
|---------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i913</b>               | <b><i>CSI2 LDO Needs to Be Disabled when Module Is Powered On</i></b>                                                                                                                                                                                                                                                                                                                                                                   |
| <b>CRITICALITY</b>        | High                                                                                                                                                                                                                                                                                                                                                                                                                                    |
| <b>DESCRIPTION</b>        | <p>Enabling CSI2 LDO shorts it to core supply. It is crucial the 2 CSI2 LDOs on the device are disabled if CSI-2 module is powered on (0x4845 B304   0x4845 B384 [28:27] = 0x1) or in ULPS (0x4845 B304   0x4845 B384 [28:27] = 0x2) mode. Common concerns include: high current draw on the module supply in active mode.</p> <p>Errata does not apply when CSI-2 module is powered off (0x4845 B304   0x4845 B384 [28:27] = 0x0).</p> |
| <b>WORKAROUND</b>         | <p><b>CSI-2 module enabled:</b></p> <p>Set the following register bits to disable the LDO:</p> <ul style="list-style-type: none"> <li>• For CSI2_PHY1: Set bit 6 of 0x4845 B828</li> <li>• For CSI2_PHY2: Set bit 6 of 0x4845 B928</li> </ul>                                                                                                                                                                                           |
| <b>REVISIONS IMPACTED</b> | AM571x SR 1.0                                                                                                                                                                                                                                                                                                                                                                                                                           |

**i916** ***QSPI Reads Can Fail For Flash Devices with HOLD Function***
**CRITICALITY** High

**DESCRIPTION** The default internal pull-up/pull-down on the SoC QSPI interface can interfere with the HOLD function implemented in some QSPI FLASH devices leading to Read Failures. This is most likely to be seen at higher clock rates, and with EDMA reads of greater than 128-Bytes.

In Quad SPI mode, the SoC QSPI IP transmits the command and address to the flash device on data line D0 and reads the data back on all four data lines D0, D1, D2 and D3. The default values of the data lines i.e. values when there is no driver on lines are LOW for D0 and D1 and HIGH for D2 and D3. These values are dictated by the internal and external pull ups.

When the last bit on the last read driven by the FLASH doesn't match the 'default value', the data lines D1, D2 and D3 transition slowly to their default values i.e. LOW for D1 and HIGH for D2 and D3. The transition time is in the order of 100 ns and depends on board loadings. At higher frequencies (typically above 64MHz QSPI clock rate) the time from the last bit of data transfer to the first bit of the next command is not long enough to allow for the pull-ups to get the data lines D1, D2 and D3 to the desired state. It is possible that the D3 line is still in a LOW state when the next command transmission begins.

The D3 line is used by some flash devices as a HOLD signal. If the D3 line has not reached HIGH state by the time CS is reasserted, flash devices can infer that a HOLD is in effect and fail to service the current command.

This issue is most easily seen with EDMA reads of length greater than 128 bytes. CPU reads typically provide sufficient time between reads for the data lines to reach their default values.

**WORKAROUND** The software workaround is to disable the hold functionality on the QSPI device, preferably by setting a nonvolatile configuration register. On most flash devices, placing the QSPI device in Quad read mode automatically disables the HOLD functionality. On certain flash devices, there is a separate mode bit that can be set to disable the HOLD functionality. Typically this setting would be done in a Flash Writer utility that programs the flash with the customer's boot image and sets appropriate non-volatile mode bits. Depending on the software architecture, this mode bit setting may also be done in the boot-loader or HLOS kernel.

Disabling the HOLD functionality prevents the slow ramp on the D3 line from interrupting the operation of the QSPI flash device and allows EDMA reads at high clock speeds (64 MHz).

There are no negative effects of the workaround as HOLD functionality is not supported by the SoC QSPI IP.

**REVISIONS IMPACTED** AM571x SR 2.0, 1.0  
AM570x SR 2.0

|                           |                                                                                                                                                                                                                                                                                                                                                                                                                               |
|---------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i927</b>               | <b><i>SoC Doesn't Read Redundant ONFI Parameter Pages in NAND Boot Mode</i></b>                                                                                                                                                                                                                                                                                                                                               |
| <b>CRITICALITY</b>        | Low                                                                                                                                                                                                                                                                                                                                                                                                                           |
| <b>DESCRIPTION</b>        | In NAND boot mode if an ONFI NAND is detected, the SoC Boot ROM reads the NAND flash geometry from the first parameter page without checking the integrity CRCs. If there are CRC errors in the page, the ROM could use incorrect information about the NAND geometry and could fail to boot. The ONFI standard indicates that the CRC should be checked and in case of CRC errors a redundant parameter page should be used. |
| <b>WORKAROUND</b>         | Instead of using ONFI NAND, a non-ONFI NAND can be used. Note that when selecting a specific non-ONFI NAND, the Read ID and Geometry of the NAND should be compared to the supported configurations documented in the device Technical Reference Manual.                                                                                                                                                                      |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                                                                                                                                                                                                           |

## Silicon Limitations

This Chapter describes limitations for the given architecture and provides information for working with those issues.

### Revisions SR 2.0, 1.0 - Limitations List

| Title                                                                                                           | Page |
|-----------------------------------------------------------------------------------------------------------------|------|
| <b>i596</b> —BITMAP1-2-4 Formats Not Supported by The Graphics Pipeline.....                                    | 81   |
| <b>i641</b> —Overlay Optimization Limitations .....                                                             | 82   |
| <b>i833</b> —I2C Module in Multislave Mode Potentially Acknowledges Wrong Address .....                         | 83   |
| <b>i838</b> —DSS BT.656/BT.1120 Max Horizontal Blanking is Non Compliant.....                                   | 84   |
| <b>i845</b> —USB2.0 False Detection of Disconnect Condition.....                                                | 85   |
| <b>i848</b> —McASP IO Pad Loopback Not Functional .....                                                         | 86   |
| <b>i876</b> —DVFS Only Supported on MPU .....                                                                   | 87   |
| <b>i877</b> —RGMII Clocks Should Be Enabled at Boot Time .....                                                  | 88   |
| <b>i892</b> —L3 Clocks Should Be Enabled at All Times .....                                                     | 89   |
| <b>i909</b> —PCIe Unintentional Translation of Outbound Message TLPs.....                                       | 90   |
| <b>i922</b> —Usability of ECC Feature in the DDR Controller is Limited .....                                    | 91   |
| <b>i925</b> —PCI-Express Gen2 (5.0 GT/s) Operation Not Supported When Operating Junction Temperature <0°C ..... | 92   |

|                           |                                                                           |
|---------------------------|---------------------------------------------------------------------------|
| <b>i596</b>               | <b><i>BITMAP1-2-4 Formats Not Supported by The Graphics Pipeline</i></b>  |
| <b>CRITICALITY</b>        | Low                                                                       |
| <b>DESCRIPTION</b>        | BITMAP1, BITMAP2, and BITMAP4 are not supported by the graphics pipeline. |
| <b>WORKAROUND</b>         | No workaround is available.                                               |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                       |

| i641                      | <b>Overlay Optimization Limitations</b>                                                                                                                                                                                                                                            |
|---------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>CRITICALITY</b>        | Low                                                                                                                                                                                                                                                                                |
| <b>DESCRIPTION</b>        | <p>Overlay optimization does not work when resize processing is enabled on any 'Enabled' layer.</p> <p>When any of the 'Enabled' layers has bit field DISPC_P_ATTRIBUTES.RESIZEENABLE as nonzero it will neither be optimized nor participate in optimization of layers below.</p> |
| <b>WORKAROUND</b>         | <p>For optimization to occur for a particular layer, make RESIZEENABLE as 0x0. With multiple layers enabled, make RESIZEENABLE for all the layers as 0x0 for every layer to participate in overlay optimization of itself or for the layers below it.</p>                          |
| <b>REVISIONS IMPACTED</b> | <p>AM571x SR 2.0, 1.0</p> <p>AM570x SR 2.0</p>                                                                                                                                                                                                                                     |

| <b>i833</b>               | <b><i>I2C Module in Multislave Mode Potentially Acknowledges Wrong Address</i></b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   |
|---------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>CRITICALITY</b>        | Low                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  |
| <b>DESCRIPTION</b>        | <p>When the I2C module is in multislave mode with up to four 10-bit own addresses it may acknowledge the wrong address. According to the I2C protocol, a 10-bit address is sent via 2 bytes. The first byte is formatted as 11110XX R/W where XX are the 2 MSB of the address. The second byte contains the remaining 8 bits of the device address.</p> <p>When the first byte received contains 2 MSB that matches the 2 MSB of the one of the modules four own addresses, an ACK is correctly sent by the module. However, if the second byte received matches the remaining 8 bits of one of the modules other own addresses, an ACK is sent incorrectly by that module. In turn, the incorrect module then enters an internal state where starts reading data sent on the bus not intended for it.</p> <p>The module should only send a second ACK if the entire 10-bit address matches one of its four own addresses. However, the module incorrectly ACKs any address that matches the first 2 bits of one slave address and the last eight bits of another slave address.</p> |
| <b>WORKAROUND</b>         | The issue can be avoided by ensuring that the 2 most significant bits are identical for all multislave addresses in 10-bit addressing mode.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                          |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  |

## i838 *DSS BT.656/BT.1120 Max Horizontal Blanking is Non Compliant*

**CRITICALITY** Medium

### DESCRIPTION

---

**NOTE:** VOUT1 is not supported in AM570x family of devices.

---

When BT.656 or BT.1120 modes are used on DSS outputs (VOUT1,2,3), the configuration of the horizontal blanking timing is limited to a value of 256 bytes or less due to the HSW bit field being limited to 8b (256 max value). The BT.656 standard requires 280 or 268 bytes to support PAL and NTSC timings respectively. BT.1120 requires 280, 720, 830 depending on format. The DSS cannot support devices requiring such blanking duration due to this limitation.

**WORKAROUND** If larger blanking period needed, use RGB or YUV mode output, not BT.656/1120.

**REVISIONS IMPACTED** AM571x SR 2.0, 1.0  
AM570x SR 2.0

|                           |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         |
|---------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i845</b>               | <b><i>USB2.0 False Detection of Disconnect Condition</i></b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |
| <b>CRITICALITY</b>        | Low                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     |
| <b>DESCRIPTION</b>        | <p>Per the standard, the 'Envelope detector' in the USB2.0 PHY must indicate High Speed disconnection when the amplitude of the differential signal at the downstream facing driver's connector is greater than or equal to 625 mV, and it must not be indicated when the signal amplitude is less than or equal to 525 mV at our connector. The default configuration of the USB1/USB2 phy is such that the detector circuit is monitoring the during the entire SOF frame and not just the last 8b portion of the extended EOP as indicated in the standard.</p> <p>Due to this constant monitoring, it is possible that the PHY may falsely indicate disconnect condition due to reflections on the PCB. These reflections could exceed the disconnect thresholds if TI PCB layout guidelines for USB are not strictly followed.</p> |
| <b>WORKAROUND</b>         | <p>SW Workaround: During USB2.0 PHY initialization, configure: bit 31 of 0x4A08 404C (USB1) or 0x4A08 504C (USB2) to =1b. This will limit detection window to the proper time and prevent false disconnect. TI PCB layout guidelines for USB should also be strictly followed to minimize reflections to within the thresholds defined in the standard. See device Data Manual for details.</p>                                                                                                                                                                                                                                                                                                                                                                                                                                         |
| <b>REVISIONS IMPACTED</b> | <p>AM571x SR 2.0, 1.0<br/>AM570x SR 2.0</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             |

|                           |                                                                                                                                                                                                                                                                                                      |
|---------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i848</b>               | <b><i>McASP IO Pad Loopback Not Functional</i></b>                                                                                                                                                                                                                                                   |
| <b>CRITICALITY</b>        | Low                                                                                                                                                                                                                                                                                                  |
| <b>DESCRIPTION</b>        | <p>Due to timing issues, the IO pad loopback feature of the McASP, configured by setting DLBEN=1 and IOLBEN=1 in the McASP_LBCTL register, will sometimes result in corrupt serializer data.</p> <p>This feature is intended for development only. All McASP instances are potentially affected.</p> |
| <b>WORKAROUND</b>         | Use digital loopback, which is logically equivalent. Digital loopback is configured by setting DLBEN=1 and IOLBEN=0b in the appropriate McASP_LBCTL register.                                                                                                                                        |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                                                                                  |

|                           |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           |
|---------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i876</b>               | <b><i>DVFS Only Supported on MPU</i></b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  |
| <b>CRITICALITY</b>        | Low                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |
| <b>DESCRIPTION</b>        | <p>Dynamic Voltage Frequency Scaling (DVFS) refers to a software technique where the various SoC AVS rails are changed from one OPP level to another in order to either adapt to a changing work-load, or in order to avoid device operation outside of desired temperature bounds.</p> <p>The SoC only supports DVFS on the MPU rail.</p>                                                                                                                                                                                                |
| <b>WORKAROUND</b>         | <p>Software may use DVFS only on the MPU rail. For example, SW may change the MPU operation from OPP_NOM (1 GHz, at OPP_NOM AVS voltage level) to OPP_HIGH (1.5 GHz, at OPP_HIGH AVS voltage level) in order to accommodate an increased work-load, or may change the MPU operation from OPP_HIGH to OPP_NOM if the temperature exceeds a certain threshold.</p> <p>The supply rails and OPP conditions (Frequency/Voltage) for non-MPU rails should be set at boot-time and remain at that OPP voltage level during device run-time.</p> |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |

|                           |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             |
|---------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i877</b>               | <b>RGMII Clocks Should Be Enabled at Boot Time</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                          |
| <b>CRITICALITY</b>        | Medium                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      |
| <b>DESCRIPTION</b>        | <p>The RGMII 1000 Mbps Transmit timing is based on the output clock (rgmiin_txc) being driven relative to the rising edge of an internal clock and the output control/data (rgmiin_txctl/txd) being driven relative to the falling edge of an internal clock source. If the internal clock source is allowed to be static low (i.e., disabled) for an extended period of time then when the clock is actually enabled the timing delta between the rising edge and falling edge can change over the lifetime of the device. This can result in the device switching characteristics degrading over time, and eventually failing to meet the Data Manual Delay Time/Skew specs.</p> <p>To maintain RGMII 1000 Mbps IO Timings, SW should minimize the duration that the Ethernet internal clock source is disabled. Note that the device reset state for the Ethernet clock is "disabled".</p> <p>Other RGMII modes (10 Mbps, 100Mbps) are not affected.</p> |
| <b>WORKAROUND</b>         | <p>If the SoC Ethernet interface(s) are used in RGMII mode at 1000 Mbps, SW should minimize the time the Ethernet internal clock source is disabled to a maximum of 200 hours in a device life cycle. This is done by enabling the clock as early as possible in IPL (QNX) or SPL/u-boot (Linux/Android) by setting the register CM_GMAC_CLKSTCTRL[1:0]CLKTRCTRL = 0x2:SW_WKUP.</p> <p>In addition to programming SW_WKUP(0x2) on CM_GMAC_CLKSTCTRL, SW should also program modulemode field as ENABLED(0x2) on CM_GMAC_GMAC_CLKCTRL register.</p> <p>If the application does not require Ethernet functionality ever, the developer can choose to place the GMAC module in a power disabled state<br/>CM_GMAC_GMAC_CLKCTRL.MODULEMODE = 0x0 (disabled) and<br/>CM_GMAC_CLKSTCTRL.CLKTRCTRL = 0x1 (SW_SLEEP) during the boot operation.</p>                                                                                                                 |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         |

|                           |                                                                                                                                                        |
|---------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i892</b>               | <b><i>L3 Clocks Should Be Enabled at All Times</i></b>                                                                                                 |
| <b>CRITICALITY</b>        | Medium                                                                                                                                                 |
| <b>DESCRIPTION</b>        | If the L3 clock (L3_ICLK) is allowed to be gated by the PRCM, the device internal timing can degrade leading to functional issues and device failures. |
| <b>WORKAROUND</b>         | The L3 clock (L3_ICLK) should be enabled at all times.                                                                                                 |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                    |

| <b>i909</b>               | <b><i>PCIe Unintentional Translation of Outbound Message TLPs</i></b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 |
|---------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>CRITICALITY</b>        | Medium                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                |
| <b>DESCRIPTION</b>        | <p>There is a limitation in internal address translation unit in which unintentional translation of outbound message TLPs can occur if the third and fourth double words of the header match an iATU region. The unintentional translation is most likely to occur in the case of an address translation region at location 0x0 in address space since many message TLPs require the third and fourth double words of the header to be 0x0.</p> <p>Outbound completion TLPs also partially suffer from the same issue. Completion TLPs are never translated by the controller. However if the client address is held at a value which matches an outbound iATU region when a completion TLP is being transmitted, the controller will reduce the credit counter of the type specified in that region. Because the client address bus is normally held at address 0x0 when transmitting completion TLPs, this issue generally occurs when an address translation region is defined at address 0x0.</p> |
| <b>WORKAROUND</b>         | <p>Do not configure an outbound iATU region starting at address 0x0. Instead, only configure outbound iATU regions starting at address 0x1000 or greater.</p> <p>At the SoC level, this workaround effectively reduces each PCIE_SSx 256MiB L3_MAIN address window to 256MiB – 4KB, starting at address 0x2000_1000 for PCIE_SS1 and address 0x3000_1000 for PCIE_SS2.</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |
| <b>REVISIONS IMPACTED</b> | <p>AM571x SR 2.0, 1.0<br/>AM570x SR 2.0</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           |

| <b>i922</b>               | <b><i>Usability of ECC Feature in the DDR Controller is Limited</i></b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           |
|---------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>CRITICALITY</b>        | High                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              |
| <b>DESCRIPTION</b>        | <p>For ECC-enabled DDR regions, only quanta-sized, quanta-aligned writes are allowed (16-bit quanta for 16-bit DDR data bus, and 32-bit quanta for 32-bit DDR data bus).</p> <p>For the ARM and DSP as initiators, if the caches are appropriately enabled, it is possible to ensure full quanta, aligned writes. However, for other initiators in the device (for example, EMAC, USB, 3D, 2D, IVA, PCIe, SATA, DMA, MMC, and so forth) it is difficult and in many cases impossible to ensure full quanta, aligned writes under all scenarios and use cases. The software and drivers would need to be partitioned such that the drivers for these initiators only utilize non-ECC protected memory regions. This requires significant modifications to the operating system and drivers that are neither implemented in the TI Processor SDK nor supported.</p> |
| <b>WORKAROUND</b>         | <p>Disable ECC</p> <p>Or</p> <p>Partition the EMIF1 memory range into ECC protected and non-ECC protected regions. For the ECC protected region, ensure that all DDR write accesses are a multiple of quanta size and are quanta aligned. This requires modifications to the operating system and drivers that TI does not implement nor support.</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             |
| <b>REVISIONS IMPACTED</b> | <p>AM571x SR 2.0, 1.0</p> <p>AM570x SR 2.0</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    |

**i925** ***PCI-Express Gen2 (5.0 GT/s) Operation Not Supported When Operating Junction Temperature <0°C***

---

|                           |                                                                                                                                                                                                                                 |
|---------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>CRITICALITY</b>        | High                                                                                                                                                                                                                            |
| <b>DESCRIPTION</b>        | PCI-Express (PCIe) Gen2 (5.0 GT/s) operation is not supported for operating junction temperatures (Tj) of < 0°C. Limit device operation to PCIe Gen1 (2.5 GT/s) in both Endpoint and Root-Complex configurations when Tj < 0°C. |
| <b>WORKAROUND</b>         | None                                                                                                                                                                                                                            |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0<br>AM570x SR 2.0                                                                                                                                                                                                  |

## Silicon Cautions

This Chapter alerts device users to silicon sensitivity concerns. Items described in the following section are compliant with specification (neither bug nor limitation), but it is mandatory to carefully respect guidelines to ensure correct device behavior.

### Revisions SR 2.0, 1.0 - Cautions List

| Title                                                                                                   | Page |
|---------------------------------------------------------------------------------------------------------|------|
| <b>i827</b> — Thermal Alert Will Not Be Generated When Bandgap Is Configured in "Smart Idle" Mode ..... | 94   |
| <b>i832</b> — DLL SW Reset Bit Does Not Reset to 0 after Execution .....                                | 95   |
| <b>i836</b> — Bus Testing Commands CMD19 Incorrectly Waits for CRC Status Return .....                  | 96   |
| <b>i839</b> — Some RGB and YUV Formats Have Non-Standard Ordering .....                                 | 97   |
| <b>i864</b> — VDDS18V to VDDSHVn Current Path .....                                                     | 98   |
| <b>i885</b> — Software Requirements for Data Manual IO Timing .....                                     | 100  |
| <b>i886</b> — FPDLink PLL Unlocks with Certain SoC PLL M/N Values.....                                  | 101  |
| <b>i912</b> — QSPI_SPI_CMD_REG [25:24] Masked from Read in RTL.....                                     | 102  |
| <b>i918</b> — Dual-rank DDR with Twin Die Configuration is Not Supported .....                          | 103  |
| <b>i920</b> — DSS VOUT1, VOUT2, and VOUT3 Supported Only at 1.8V .....                                  | 104  |
| <b>i921</b> — Limited GPMC Use Case Supported at 3.3V.....                                              | 105  |
| <b>i926</b> — PCIe Preferred PCIe_PHY_RX SCP Register Settings Updated.....                             | 106  |

|                           |                                                                                                                                                                                                                                                                                                                             |
|---------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i827</b>               | <b><i>Thermal Alert Will Not Be Generated When Bandgap Is Configured in "Smart Idle" Mode</i></b>                                                                                                                                                                                                                           |
| <b>CRITICALITY</b>        | Low                                                                                                                                                                                                                                                                                                                         |
| <b>DESCRIPTION</b>        | The MPU will not receive an interrupt request for thermal alert (MPU_IRQ_126) if the MPU bandgap cell is in idle mode. When the MPU bandgap cell is in idle state (CTRL_CORE_BANDGAP_MASK_1[31:30] SIDLEMODE=0x2), the MPU bandgap state machine can not send THERMAL_ALERT signal and MPU interrupt request, respectively. |
| <b>GUIDELINES</b>         | Do not idle the Control Module MPU Bandgap (keep CTRL_CORE_BANDGAP_MASK_1 [31:30]SIDLEMODE=0x0)                                                                                                                                                                                                                             |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                                                                                                         |

|                           |                                                                                                                                                                                                                                                                                                                     |
|---------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i832</b>               | <b><i>DLL SW Reset Bit Does Not Reset to 0 after Execution</i></b>                                                                                                                                                                                                                                                  |
| <b>CRITICALITY</b>        | Medium                                                                                                                                                                                                                                                                                                              |
| <b>DESCRIPTION</b>        | When autoidle is enabled (MMCHS_SYSCONFIG[0]AUTOIDLE=0x1), clock gets cut off and the reset completion signal would not be recorded by the processor. Hence, though the reset executed and finished, the MMCHS_DLL[31]DLL_SOFT_RESET flag will remain asserted indefinitely and another soft reset will be ignored. |
| <b>WORKAROUND</b>         | <p>Disable autoidle (MMCHS_SYSCONFIG[0]AUTOIDLE=0x0), before DLL reset and reenale autoidle after the reset.</p> <p>Set MMCHS_SYSCONFIG[0]AUTOIDLE = 0 before reset.</p> <p>Set MMCHS_SYSCONFIG[0]AUTOIDLE = 1 after the reset.</p>                                                                                 |
| <b>REVISIONS IMPACTED</b> | <p>AM571x SR 2.0, 1.0</p> <p>AM570x SR 2.0</p>                                                                                                                                                                                                                                                                      |

|                           |                                                                                                                                                                                                                                                                                                               |
|---------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i836</b>               | <b><i>Bus Testing Commands CMD19 Incorrectly Waits for CRC Status Return</i></b>                                                                                                                                                                                                                              |
| <b>CRITICALITY</b>        | Low                                                                                                                                                                                                                                                                                                           |
| <b>DESCRIPTION</b>        | CMD19/CMD14 commands are required for MMC to test data bus pins functionality. After the MMC controller sends out CMD19, it incorrectly waits for the CRC status to be returned. Because no CRC status is generated by the card at this step, the MMC controller signals an interrupt for Data Timeout (DTO). |
| <b>GUIDELINES</b>         | Ignore DTO generated after CMD19 is sent, then clear the interrupt and proceed with CMD14.                                                                                                                                                                                                                    |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                                                                                           |

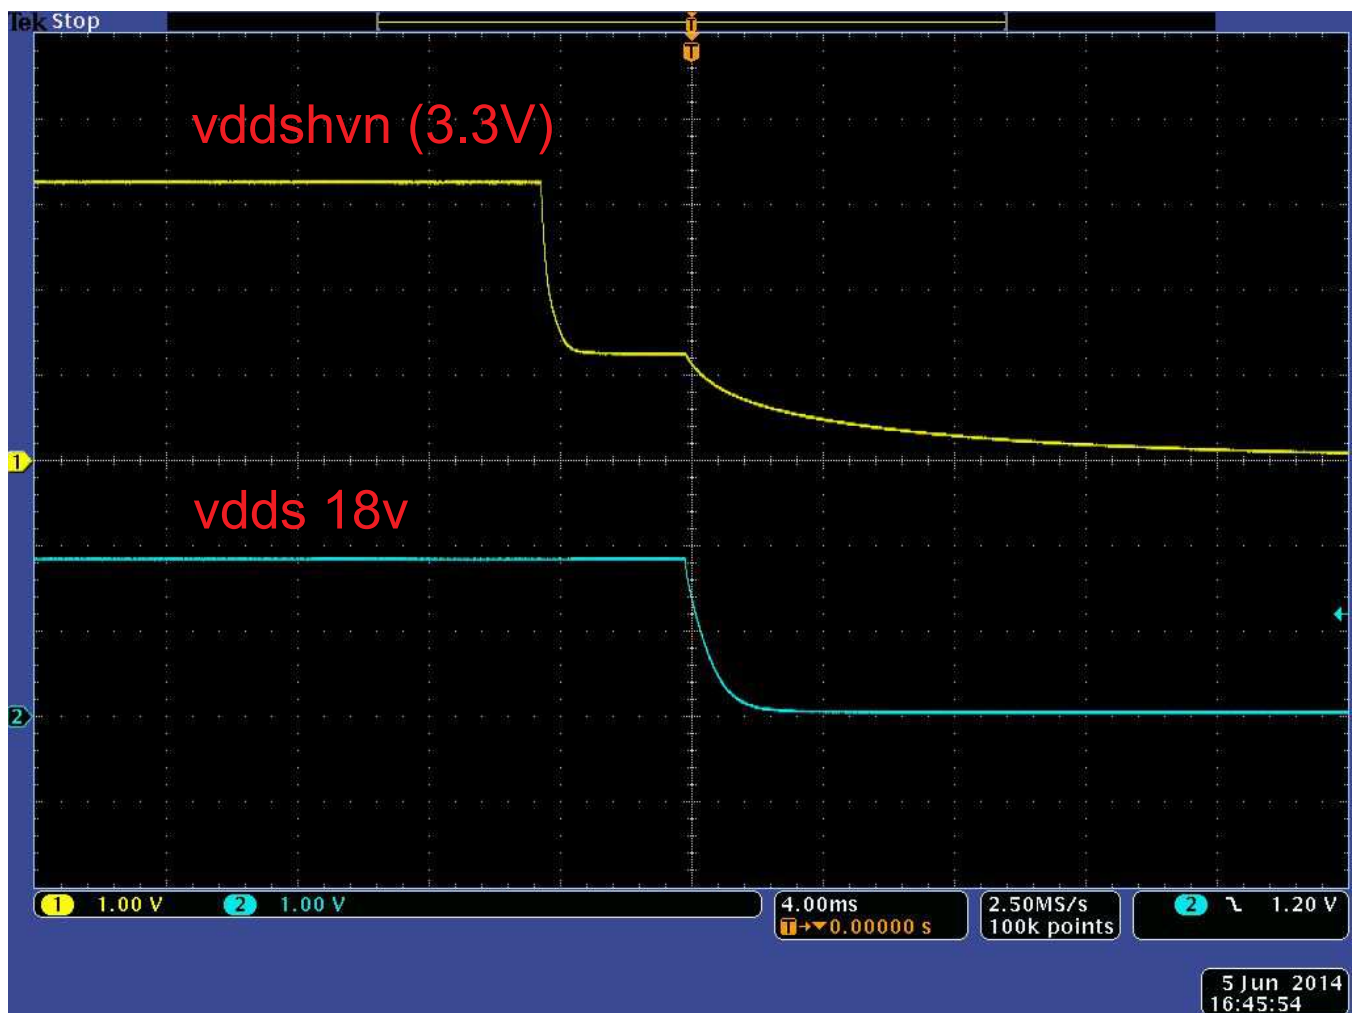
|                           |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                |
|---------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i839</b>               | <b><i>Some RGB and YUV Formats Have Non-Standard Ordering</i></b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              |
| <b>CRITICALITY</b>        | Medium                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         |
| <b>DESCRIPTION</b>        | <p>Data format definitions are non-standard and resulting in color components being swapped if wrong assumption is made in software.</p> <p>To configure data packing/unpacking logic for each active data channel, the VPDMA (in the VPE, and VIP) relies on the 'data type' value in the channel's data transfer descriptor. Due to mismatches in the component order directions between what the VPDMA specifies and what commonly used image identifiers expect, color components can be swapped in the display and in the video/image data written out to the memory for some RGB and YUV data types.</p> |
| <b>GUIDELINES</b>         | Software drivers should remap custom formats to the desired industry standard formats and/or treat data as word/byte swapped as appropriate. See also Device TRM for full explanation of data formats.                                                                                                                                                                                                                                                                                                                                                                                                         |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |

**i864** **VDDS18V to VDDSHVn Current Path**
**CRITICALITY** Medium

**DESCRIPTION** A current path exists between vdds18v and vddshvn during power down sequence.

The Data Manual allows the vddshvn rail (in either 3.3V or 1.8V mode) to power down at the same time or before the vdds18v rail. When the vddshvn rail is powered down before the vdds18v rail, the vddshvn rail stays at Plateau Level (<1.5V) until the vdds18v rail is disabled, as shown in the waveform below.

A subset of the SOC's LVC MOS IOs (refer to DM for details) have a pull-up resistor that is active by default, including during reset and power-down. The SOC's IOs that have internal or external pull-ups will stay at Plateau Level (<1.5V) during the power-down. If other ICs on the board that are interfaced to the SOC's LVC MOS signals use a separate supply then it's possible that the other IC's signals can be pulled to the Plateau Level while its power supply is off.

**Figure 4-1. PAB\_RevA**


The root cause of the plateau is related to the LVC MOS IO buffer Dual Voltage detection circuitry. The LVC MOS Dual Voltage IO includes voltage comparator circuitry to determine if the IO is in 3.3V mode or 1.8V mode. During powerdown of vddshvn domains, a current path in the internal bias transistors results in the vddshvn rail being held to an intermediate voltage level (<1.5 V). This path can consume at most 500 uA per IO - worst case estimate is ~150 mA (based on 280 IOs) from the vdds18v supply

during power down. This path is not a reliability concern for the device.

The plateau is no concern for systems where the same supply/LDO is used for vddshvn rail and the other components that interface to the SOC's Dual Voltage LVCMOS IOs.

Systems that use independent supplies for the SOC rail and the other component's rail require further analysis by the system designer. There may be a state where SOC's IO's with internal or external pull-ups are pulled to plateau level (<1.5V) while the external device is powered down. In this case, the current on any given IO is limited due to the ~10 kOhm (minimum) internal pull-up resistor. The limit is 150  $\mu$ A per IO (1.5 V maximum plateau / 10 kOhm minimum pull-up resistor.) Refer to the device Data Manual for details on which pins include a pull-up resistor by default.

#### **GUIDELINES**

In general, TI recommends using the same supply source for connected components. E.g., a single LDO should drive vddshvn and the related 3.3V external components.

For systems that use a different 3.3V supply for the SOC and connected ICs, customers should evaluate their system for reliability risk. If necessary, the PMIC OTP power-down sequence can be modified to delay the vddshv[11:1] powerdown to coincide with the vdds18v powerdown. [Note: The 3.3V rail must never be 2.0V above the 1.8V rail.]

VDDSHV8 is a special case. If VDDSHV8 is powered by the same LDO/switch as the other VDDSHVn rails then the VDDSHV8 rail can also be delayed. However, if the VDDSHV8 rail is supplied by a different LDO (e.g., LDO1 on EVM) than the other VDDSHVn rails, then the sequence should not be modified.

**REVISIONS IMPACTED** AM571x SR 2.0, 1.0  
AM570x SR 2.0

| i885                      | <b>Software Requirements for Data Manual IO Timing</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 |
|---------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>CRITICALITY</b>        | High                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   |
| <b>DESCRIPTION</b>        | In order to guarantee the values presented in the Timing Requirements and Switching Characteristics tables of the device Data Manual, proper software configuration of the IOs is required.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |
| <b>GUIDELINES</b>         | <p>The required software IO configurations include:</p> <ul style="list-style-type: none"> <li>• Pin Multiplexing (CTRL_CORE_PAD_*[3:0] MUXMODE) selection compliant with the IOSETS defined in the datasheet. (See IOSET tables DM Chapter Timing Requirements and Switching Characteristics.)</li> <li>• Slew Control (CTRL_CORE_PAD_*[19] SLEWCONTROL) settings left at their default values. (See DM Section 1.8V and 3.3V Signal Transition Rates.)</li> <li>• Virtual and Manual IO Timing Modes configured as required for the desired mode of operation.(See TRM Sections Virtual IO Timing Modes and Manual IO Timing Modes.)</li> <li>• IO Delay Recalibration performed after adjusting the AVS voltage for VDD_CORE_L voltage domain. (See TRM Section IO Delay Recalibration.)</li> </ul> |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    |

|                           |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |
|---------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i886</b>               | <b><i>FPDLink PLL Unlocks with Certain SoC PLL M/N Values</i></b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     |
| <b>CRITICALITY</b>        | Medium                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                |
| <b>DESCRIPTION</b>        | <p>In many end systems, the SoC's VOUT or DISPC_* parallel video output interface is used to connect to a TI FPDLink LVDS Serializer component (on the system board) such as the DS90UH925, which connects via FPDLink cable to a remote deserializer such as the DS90UH926 device which is typically used to drive a display.</p> <p>In this scenario, the SoC's internal PLL is used to create the Video output clock that is used by the FPDLink Serializer internal PLL to create the higher frequency LVDS link clock. Depending on the jitter characteristics of the SoC's output clock, a high amount of jitter can be introduced into the serializer output. This can cause the remote LVDS deserializer's PLL to become unlocked, resulting in a blank image.</p> <p>A given target frequency for the SoC Video output clock can be achieved with different values of Multiplier M and Divider N (M/N). In general, lower values of M/N result in jitter characteristics that can cause the unlocked condition to occur.</p> |
| <b>GUIDELINES</b>         | <p>The SoC PLL M/N values should be set with the highest valid values of M/N to achieve the desired frequency setting. This results in optimal jitter characteristics relative to the FPDLink device requirements.</p> <p>For example, using a SoC PLL input clock of 20 MHz, a Video clock target frequency of 74.25 MHz can be achieved using either Option A (N=7, M=297, M4=19) or Option B (N=119, M=1782, M4=7). Option B is recommended.</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   |

|                           |                                                                                                                                                                                                          |
|---------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i912</b>               | <b><i>QSPI_SPI_CMD_REG [25:24] Masked from Read in RTL</i></b>                                                                                                                                           |
| <b>CRITICALITY</b>        | Low                                                                                                                                                                                                      |
| <b>DESCRIPTION</b>        | There is an integration error in the device. All WLEN (QSPI_SPI_CMD_REG[25:19]) bits in the QSPI_SPI_CMD_REG register are writeable. However, on a read the QSPI_SPI_CMD_REG[25:24] bits will be masked. |
| <b>GUIDELINES</b>         | None.                                                                                                                                                                                                    |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                      |

**i918**
***Dual-rank DDR with Twin Die Configuration is Not Supported***
**CRITICALITY**

Low

**DESCRIPTION**


---

**NOTE:** Signals ddr1\_odt1 and ddr1\_csn1 are not pinned out in AM570x family of devices.

---

DDR configuration for dual-rank support with twin die configuration is not supported. Therefore, ddr1\_odt1 (ball AC17) and ddr1\_csn1 (ball AB16) will not be useable for any supported configuration.

**GUIDELINES**

Do not use a dual-rank topology. Refer to the Data Manual for all supported device configurations.

**REVISIONS IMPACTED**

AM571x SR 2.0, 1.0  
AM570x SR 2.0

## i920 DSS VOUT1, VOUT2, and VOUT3 Supported Only at 1.8V

**CRITICALITY** High

### DESCRIPTION

**NOTE:** VOUT1 is not supported on AM570x family of devices.

VOUT1, VOUT2 and VOUT3 are only supported at 1.8V and not at 3.3V. When the VOUT1, VOUT2, and VOUT3 interfaces are used in 3.3V mode of operation there can be excessive overshoot/undershoot on the IOs when the interface data bus switches concurrently. This can impact the long term reliability of these IOs.

### GUIDELINES

Do not use 3.3V on VOUT1, VOUT2, and VOUT3. VOUT2 occurs in multiple voltage domains. Do not use VOUT2 on any voltage domains at 3.3V. Only use 1.8V on VOUT1, VOUT2, and VOUT3. Note this must be considered in the pin mux programming and VDDSHVx supply connections.

**REVISIONS IMPACTED** AM571x SR 2.0, 1.0  
N/A for AM570x SR 2.0 pending validation

|                           |                                                                                                                                                                                                                                                                                  |
|---------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i921</b>               | <b><i>Limited GPMC Use Case Supported at 3.3V</i></b>                                                                                                                                                                                                                            |
| <b>CRITICALITY</b>        | High                                                                                                                                                                                                                                                                             |
| <b>DESCRIPTION</b>        | Only limited GPMC use cases are supported at 3.3V. When some GPMC use cases are used in 3.3V mode of operation there can be excessive overshoot/undershoot on the IOs when the interface data bus switches concurrently. This can impact the long term reliability of these IOs. |
| <b>GUIDELINES</b>         | Single load GPMC frequency must stay below 66 MHz (reduced from maximum of 88 MHz) at 3.3V. Multi-load GPMC maximum capacitive load must be less than or equal to 10 pF at 3.3V for all frequencies up to 66MHz. To avoid limitations at 3.3V, GPMC can be used at 1.8V.         |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x resolved on SR 2.0, pending validation                                                                                                                                                                                                              |

|                           |                                                                                                                                                                                                                                                                                                                                                                 |
|---------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>i926</b>               | <b><i>PCIe Preferred PCIe_PHY_RX SCP Register Settings Updated</i></b>                                                                                                                                                                                                                                                                                          |
| <b>CRITICALITY</b>        | Low                                                                                                                                                                                                                                                                                                                                                             |
| <b>DESCRIPTION</b>        | The “Preferred PCIe_PHY_RX SCP Register Settings” table in the in version C and later of the device-specific Technical Reference Manual (TRM) has been updated with values to select fully adaptive equalization and a second-order clock recovery algorithm. These changes have been shown to enhance PCIe receiver (RX) jitter tolerance for 5GT/s operation. |
| <b>GUIDELINES</b>         | Software can be updated to the new preferred settings, especially for 5GT/s operation, if enhanced RX jitter tolerance is desired.                                                                                                                                                                                                                              |
| <b>REVISIONS IMPACTED</b> | AM571x SR 2.0, 1.0<br>AM570x SR 2.0                                                                                                                                                                                                                                                                                                                             |

## IMPORTANT NOTICE FOR TI DESIGN INFORMATION AND RESOURCES

Texas Instruments Incorporated ("TI") technical, application or other design advice, services or information, including, but not limited to, reference designs and materials relating to evaluation modules, (collectively, "TI Resources") are intended to assist designers who are developing applications that incorporate TI products; by downloading, accessing or using any particular TI Resource in any way, you (individually or, if you are acting on behalf of a company, your company) agree to use it solely for this purpose and subject to the terms of this Notice.

TI's provision of TI Resources does not expand or otherwise alter TI's applicable published warranties or warranty disclaimers for TI products, and no additional obligations or liabilities arise from TI providing such TI Resources. TI reserves the right to make corrections, enhancements, improvements and other changes to its TI Resources.

You understand and agree that you remain responsible for using your independent analysis, evaluation and judgment in designing your applications and that you have full and exclusive responsibility to assure the safety of your applications and compliance of your applications (and of all TI products used in or for your applications) with all applicable regulations, laws and other applicable requirements. You represent that, with respect to your applications, you have all the necessary expertise to create and implement safeguards that (1) anticipate dangerous consequences of failures, (2) monitor failures and their consequences, and (3) lessen the likelihood of failures that might cause harm and take appropriate actions. You agree that prior to using or distributing any applications that include TI products, you will thoroughly test such applications and the functionality of such TI products as used in such applications. TI has not conducted any testing other than that specifically described in the published documentation for a particular TI Resource.

You are authorized to use, copy and modify any individual TI Resource only in connection with the development of applications that include the TI product(s) identified in such TI Resource. NO OTHER LICENSE, EXPRESS OR IMPLIED, BY ESTOPPEL OR OTHERWISE TO ANY OTHER TI INTELLECTUAL PROPERTY RIGHT, AND NO LICENSE TO ANY TECHNOLOGY OR INTELLECTUAL PROPERTY RIGHT OF TI OR ANY THIRD PARTY IS GRANTED HEREIN, including but not limited to any patent right, copyright, mask work right, or other intellectual property right relating to any combination, machine, or process in which TI products or services are used. Information regarding or referencing third-party products or services does not constitute a license to use such products or services, or a warranty or endorsement thereof. Use of TI Resources may require a license from a third party under the patents or other intellectual property of the third party, or a license from TI under the patents or other intellectual property of TI.

TI RESOURCES ARE PROVIDED "AS IS" AND WITH ALL FAULTS. TI DISCLAIMS ALL OTHER WARRANTIES OR REPRESENTATIONS, EXPRESS OR IMPLIED, REGARDING TI RESOURCES OR USE THEREOF, INCLUDING BUT NOT LIMITED TO ACCURACY OR COMPLETENESS, TITLE, ANY EPIDEMIC FAILURE WARRANTY AND ANY IMPLIED WARRANTIES OF MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, AND NON-INFRINGEMENT OF ANY THIRD PARTY INTELLECTUAL PROPERTY RIGHTS.

TI SHALL NOT BE LIABLE FOR AND SHALL NOT DEFEND OR INDEMNIFY YOU AGAINST ANY CLAIM, INCLUDING BUT NOT LIMITED TO ANY INFRINGEMENT CLAIM THAT RELATES TO OR IS BASED ON ANY COMBINATION OF PRODUCTS EVEN IF DESCRIBED IN TI RESOURCES OR OTHERWISE. IN NO EVENT SHALL TI BE LIABLE FOR ANY ACTUAL, DIRECT, SPECIAL, COLLATERAL, INDIRECT, PUNITIVE, INCIDENTAL, CONSEQUENTIAL OR EXEMPLARY DAMAGES IN CONNECTION WITH OR ARISING OUT OF TI RESOURCES OR USE THEREOF, AND REGARDLESS OF WHETHER TI HAS BEEN ADVISED OF THE POSSIBILITY OF SUCH DAMAGES.

You agree to fully indemnify TI and its representatives against any damages, costs, losses, and/or liabilities arising out of your non-compliance with the terms and provisions of this Notice.

This Notice applies to TI Resources. Additional terms apply to the use and purchase of certain types of materials, TI products and services. These include; without limitation, TI's standard terms for semiconductor products (<http://www.ti.com/sc/docs/stdterms.htm>), [evaluation modules](#), and [samples](http://www.ti.com/sc/docs/sampterm.htm) (<http://www.ti.com/sc/docs/sampterm.htm>).

Mailing Address: Texas Instruments, Post Office Box 655303, Dallas, Texas 75265  
Copyright © 2017, Texas Instruments Incorporated