



# USB251xB/xBi

## USB251xB/xBi Family Silicon Errata

The USB251xB/xBi family devices that you have received conform functionally to the current Device Data Sheet (DS00001692A), except for the anomalies described in this document.

The silicon issues discussed in the following pages are for silicon revisions with the Device and Revision IDs listed in [Table 1](#). The silicon issues are summarized in [Table 2](#).

**Note:** This document summarizes all silicon errata issues of the current silicon revision (**A2**).

The Engineering Device ID values for USB251xB/xBi silicon revision A2 is shown in [Table 1](#).

**TABLE 1: SILICON DEVREV VALUES**

Part Number	Engineer Device ID of A2
USB2512B-AEZC	A2P10
USB2512Bi-AEZC	A2P10
USB2512B/M2	A2P10
USB2512BT/M2	A2P10
USB2512B-I/M2	A2P10
USB2512BT-I/M2	A2P10
USB2513B-AEZC	A2P10
USB2513Bi-AEZC	A2P10
USB2513B/M2	A2P10
USB2513BT/M2	A2P10
USB2513B-I/M2	A2P10
USB2513BT-I/M2	A2P10
USB2514B-AEZG	A2P10
USB2514Bi-AEZG	A2P10
USB2514B/M2	A2P10
USB2514BT/M2	A2P10
USB2514B-I/M2	A2P10
USB2514BT-I/M2	A2P10

**TABLE 2: SILICON ISSUE SUMMARY**

Item Number	Silicon Issue Summary	Affected Silicon Revisions
1	<a href="#">bcdDevice field (DID) has invalid characters</a>	A2
2	<a href="#">Selective Suspend command is ignored by the hub</a>	A2
3	<a href="#">Glitch on DP (and SD/SCL) during power-up</a>	A2
4	<a href="#">Detach detection failure</a>	A2

# USB251xB/xBi

---

## Silicon Errata Issues

### Module 1: bcdDevice field (DID) has invalid characters

#### DESCRIPTION

According to the USB2.0 specification, the bcdDevice field is specified to be binary-coded-decimal, which means only decimal characters are allowed. The hexadecimal digits A-F are not allowed.

#### END USER IMPLICATIONS

The presence of non-BCD characters will cause failures in some Command Verifier (CV) and Windows Hardware Certification tests, such as:

- USB (USBDEX) Verifier Test
- USB Device Connection S3 + S4
- USB Driver Level Re-Enumeration Test
- USB Enumeration Stress
- USB Serial Number

No end user functional impact.

#### Work around

This bcdDevice field can be changed through the configuration options by programming EEPROM via SMBus or I<sup>2</sup>C interface. Also, a Microsoft Contingency number 323 can be used to waive five mentioned tests above in the Windows Hardware Certification test suite.

#### PLAN

This erratum will not be corrected in a future revision.

### Module 2: Selective Suspend command is ignored by the hub

#### DESCRIPTION

If a SET\_FEATURE (PORT\_SUSPEND) command is sent right after the SOF command (microframe 0), the hub will not disable the port.

#### END USER IMPLICATIONS

The port will not suspend when a command is sent by the host. This will cause more current draw than if the port was suspended (~10mA).

#### Work around

It is recommended to use the Global Suspend function to put the entire hub into suspend to conserve power.

#### PLAN

This erratum will not be corrected in a future revision.

## Module 3: Glitch on DP (and SD/SCL) during power-up

### DESCRIPTION

When the Hub is powering up, the DP pin is asserted before other internal logic has started. When the internal logic does start, it can cause a low pulse on the SMBus and DP pins.


### END USER IMPLICATIONS

The USB protocol can handle a glitch on DP, so no user impact on the USB lines. The SMBus glitch can impact the state machine of the SMBus Controller.

#### **Work around**

Keep the RESET\_N pin low during POR to remove this glitch. Control RESET\_N through a digital controller or an RC circuit by connecting a 100K $\Omega$  pull-up resistor to 3.3V and a 220nF capacitor to ground. See RC circuit diagram below.

**FIGURE 1: RC CIRCUIT DIAGRAM**

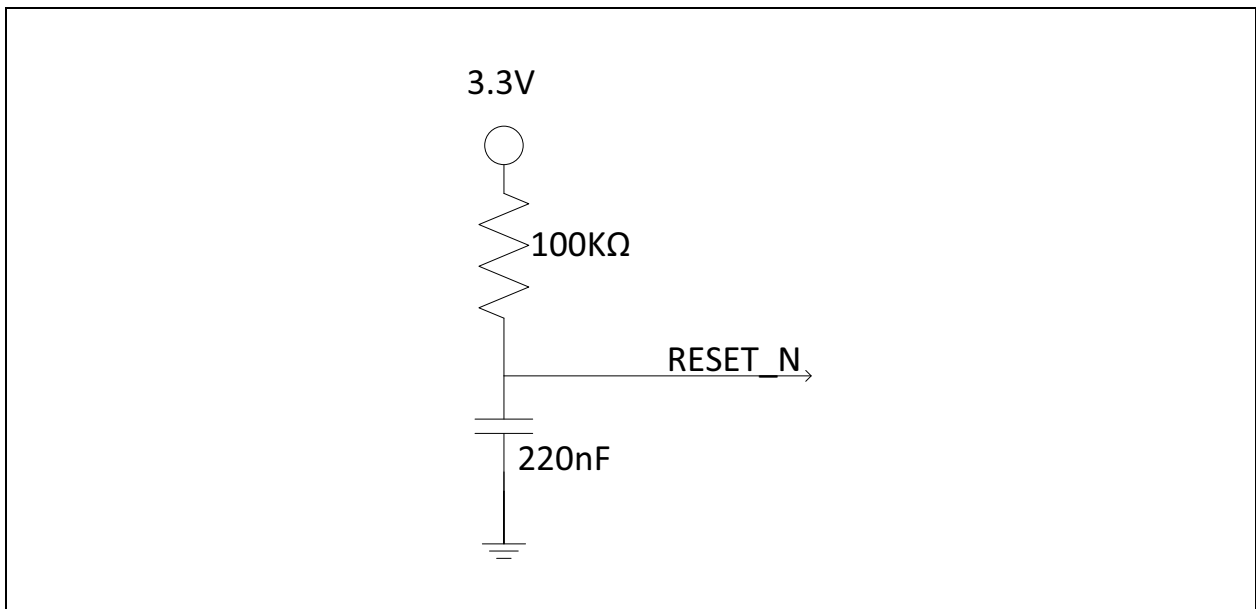

### PLAN

This erratum will not be corrected in a future revision.

# USB251xB/xBi

---

## Module 4: Detach detection failure

### DESCRIPTION

When a Full-Speed/Low-Speed device detaches and quickly re-attaches, such as when issued a reset command over USB or other sideband control signal, there is a chance that the USB hub will not recognize the device detach and communicate the device detach event to the USB host. This may result in a failure to establish a connection with the device after the device is re-attached.

The hub requires 100us of uninterrupted SE0 line state (both D+ and D- lines below  $V_{IL}(\min)$ ) before a device detach is detected.

### END USER IMPLICATIONS

This issue does not typically apply to a physical detach, as a physical device detach and re-attach typically involves much longer time scales.

This issue may be encountered when a device performs a self detach and re-attach as a result of some special command over USB or a reset due to some stimulus within the device's system (such as a button reset).

#### **Work around**

There are two possible work arounds:

1. Ensure that the hub port detects an SE0 line state for  $> 100\mu\text{s}$  before re-attaching the device.
  - a) The device must remove its D+ or D- pull-up resistor to ensure SE0 line state is achieved.
  - b) There must be at least one  $100\mu\text{s}$  gap in between packets while the device is in the detached state.
2. If the device is being commanded to detach and re-attach from USB host command (such as when instructing a device to re-enumerate in a different mode of operation), issue a Port Reset command to the hub for the respective port immediately after the detach command is issued to ensure that the device can be properly detected when it re-attaches.

### PLAN

This erratum will not be corrected in a future revision.

## APPENDIX A: DOCUMENT REVISION HISTORY

TABLE A-1: REVISION HISTORY

Revision Level & Date	Section/Figure/Entry	Correction
DS80000627D (03-19-19)	Module 4	Added new errata module " <a href="#">Detach detection failure</a> ".
	All	Updated layout to standard Microchip format.
DS80000627C (09-15-15)	<a href="#">Table 1</a>	Added additional device part numbers to table for SQFN package. No new errata added.
DS80000627B (11-07-14)		Initial release.

# USB251xB/xBi

---

## THE MICROCHIP WEB SITE

Microchip provides online support via our WWW site at [www.microchip.com](http://www.microchip.com). This web site is used as a means to make files and information easily available to customers. Accessible by using your favorite Internet browser, the web site contains the following information:

- **Product Support** – Data sheets and errata, application notes and sample programs, design resources, user's guides and hardware support documents, latest software releases and archived software
- **General Technical Support** – Frequently Asked Questions (FAQ), technical support requests, online discussion groups, Microchip consultant program member listing
- **Business of Microchip** – Product selector and ordering guides, latest Microchip press releases, listing of seminars and events, listings of Microchip sales offices, distributors and factory representatives

## CUSTOMER CHANGE NOTIFICATION SERVICE

Microchip's customer notification service helps keep customers current on Microchip products. Subscribers will receive e-mail notification whenever there are changes, updates, revisions or errata related to a specified product family or development tool of interest.

To register, access the Microchip web site at [www.microchip.com](http://www.microchip.com). Under "Support", click on "Customer Change Notification" and follow the registration instructions.

## CUSTOMER SUPPORT

Users of Microchip products can receive assistance through several channels:

- Distributor or Representative
- Local Sales Office
- Field Application Engineer (FAE)
- Technical Support

Customers should contact their distributor, representative or field application engineer (FAE) for support. Local sales offices are also available to help customers. A listing of sales offices and locations is included in the back of this document.

**Technical support is available through the web site at: <http://microchip.com/support>**

**Note the following details of the code protection feature on Microchip devices:**

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as “unbreakable.”

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

---

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

## Trademarks

The Microchip name and logo, the Microchip logo, AnyRate, AVR, AVR logo, AVR Freaks, BitCloud, chipKIT, chipKIT logo, CryptoMemory, CryptoRF, dsPIC, FlashFlex, flexPWR, Heldo, JukeBlox, KeeLoq, Klear, LANCheck, LINK MD, maXStylus, maXTouch, MediaLB, megaAVR, MOST, MOST logo, MPLAB, OptoLyzer, PIC, picoPower, PICSTART, PIC32 logo, Prochip Designer, QTouch, SAM-BA, SpyNIC, SST, SST Logo, SuperFlash, tinyAVR, UNI/O, and XMEGA are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

ClockWorks, The Embedded Control Solutions Company, EtherSynch, Hyper Speed Control, HyperLight Load, IntellIMOS, mTouch, Precision Edge, and Quiet-Wire are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Adjacent Key Suppression, AKS, Analog-for-the-Digital Age, Any Capacitor, AnyIn, AnyOut, BodyCom, CodeGuard, CryptoAuthentication, CryptoAutomotive, CryptoCompanion, CryptoController, dsPICDEM, dsPICDEM.net, Dynamic Average Matching, DAM, ECAN, EtherGREEN, In-Circuit Serial Programming, ICSP, INICnet, Inter-Chip Connectivity, JitterBlocker, KlearNet, KlearNet logo, memBrain, Mindi, MiWi, motorBench, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach, Omniscient Code Generation, PICDEM, PICDEM.net, PICKit, PICtail, PowerSmart, PureSilicon, QMatrix, REAL ICE, Ripple Blocker, SAM-ICE, Serial Quad I/O, SMART-I.S., SQI, SuperSwitcher, SuperSwitcher II, Total Endurance, TSHARC, USBCheck, VariSense, ViewSpan, WiperLock, Wireless DNA, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

Silicon Storage Technology is a registered trademark of Microchip Technology Inc. in other countries.

GestIC is a registered trademark of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2014-2019, Microchip Technology Incorporated, All Rights Reserved.

ISBN: 9781522442875

**QUALITY MANAGEMENT SYSTEM**  
**CERTIFIED BY DNV**  
**== ISO/TS 16949 ==**

*Microchip received ISO/TS-16949:2009 certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona; Gresham, Oregon and design centers in California and India. The Company's quality system processes and procedures are for its PIC® MCUs and dsPIC® DSCs, KEELOQ® code hopping devices, Serial EEPROMs, microperipherals, nonvolatile memory and analog products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001:2000 certified.*



# MICROCHIP

## Worldwide Sales and Service

### AMERICAS

**Corporate Office**  
2355 West Chandler Blvd.  
Chandler, AZ 85224-6199  
Tel: 480-792-7200  
Fax: 480-792-7277  
Technical Support:  
<http://www.microchip.com/support>  
Web Address:  
[www.microchip.com](http://www.microchip.com)

#### Atlanta

Duluth, GA  
Tel: 678-957-9614  
Fax: 678-957-1455

#### Austin, TX

Tel: 512-257-3370

#### Boston

Westborough, MA  
Tel: 774-760-0087  
Fax: 774-760-0088

#### Chicago

Itasca, IL  
Tel: 630-285-0071  
Fax: 630-285-0075

#### Dallas

Addison, TX  
Tel: 972-818-7423  
Fax: 972-818-2924

#### Detroit

Novi, MI  
Tel: 248-848-4000

#### Houston, TX

Tel: 281-894-5983

#### Indianapolis

Noblesville, IN  
Tel: 317-773-8323  
Fax: 317-773-5453  
Tel: 317-536-2380

#### Los Angeles

Mission Viejo, CA  
Tel: 949-462-9523  
Fax: 949-462-9608  
Tel: 951-273-7800

#### Raleigh, NC

Tel: 919-844-7510

#### New York, NY

Tel: 631-435-6000

#### San Jose, CA

Tel: 408-735-9110  
Tel: 408-436-4270

#### Canada - Toronto

Tel: 905-695-1980  
Fax: 905-695-2078

### ASIA/PACIFIC

**Australia - Sydney**  
Tel: 61-2-9868-6733

**China - Beijing**  
Tel: 86-10-8569-7000

**China - Chengdu**  
Tel: 86-28-8665-5511

**China - Chongqing**  
Tel: 86-23-8980-9588

**China - Dongguan**  
Tel: 86-769-8702-9880

**China - Guangzhou**  
Tel: 86-20-8755-8029

**China - Hangzhou**  
Tel: 86-571-8792-8115

**China - Hong Kong SAR**  
Tel: 852-2943-5100

**China - Nanjing**  
Tel: 86-25-8473-2460

**China - Qingdao**  
Tel: 86-532-8502-7355

**China - Shanghai**  
Tel: 86-21-3326-8000

**China - Shenyang**  
Tel: 86-24-2334-2829

**China - Shenzhen**  
Tel: 86-755-8864-2200

**China - Suzhou**  
Tel: 86-186-6233-1526

**China - Wuhan**  
Tel: 86-27-5980-5300

**China - Xian**  
Tel: 86-29-8833-7252

**China - Xiamen**  
Tel: 86-592-2388138

**China - Zhuhai**  
Tel: 86-756-3210040

### ASIA/PACIFIC

**India - Bangalore**  
Tel: 91-80-3090-4444

**India - New Delhi**  
Tel: 91-11-4160-8631

**India - Pune**  
Tel: 91-20-4121-0141

**Japan - Osaka**  
Tel: 81-6-6152-7160

**Japan - Tokyo**  
Tel: 81-3-6880-3770

**Korea - Daegu**  
Tel: 82-53-744-4301

**Korea - Seoul**  
Tel: 82-2-554-7200

**Malaysia - Kuala Lumpur**  
Tel: 60-3-7651-7906

**Malaysia - Penang**  
Tel: 60-4-227-8870

**Philippines - Manila**  
Tel: 63-2-634-9065

**Singapore**  
Tel: 65-6334-8870

**Taiwan - Hsin Chu**  
Tel: 886-3-577-8366

**Taiwan - Kaohsiung**  
Tel: 886-7-213-7830

**Taiwan - Taipei**  
Tel: 886-2-2508-8600

**Thailand - Bangkok**  
Tel: 66-2-694-1351

**Vietnam - Ho Chi Minh**  
Tel: 84-28-5448-2100

### EUROPE

**Austria - Wels**  
Tel: 43-7242-2244-39  
Fax: 43-7242-2244-393

**Denmark - Copenhagen**  
Tel: 45-4450-2828  
Fax: 45-4485-2829

**Finland - Espoo**  
Tel: 358-9-4520-820

**France - Paris**  
Tel: 33-1-69-53-63-20  
Fax: 33-1-69-30-90-79

**Germany - Garching**  
Tel: 49-8931-9700

**Germany - Haan**  
Tel: 49-2129-3766400

**Germany - Heilbronn**  
Tel: 49-7131-67-3636

**Germany - Karlsruhe**  
Tel: 49-721-625370

**Germany - Munich**  
Tel: 49-89-627-144-0  
Fax: 49-89-627-144-44

**Germany - Rosenheim**  
Tel: 49-8031-354-560

**Israel - Ra'anana**  
Tel: 972-9-744-7705

**Italy - Milan**  
Tel: 39-0331-742611  
Fax: 39-0331-466781

**Italy - Padova**  
Tel: 39-049-7625286

**Netherlands - Drunen**  
Tel: 31-416-690399  
Fax: 31-416-690340

**Norway - Trondheim**  
Tel: 47-7288-4388

**Poland - Warsaw**  
Tel: 48-22-3325737

**Romania - Bucharest**  
Tel: 40-21-407-87-50

**Spain - Madrid**  
Tel: 34-91-708-08-90  
Fax: 34-91-708-08-91

**Sweden - Gothenberg**  
Tel: 46-31-704-60-40

**Sweden - Stockholm**  
Tel: 46-8-5090-4654

**UK - Wokingham**  
Tel: 44-118-921-5800  
Fax: 44-118-921-5820