PRODUCT DATASHEET
Lena series
last update 31/10/2016

DETAILS




Product Number	CN13193_LENA-WAS
Family	Lena
Type	RefPack
Color	metal
Diameter	111 mm
Height	39,6 mm
Style	round
Optic Material	
Holder Material	
Fastening	screw, socket
Status	production ready
ROHS Comliant	Yes
Date Updated	31/10/2016

OPTICAL PROPERTIES


LED	Viewing Angle	Light Beam	Effi-ciency	cd/lm	Connector
CXA/B 15xx	asymmetric deg	Asymmetric	88 %	1.420	-

Ledil Oy
Salorankatu 10
24240 SALO, Finland


http://www.ledil.com
email: ledil@ledil.com
FAX: +358-2-733 8001

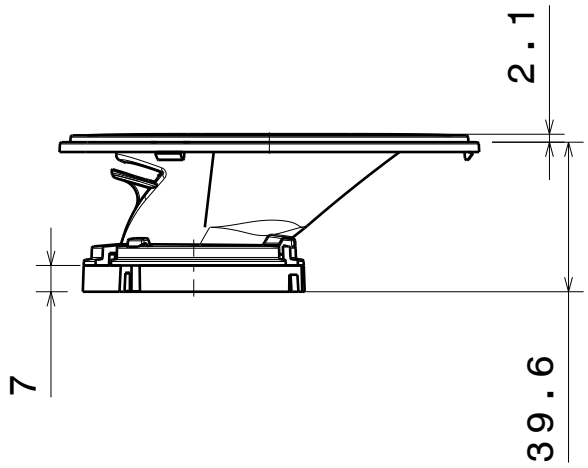


Front view

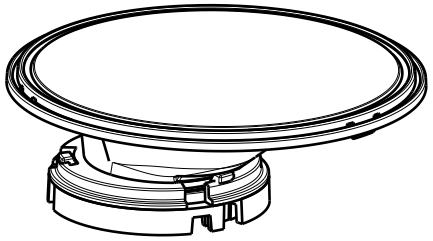

Isometric view

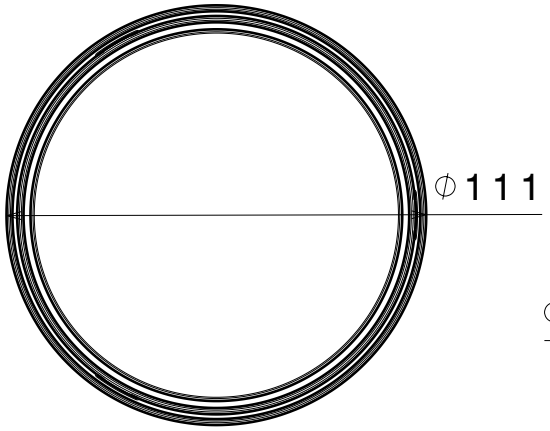

Top view

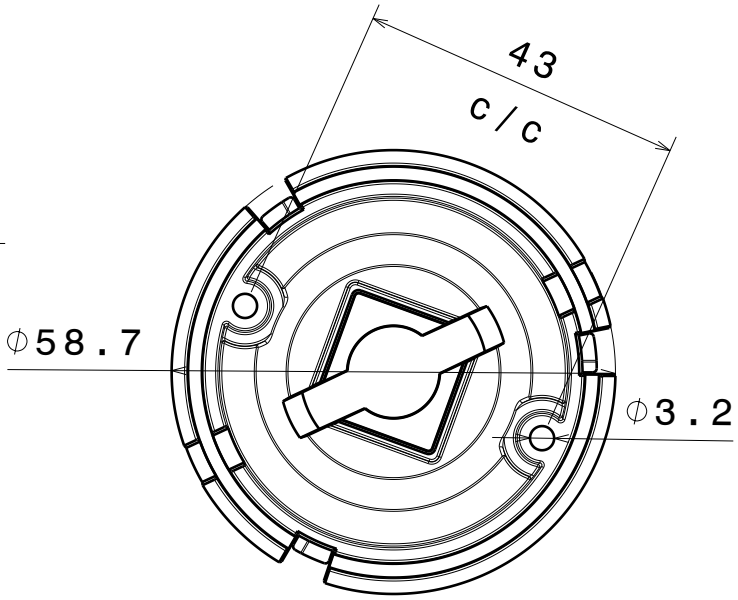

Materials

Reflector: PC
Base part: PC
Sublens: PC


Note: using additional sublens
add 2.1mm to total height

This drawing is our property.
It can't be reproduced
or communicated without
our written agreement.


Ledil Oy
Salorankatu 10
FIN 24240 SALO
Finland

DRAWN BY: as	DATE: 17.10.2012	DRAWING TITLE: Mechanical drawing			
		LENA-WAS-CXA15			
CHECKED BY: -	DATE: -	SIZE: A4	PART NUMBER: -		REV: 001
DESIGNED BY: as	DATE: -	SCALE: 1:2	WEIGHT: - g		SHEET: 1/1

Luminaire: LEDiL Oy CN13193_LENA-WAS_(CXA1520)
Lamps: 1 x CREE_CXA1520_(CXA1520-30F-N4-N0H-0001)_972.29@250mA_CCT=3000K_P=8.22841W_I=249.8mA

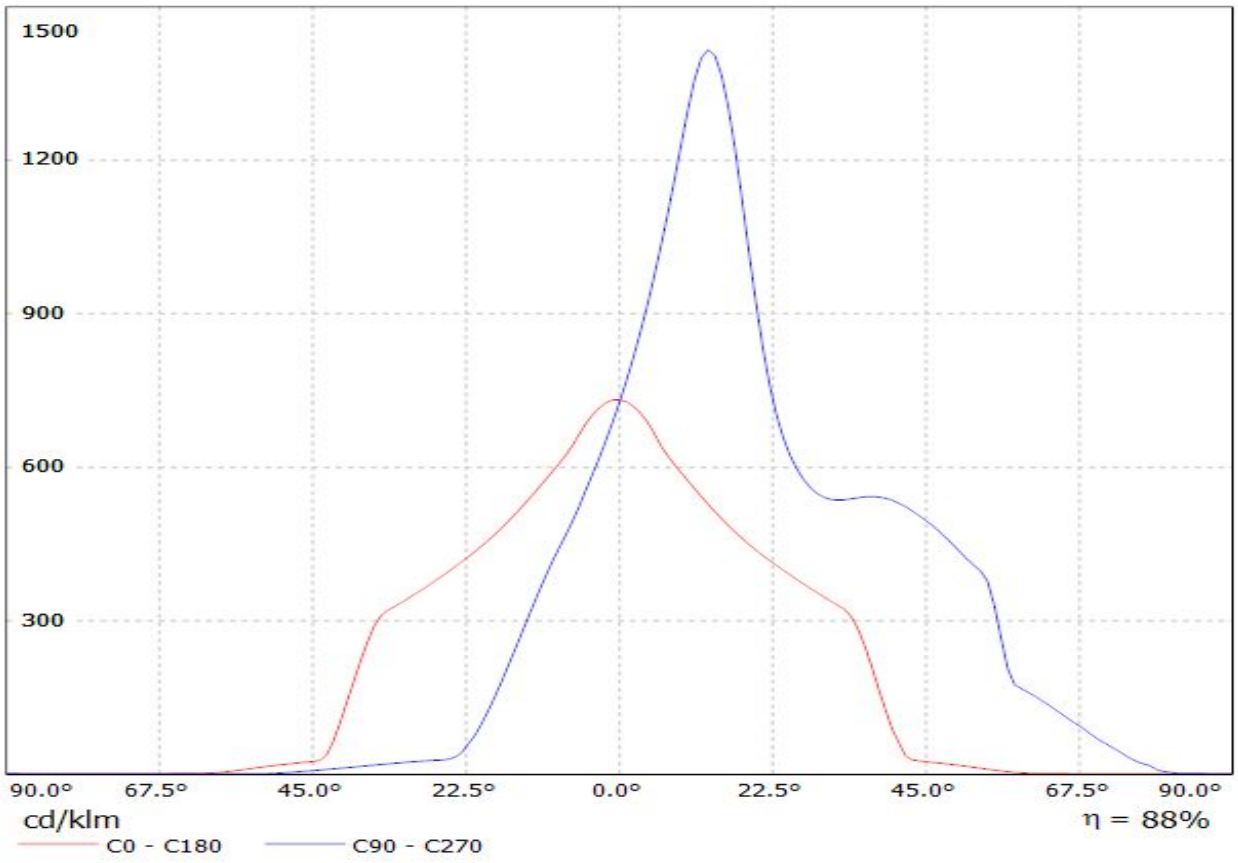

Luminaire: LEDiL Oy CN13193_LENA-WAS_(CXA1520)
Lamps: 1 x CREE_CXA1520_(CXA1520-30F-N4-N0H-0001)_972.29@250mA_CCT=3000K_P=8.22841W_I=249.8mA

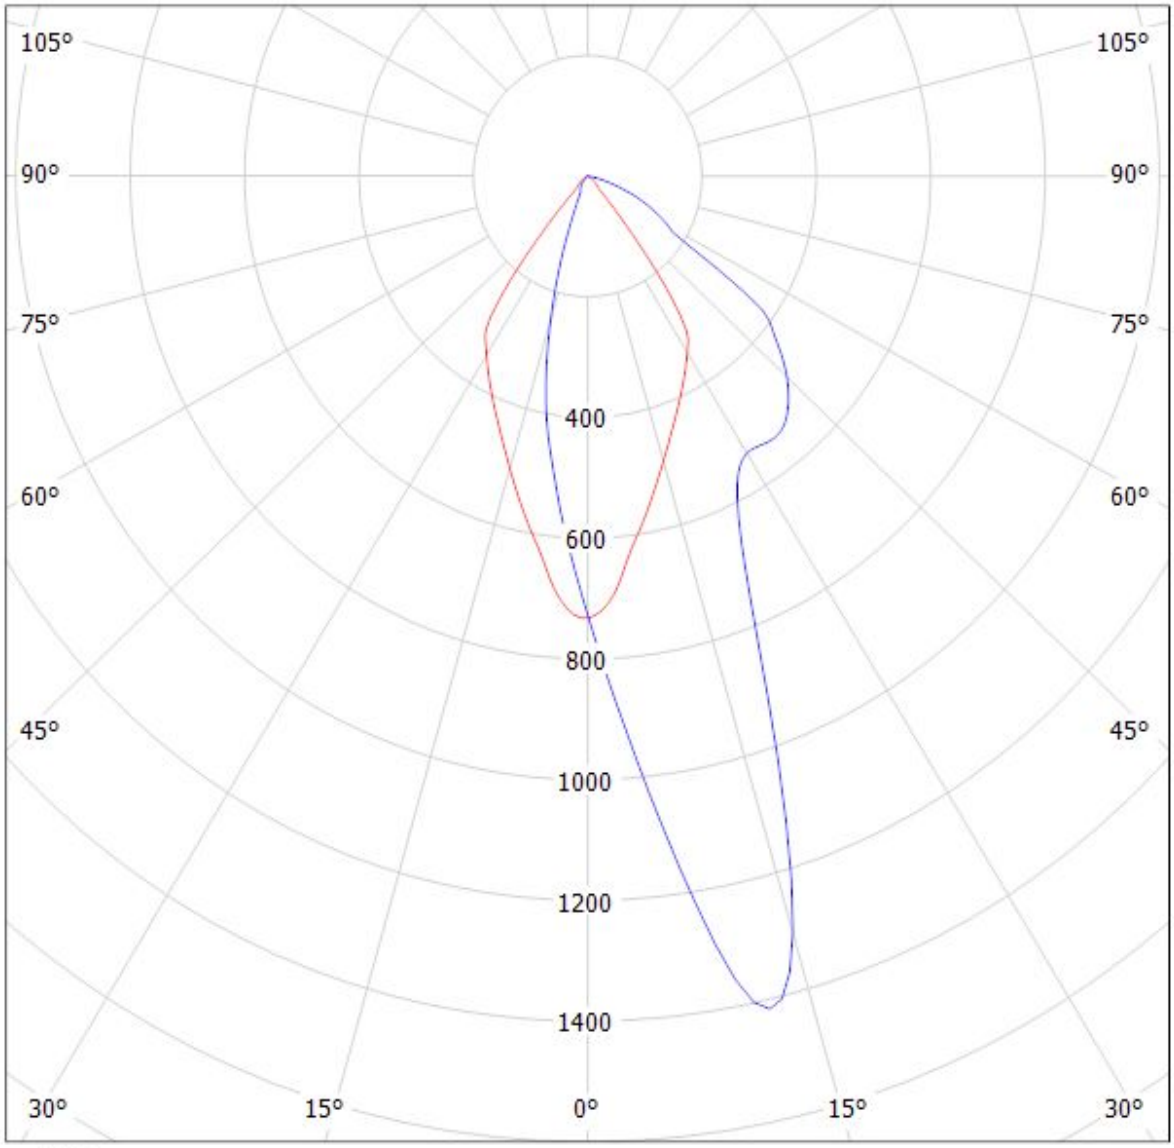

cd/klm

η = 88%

C0 - C180 C90 - C270

NOTE: The typical divergence will be changed by different color, chip size and chip position tolerance. The typical total divergence is the full angle measured where the luminous intensity is half of the peak value.

GENERAL INFORMATION

- Product series especially designed & optimized for series of LEDs.
- Special care taken to make light distribution as uniform as possible.

Note! Due to use of high power COB's with this product, special attention to proper thermal design is highly recommended. LEDiL has no liability for direct, indirect or consecutive damages arising from the LEDiL products being used outside of the recommended temperature range.