

SMT PLANAR TRANSFORMER AND PLANAR INDUCTOR

For use with Linear Technology's
LT1681 and LTC1698



NEW!



PLANAR TRANSFORMER – PA0191

- Power Rating: 60-100W
- Height: 8.3 mm Max
- Footprint: 27.7 mm x 21.8 mm Max

PLANAR INDUCTOR – P1977

- Energy Storage: 420 μ J (2.1 μ H/20A)
- Height: 8.3 mm Max
- Footprint: 21.7 mm x 20.3 mm Max

Electrical Specifications @ 25°C — Operating Temperature -40°C to 125°C

Part Number	Power Rating ¹	Turns Ratio (with 7T Pri. Aux.)	Primary Secondary Isolation	Primary Inductance (μ H MIN)	Leakage Inductance (μ H MAX)	DCR		
						Primary (m Ω MAX)	Primary Aux. (m Ω MAX)	Secondary (m Ω MAX)
PA0191	60-100 W	9:2	1500 Vdc Basic	100	1.5	85	800	2.5



Electrical Specifications @ 25°C — Operating Temperature -40°C to 125°C

Part Number	Inductance @ Irated (μ H $\pm$ 5%)	Irated ² (A _{DC})	DCR (m Ω)		Inductance @ 0 ADC (μ H $\pm$ 5%)	Saturation Current ³ (A)		Heating Current ⁴ (A)
			TYP	MAX		@ 25°C	@ 125°C	
P1977	2.1	20	1.00	1.25	2.1	27.0	22.5	31



Mechanicals

Schematics

PA0191

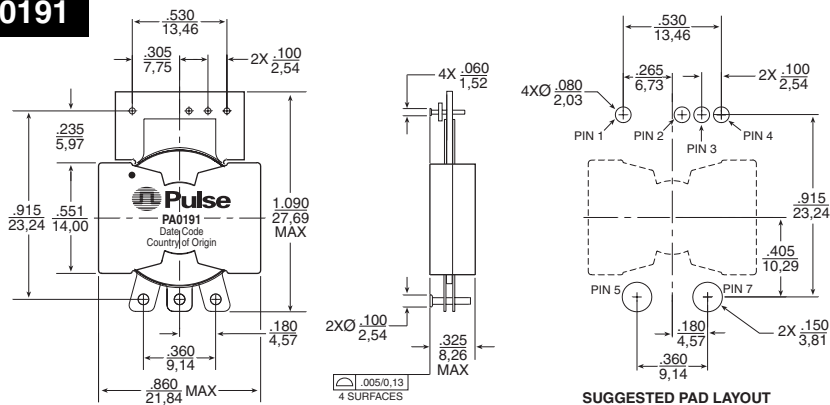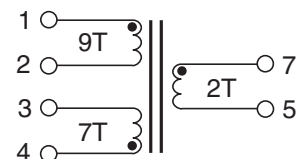

P1977

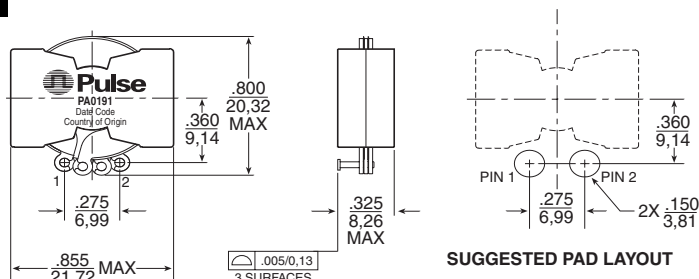

	PA0191	P1977
Weight	11.0 grams	10.8 grams
Tape & Reel	150/reel	150/reel
Tray	55/tray	48/tray
Dimensions:	<div>Inches</div> <div>mm</div>	
Unless otherwise specified, all tolerances are ± <div>.010</div> <div>0.25</div>		

SMT PLANAR TRANSFORMER AND INDUCTOR



For use with Linear Technology's LT1681 and LTC1698

Notes from Tables

For PA0191: Basic Insulated Planar Transformer

1. To determine if the transformer is suitable for your application it is necessary to ensure that the temperature rise of the component (ambient plus temp. rise) does not exceed its operating temperature. To determine the temperature rise of the component it is necessary to calculate the total power losses (copper and core) in the application.

Total Copper Losses

CopperTotal (W) = sum of the losses in each winding

The losses in each winding can be calculated by:

$$\text{CopperWindingX (W)} = .001 * \text{DCR(m}\Omega\text{)} * (\text{Irms}^2)$$

Core Losses

To calculate the core loss, use the following formula:

$$\text{CoreLoss (W)} = 2.5\text{E-}8 * (\text{Freq kHz})^{1.7} * (\Delta B/2000)^{2.5}$$

where:

$$\Delta B/2000 = 1.01 * (\text{Voltage Min} * \text{Dutycycle Max}/\text{Freq kHz})$$

Temperature Rise

$$\text{TempRise (}^\circ\text{C)} = .603 * \text{CopperTotal (W)} * (50.6 * \text{CoreLoss (W)}/\text{CopperTotal (W)} + 88.1)$$

For P1977: Planar Inductor

2. The rated current as listed is either the saturation current or the heating current depending on which value is lower.

3. The saturation current is the current which causes the inductance to drop by 10% at the stated ambient temperatures (25°C, 125°C). This current is determined by placing the component in

the specified ambient environment and applying a short duration pulse current (to eliminate self-heating effects) to the component.

4. The heating current is the dc current which causes the temperature of the part to increase by approximately 40°C. This current is determined by mounting the component on a PCB with a .25" wide (2 ounce equivalent copper traces) and applying the current to the device for 30 minutes.

5. In high volt*time applications additional heating in the component can occur due to core losses in the inductor which may necessitate derating the current in order to limit the temperature rise of the component. In order to determine the approximate total losses (or temperature rise) for a given application both copper and core losses should be taken into account.

Total Copper Losses

$$\text{CopperTotal (W)} = .001 * \text{DCR(m}\Omega\text{)} * (\text{Irms}^2)$$

where:

$$\text{Irms} = (\text{IDC}^2 + (\Delta I/2)^2)^{.5}$$

Core Losses

To calculate the core loss, use the following formula:

$$\text{CoreLoss (W)} = 2.5\text{E-}8 * (\text{Freq kHz})^{1.7} * (.0635 * \Delta I)^{2.5}$$

Temperature Rise

$$\text{TempRise (}^\circ\text{C)} = .603 * \text{CopperTotal (W)} * (50.6 * \text{CoreLoss (W)}/\text{CopperTotal (W)} + 88.1)$$

APPLICATION NOTES

The **PA0191** transformer and **P1977** inductor were designed for use with Linear Technology's LT1681 and LTC1698 IC's and are featured in Linear Technology's Design note 261 which details the solution for a low cost, discrete component alternative to telecom power modules.

The **PA0191** transformer and **P1977** inductor were designed for (but not limited to) the following application:


Topology – Two-switch forward

Frequency – 230 kHz

Pri./Sec. Isolation – Basic Insulation (1500 Vdc)

Input Voltage – 36-72 v telecom input

Output Voltage(s) – 3.3 v / 20 A output (with an auxiliary primary side control winding - 12 v/100 mA)

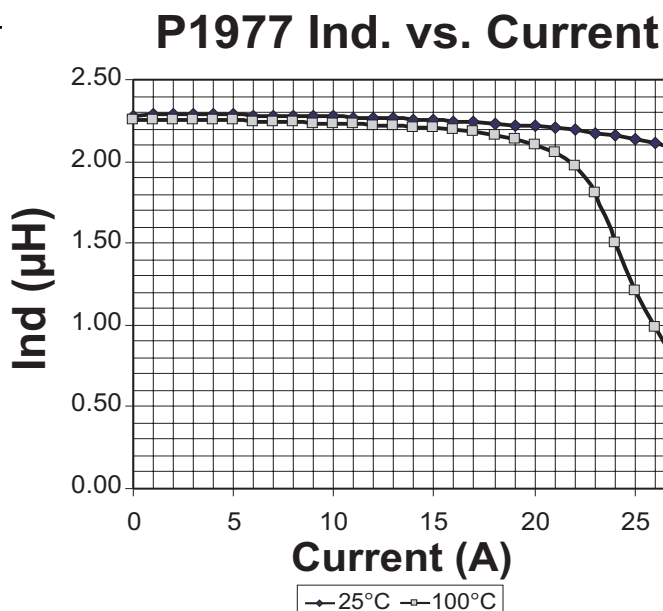

For More Information :

UNITED STATES (Worldwide)

12220 World Trade Drive
San Diego, CA 92128
U.S.A.
<http://www.pulseeng.com>
TEL: 858 674 8100
FAX: 858 674 8262

UNITED KINGDOM (Northern Europe)

1 & 2 Huxley Road
The Surrey Research Park
Guildford, Surrey GU2 5RE
United Kingdom
TEL: 44 1483 401700
FAX: 44 1483 401701

FRANCE (Southern Europe)

Zone Industrielle
F-39270
Orgelet
France
TEL: 33 3 84 35 04 04
FAX: 33 3 84 25 46 41

SINGAPORE (Southern Asia)

150 Kampong Ampat
#07-01/02
KA Centre
Singapore 368324
TEL: 65 287 8998
FAX: 65 280 0080

TAIWAN, R.O.C. (Northern Asia)

3F-4, No. 81, Sec. 1
HsinTai Wu Road
Hsi-Chih, Taipei Hsien
Taiwan, R.O.C.
Tel: 886 2 2698 0228
FAX: 886 2 2698 0948

HONG KONG (China/Hong Kong)

19/F, China United Plaza
1008 Tai Nan West Street
Cheung Sha Wan, Kowloon
Hong Kong, China
TEL: 852 2788 6588
FAX: 852 2776 1055

DISTRIBUTOR

Performance warranty of products offered on this data sheet is limited to the parameters specified. Data is subject to change without notice. Other brand and product names mentioned herein may be trademarks or registered trademarks of their respective owners.