MiniSKiiP® 3 PIM — Output Inverter Application — 1200V/50A

General conditions

3phase SPWM		
V_{GEon}	=	15 V
V_{GEoff}	=	-15 V
R_{gon}	=	16 Ω
R_{goff}	=	16 Ω

Figure 1 IGBT

Typical average static loss as a function of output current

$P_{loss} = f(I_{out})$

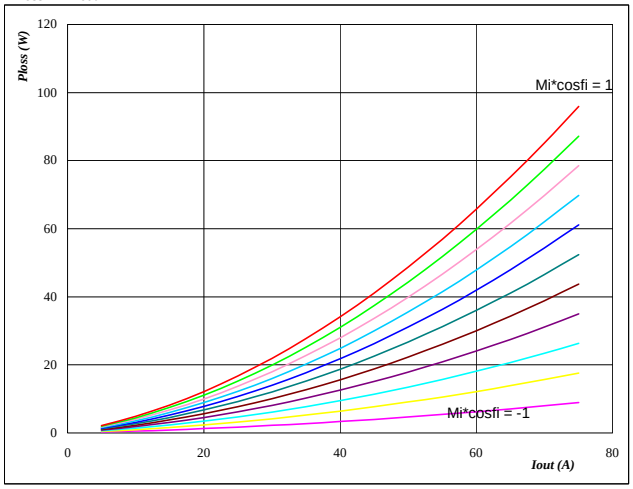

At

T_j = 150 °C

Mi*cosφ from -1 to 1 in steps of 0,2

Figure 2 FWD

Typical average static loss as a function of output current

$P_{loss} = f(I_{out})$

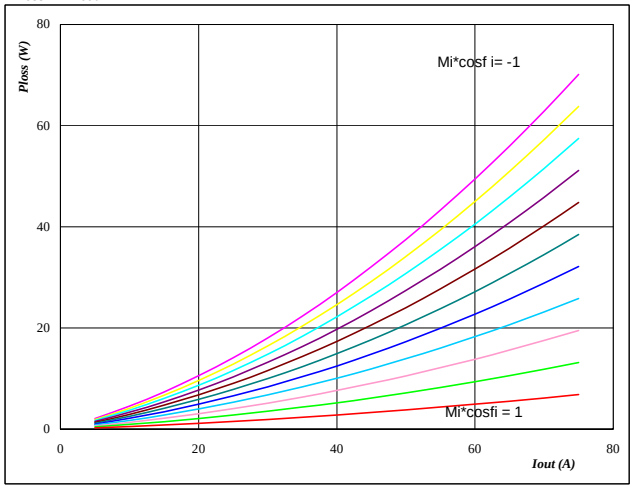

At

T_j = 150 °C

Mi*cosφ from -1 to 1 in steps of 0,2

Figure 3 IGBT

Typical average switching loss as a function of output current $P_{loss} = f(I_{out})$

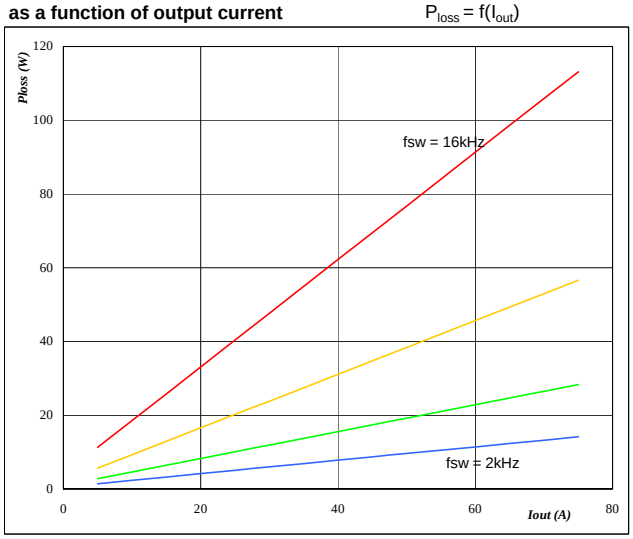

At

T_j = 150 °C

DC link = 600 V

f_{sw} from 2 kHz to 16 kHz in steps of factor 2

Figure 4 FWD

Typical average switching loss as a function of output current $P_{loss} = f(I_{out})$

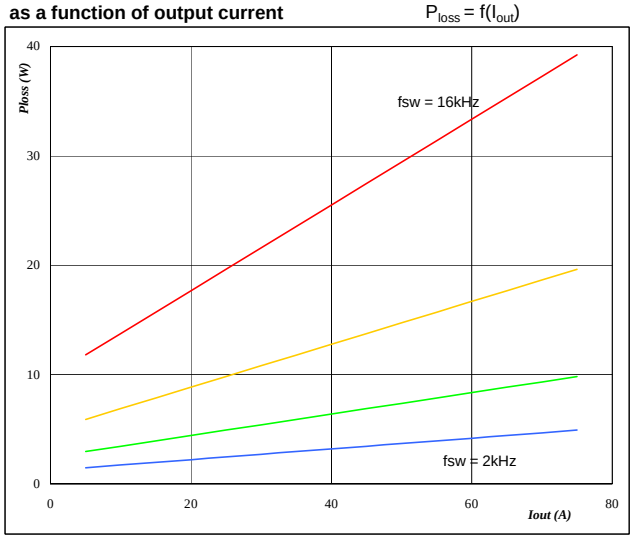

At

T_j = 150 °C

DC link = 600 V

f_{sw} from 2 kHz to 16 kHz in steps of factor 2

MiniSKiiP® 3 PIM — Output Inverter Application — 1200V/50A

Figure 5 Phase

Typical available 50Hz output current as a function Mi*cosφ $I_{out} = f(Mi*\cos\varphi)$

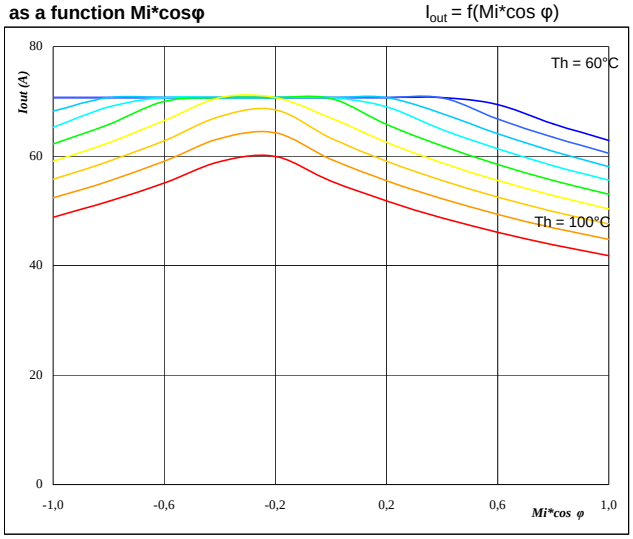

At

T_j =	150	°C
DC link =	600	V
f_{sw} =	4	kHz
T_h from	60 °C to 100 °C in steps of 5 °C	

Figure 6 Phase

Typical available 50Hz output current as a function of switching frequency $I_{out} = f(f_{sw})$

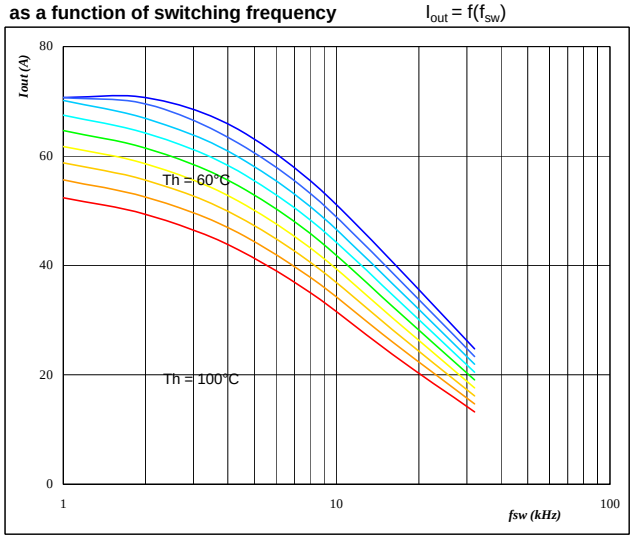

At

T_j =	150	°C
DC link =	600	V
Mi*cos φ =	0,8	
T_h from	60 °C to 100 °C in steps of 5 °C	

Figure 7 Phase

Typical available 50Hz output current as a function of Mi*cos φ and switching frequency $I_{out} = f(f_{sw}, Mi*\cos\varphi)$

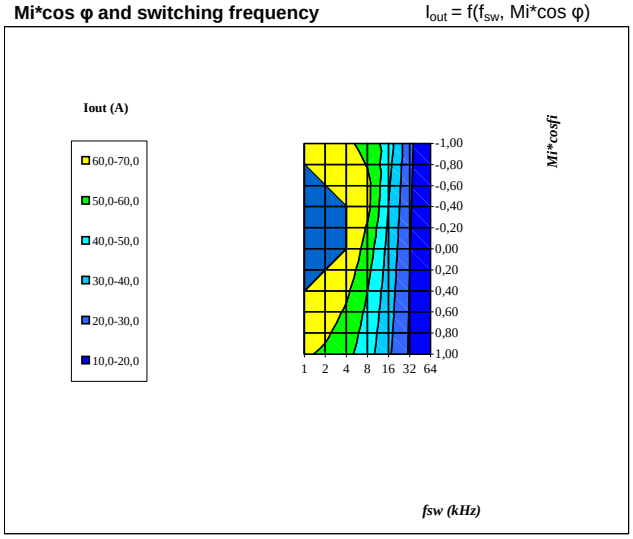

At

T_j =	150	°C
DC link =	600	V
T_h =	80	°C

Figure 8 Phase

Typical available 0Hz output current as a function of switching frequency $I_{outpeak} = f(f_{sw})$

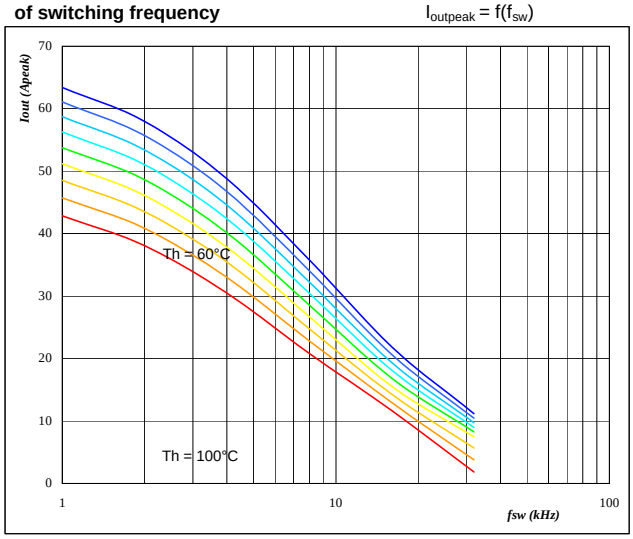

At

T_j =	150	°C
DC link =	600	V
T_h from	60 °C to 100 °C in steps of 5 °C	
Mi =	0	

MiniSKiiP® 3 PIM — Output Inverter Application — 1200V/50A

Figure 9 Inverter

Typical available peak output power as a function of heatsink temperature $P_{out}=f(T_h)$

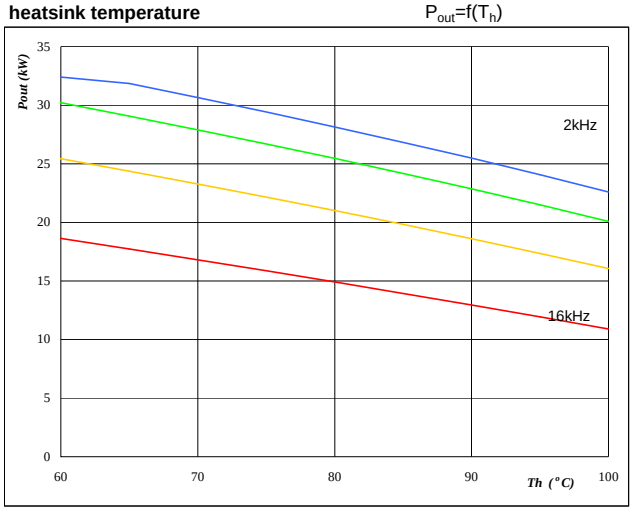

At

T_j =	150	°C
DC link =	600	V
Mi =	1	
cos φ=	0,80	
f_{sw} from	2 kHz to 16 kHz in steps of factor 2	

Figure 10 Inverter

Typical efficiency as a function of output power efficiency=f(P_{out})

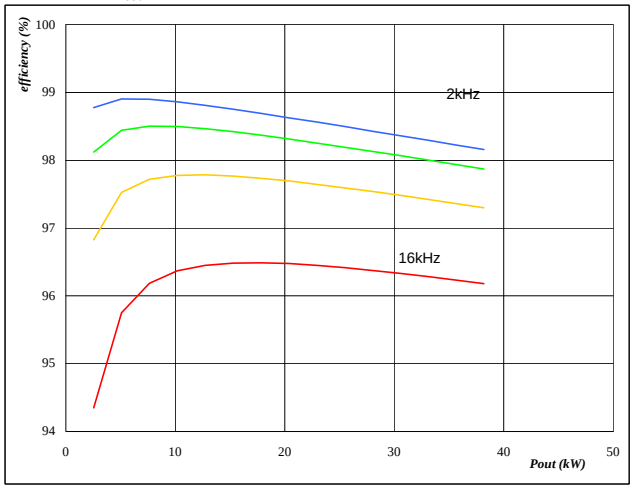

At

T_j =	150	°C
DC link =	600	V
Mi =	1	
cos φ=	0,80	
f_{sw} from	2 kHz to 16 kHz in steps of factor 2	

Figure 11 Inverter

Typical available overload factor as a function of motor power and switching frequency $P_{peak} / P_{nom}=f(P_{nom},f_{sw})$

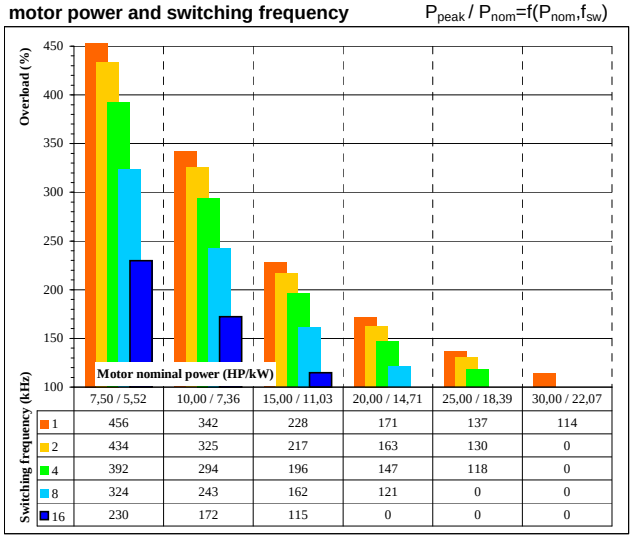

Switching frequency (kHz)	7,50 / 5,52	10,00 / 7,36	15,00 / 11,03	20,00 / 14,71	25,00 / 18,39	30,00 / 22,07
1	456	342	228	171	137	114
2	434	325	217	163	130	0
4	392	294	196	147	118	0
8	324	243	162	121	0	0
16	230	172	115	0	0	0

At

T_j =	150	°C
DC link =	600	V
Mi =	1	
cos φ=	0,8	
f_{sw} from	1 kHz to 16kHz in steps of factor 2	
T_h =	80	°C
Motor eff =	0,85	