



dsPIC30F PROGRAMMER'S REFERENCE MANUAL

dsPIC30F Programmer's Reference Manual Errata Sheet

The dsPIC30F Programmer's Reference Manual (DS70030E) conforms to the information provided in the manual, except for the anomalies described below.

All of the issues listed will be addressed in future releases of the Programmer's Reference Manual.

1. Moving Data with WREG

To clarify how the WREG may be used to move data, the following new section should be added:

4.10.3.3 Moving Data with WREG

The "MOV{.B} f {,WREG}" instruction (described on page 5-145) and "MOV{.B} WREG, f" instruction (described on page 5-146) allow for byte or word data to be moved between file register memory and the WREG (working register W0). These instructions provide equivalent functionality to the legacy Microchip PICmicro MOVF and MOVWF instructions.

The "MOV{.B} f {,WREG}" and "MOV{.B} WREG, f" instructions are the only MOV instructions which support moves of byte data to and from file register memory. Example 4-17 shows several MOV instruction examples using the WREG.

Note: When moving word data between file register memory and the working register array, the "MOV Wns, f" and "MOV f, Wnd" instructions allow any working register (W0:W15) to be used as the source or destination register, not just WREG.

Example 4-17: Moving Data with WREG

```
MOV.B 0x1001, WREG    ; move the byte stored at location 0x1001 to W0
MOV    0x1000, WREG    ; move the word stored at location 0x1000 to W0
MOV.B WREG, TBLPAG    ; move the byte stored at W0 to the TBLPAG register
MOV    WREG, 0x804     ; move the word stored at W0 to location 0x804
```

dsPIC30F Programmer's Reference Manual

2. Instruction Description - Bit Clear f Example 2

On page 5-29, Example 2 for the Bit Clear f instruction should be as follows:

Example 2 BCLR 0x400, #0x9 ; Clear bit 9 in 0x400

Before Instruction		After Instruction	
Data 0400	AA55	Data 0400	A855
SR	0000	SR	0000

3. Instruction Description - Computed Branch Example 1

On page 5-32, Example 1 for the Computed Branch instruction should be as follows:

Example 1 002000 HERE: BRA W7 ; Branch forward (2+2*W7)
 002002 . . .

 002108 . . .
 00210A TABLE7: . . .
 00210C . . .

Before Instruction		After Instruction	
PC	00 2000	PC	00 210A
W7	0084	W7	0084
SR	0000	SR	0000

4. Instruction Description Euclidean Distance (No Accumulate) - Status Affected

On page 5-111, the Status Affected for the Euclidean Distance (No Accumulate) instruction should be as follows:

OA, OB, OAB, SA, SB, SAB

5. Instruction Description - Move f to Destination

On page 5-145, the following third note should be added to the Move f to Destination description:

- 3: When moving word data from file register memory, the "MOV f to Wnd" instruction allows any working register (W0:W15) to be the destination register.

6. Instruction Description - Move WREG to f

On page 5-146, the following third note should be added to the Move WREG to f description:

- 3: When moving word data from the working register array to file register memory, the "MOV Wns to f" instruction allows any working register (W0:W15) to be the source register.

7. Instruction Description - Move f to Wnd

On page 5-147, the following third note should be added to the Mov f to Wnd description:

- 3: To move a byte of data from file register memory, the "MOV f to Destination" instruction (page 5-145) may be used.

8. Instruction Description - Move Wns to f

On page 5-148, the following third note should be added to the Mov Wns to f description:

- 3: To move a byte of data to file register memory, the "MOV WREG to f" instruction (page 5-146) may be used.

9. Table 6-3, Instruction "CP0 f" - Status Bits

In Table 6-3, dsPIC30F Instruction Set Summary Table, the "CP0 f" instruction on page 6-12, the "C" and "DC" columns should be as follows:

"1"

10. Table 6-3, Instruction "CP0 Ws" - Status Bits

In Table 6-3, dsPIC30F Instruction Set Summary Table, the "CP0 Ws" instruction on page 6-12, the "C" and "DC" columns should be as follows:

"1"

11. Table 6-3, Instruction "DIV.U Wm, Wn" - Status Bits

In Table 6-3, dsPIC30F Instruction Set Summary Table, the "DIV.U Wm, Wn" instruction on page 6-12, the "OV" column should be as follows:

"0"

12. Table 6-3, Instruction "ED Wm*Wm, Acc, Wx, Wy, Wxd" - Status Bits

In Table 6-3, dsPIC30F Instruction Set Summary Table, the "ED Wm*Wm, Acc, Wx, Wy, Wxd" instruction on page 6-12, the "OA", "OB", "OAB", "SA", "SB" and "SAB" columns should be as follows:

OA, OB, OAB: "↕"

SA, SB, SAB: "↑"

13. Table 6-3, Instruction "LSR f {,WREG}" - Status Bits

In Table 6-3, dsPIC30F Instruction Set Summary Table, the "LSR f {,WREG}" instruction on page 6-13, the "N" column should be as follows:

"0"

14. Table 6-3, Instruction "LSR Ws,Wd" - Status Bits

In Table 6-3, dsPIC30F Instruction Set Summary Table, the "LSR Ws, Wd" instruction on page 6-13, the "N" column should be as follows:

"0"

15. Table 6-3, Instruction "MPY Wm*Wn, Acc, Wx, Wxd, Wy, Wxd" - Status Bits

In Table 6-3, dsPIC30F Instruction Set Summary Table, the "MPY Wm*Wn, Acc, Wx, Wxd, Wy, Wxd" instruction on page 6-13, the "OA", "OB", "OAB", "SA", "SB" and "SAB" columns should be as follows:

OA, OB, OAB: "↕"

SA, SB, SAB: "↑"

16. Table 6-3, Instruction "MPY Wm*Wm, Acc, Wx, Wxd, Wy, Wxd" - Status Bits

In Table 6-3, dsPIC30F Instruction Set Summary Table, the "MPY Wm*Wm, Acc, Wx, Wxd, Wy, Wxd" instruction on page 6-13, the "OA", "OB", "OAB", "SA", "SB" and "SAB" columns should be as follows:

OA, OB, OAB: "↕"

SA, SB, SAB: "↑"

dsPIC30F Programmer's Reference Manual

APPENDIX A: REVISION HISTORY

Revision A (10/2003)

Original version of the document.

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as "unbreakable."

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

Information contained in this publication regarding device applications and the like is intended through suggestion only and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. No representation or warranty is given and no liability is assumed by Microchip Technology Incorporated with respect to the accuracy or use of such information, or infringement of patents or other intellectual property rights arising from such use or otherwise. Use of Microchip's products as critical components in life support systems is not authorized except with express written approval by Microchip. No licenses are conveyed, implicitly or otherwise, under any intellectual property rights.

The graphics in this document are for illustration only. Microchip reserves the right to modify the contents of its development systems.

Trademarks

The Microchip name and logo, the Microchip logo, dsPIC, KEELoQ, MPLAB, PIC, PICmicro, PICSTART, PRO MATE and PowerSmart are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

FilterLab, microID, MXDEV, MXLAB, PICMASTER, SEEVAL and The Embedded Control Solutions Company are registered trademarks of Microchip Technology Incorporated in the U.S.A.


Accuron, Application Maestro, dsPICDEM, dsPICDEM.net, ECONOMONITOR, FanSense, FlexROM, fuzzyLAB, In-Circuit Serial Programming, ICSP, ICEPIC, microPort, Migratable Memory, MPASM, MPLIB, MPLINK, MPSIM, PICC, PICKit, PICDEM, PICDEM.net, PowerCal, PowerInfo, PowerMate, PowerTool, rLAB, rPIC, Select Mode, SmartSensor, SmartShunt, SmartTel and Total Endurance are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

Serialized Quick Turn Programming (SQTP) is a service mark of Microchip Technology Incorporated in the U.S.A.

All other trademarks mentioned herein are property of their respective companies.

© 2003, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.

 Printed on recycled paper.

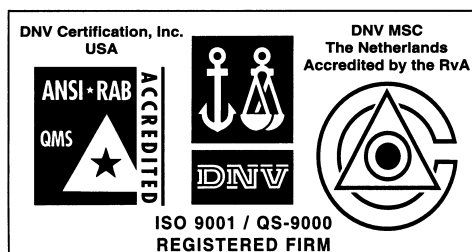

Microchip received QS-9000 quality system certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona in July 1999 and Mountain View, California in March 2002. The Company's quality system processes and procedures are QS-9000 compliant for its PICmicro® 8-bit MCUs, KEELoQ® code hopping devices, Serial EEPROMs, microperipherals, non-volatile memory and analog products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001 certified.



WORLDWIDE SALES AND SERVICE

AMERICAS

Corporate Office

2355 West Chandler Blvd.
Chandler, AZ 85224-6199
Tel: 480-792-7200
Fax: 480-792-7277
Technical Support: 480-792-7627
Web Address: <http://www.microchip.com>

Atlanta

3780 Mansell Road, Suite 130
Alpharetta, GA 30022
Tel: 770-640-0034
Fax: 770-640-0307

Boston

2 Lan Drive, Suite 120
Westford, MA 01886
Tel: 978-692-3848
Fax: 978-692-3821

Chicago

333 Pierce Road, Suite 180
Itasca, IL 60143
Tel: 630-285-0071
Fax: 630-285-0075

Dallas

4570 Westgrove Drive, Suite 160
Addison, TX 75001
Tel: 972-818-7423
Fax: 972-818-2924

Detroit

Tri-Atria Office Building
32255 Northwestern Highway, Suite 190
Farmington Hills, MI 48334
Tel: 248-538-2250
Fax: 248-538-2260

Kokomo

2767 S. Albright Road
Kokomo, IN 46902
Tel: 765-864-8360
Fax: 765-864-8387

Los Angeles

18201 Von Karman, Suite 1090
Irvine, CA 92612
Tel: 949-263-1888
Fax: 949-263-1338

Phoenix

2355 West Chandler Blvd.
Chandler, AZ 85224-6199
Tel: 480-792-7966
Fax: 480-792-4338

San Jose

2107 North First Street, Suite 590
San Jose, CA 95131
Tel: 408-436-7950
Fax: 408-436-7955

Toronto

6285 Northam Drive, Suite 108
Mississauga, Ontario L4V 1X5, Canada
Tel: 905-673-0699
Fax: 905-673-6509

ASIA/PACIFIC

Australia

Suite 22, 41 Rawson Street
Epping 2121, NSW
Australia
Tel: 61-2-9868-6733
Fax: 61-2-9868-6755

China - Beijing

Unit 915
Bei Hai Wan Tai Bldg.
No. 6 Chaoyangmen Beidajie
Beijing, 100027, No. China
Tel: 86-10-85282100
Fax: 86-10-85282104

China - Chengdu

Rm. 2401-2402, 24th Floor,
Ming Xing Financial Tower
No. 88 TIDU Street
Chengdu 610016, China
Tel: 86-28-86766200
Fax: 86-28-86766599

China - Fuzhou

Unit 28F, World Trade Plaza
No. 71 Wusi Road
Fuzhou 350001, China
Tel: 86-591-7503506
Fax: 86-591-7503521

China - Hong Kong SAR

Unit 901-6, Tower 2, Metroplaza
223 Hing Fong Road
Kwai Fong, N.T., Hong Kong
Tel: 852-2401-1200
Fax: 852-2401-3431

China - Shanghai

Room 701, Bldg. B
Far East International Plaza
No. 317 Xian Xia Road
Shanghai, 200051
Tel: 86-21-6275-5700
Fax: 86-21-6275-5060

China - Shenzhen

Rm. 1812, 18/F, Building A, United Plaza
No. 5022 Binhe Road, Futian District
Shenzhen 518033, China
Tel: 86-755-82901380
Fax: 86-755-8295-1393

China - Shunde

Room 401, Hongjian Building
No. 2 Fengxiangnan Road, Ronggui Town
Shunde City, Guangdong 528303, China
Tel: 86-765-8395507 Fax: 86-765-8395571

China - Qingdao

Rm. B505A, Fullhope Plaza,
No. 12 Hong Kong Central Rd.
Qingdao 266071, China
Tel: 86-532-5027355 Fax: 86-532-5027205

India

Divyasree Chambers
1 Floor, Wing A (A3/A4)
No. 11, O'Shaughnessy Road
Bangalore, 560 025, India
Tel: 91-80-2290061 Fax: 91-80-2290062

Japan

Benex S-1 6F
3-18-20, Shinyokohama
Kohoku-Ku, Yokohama-shi
Kanagawa, 222-0033, Japan
Tel: 81-45-471-6166 Fax: 81-45-471-6122

Korea

168-1, Youngbo Bldg. 3 Floor
Samsung-Dong, Kangnam-Ku
Seoul, Korea 135-882
Tel: 82-2-554-7200 Fax: 82-2-558-5932 or
82-2-558-5934

Singapore

200 Middle Road
#07-02 Prime Centre
Singapore, 188980
Tel: 65-6334-8870 Fax: 65-6334-8850

Taiwan

Kaohsiung Branch
30F - 1 No. 8
Min Chuan 2nd Road
Kaohsiung 806, Taiwan
Tel: 886-7-536-4818
Fax: 886-7-536-4803

Taiwan

Taiwan Branch
11F-3, No. 207
Tung Hua North Road
Taipei, 105, Taiwan
Tel: 886-2-2717-7175 Fax: 886-2-2545-0139

EUROPE

Austria

Durisolstrasse 2
A-4600 Wels
Austria
Tel: 43-7242-2244-399
Fax: 43-7242-2244-393

Denmark

Regus Business Centre
Lautrup høj 1-3
Ballerup DK-2750 Denmark
Tel: 45-4420-9895 Fax: 45-4420-9910

France

Parc d'Activite du Moulin de Massy
43 Rue du Saule Trapu
Batiment A - 1er Etage
91300 Massy, France
Tel: 33-1-69-53-63-20
Fax: 33-1-69-30-90-79

Germany

Steinheilstrasse 10
D-85737 Ismaning, Germany
Tel: 49-89-627-144-0
Fax: 49-89-627-144-44

Italy

Via Quasimodo, 12
20025 Legnano (MI)
Milan, Italy
Tel: 39-0331-742611
Fax: 39-0331-466781

Netherlands

P. A. De Biesbosch 14
NL-5152 SC Drunen, Netherlands
Tel: 31-416-690399
Fax: 31-416-690340

United Kingdom

505 Eskdale Road
Wokingham
Berkshire, England RG41 5TU
Tel: 44-118-921-5869
Fax: 44-118-921-5820

07/28/03