

MCP2551 to MCP2561 Migration

Author: Wilhelm Leichtfried
Microchip Technology Inc.

INTRODUCTION

The MCP2561 is Microchip's second generation CAN transceiver. Although major improvements have been made, resulting in increased EMC performance and much lower current consumption, the differences in using the MCP2561 versus the MCP2551 are minor.

Figure 1 shows the differences in pinout.

The MCP2561 can be used as a drop-in replacement for the MCP2551 if the differences listed in Table 1 are considered.

FIGURE 1: PINOUT DIFFERENCES

MCP2551 PDIP, SOIC				MCP2561 PDIP, SOIC			
TXD	1	8	Rs	TXD	1	8	STBY
VSS	2	7	CANH	VSS	2	7	CANH
VDD	3	6	CANL	VDD	3	6	CANL
RXD	4	5	VREF	RXD	4	5	SPLIT

The MCP2561 also adds a new leadless package type, 8LD 3x3 DFN, allowing for smaller form factor package requirements. This package features pin 9, Exposed Thermal Pad, and has the same pinout as the PDIP and SOIC packages.

For further information on these differences and on the new models available, please refer to Table A-1.

TABLE 1: MIGRATION CONSIDERATIONS

Difference	Function/Reference		Consideration
	MCP2551	MCP2561	
Pin 5	VREF	SPLIT	The name of the pin is different but the function is the same. No action required.
Pin 8	Rs Slope Control	STBY Standby	The slope of the MCP2551 is controlled by an external resistor (REXT) between the Rs pin and ground. The MCP2561 has internal slope control, allowing the Rs pin of the MCP2551 to be replaced by a STBY pin on the MCP2561. The MCP2561 enters Normal Operation mode when the voltage level on the STBY pin is low ($V_{IL} < 0.3 V_{DD}$) and enters Standby mode when the voltage level on the STBY pin is high ($V_{IH} > 0.7 V_{DD}$). The STBY pin can be pulled down or directly connected to ground for Normal Operation mode. If the STBY pin is left floating or pulled up, the MCP2561 will enter Standby mode. A microcontroller can also be used to dynamically switch between Normal Operation and Standby modes. When replacing the MCP2551 with the MCP2561, in order to meet V_{IL} for the STBY pin, the external resistor REXT must be lower than 100 kΩ . Assuming an internal worst-case pull-up of 500 kΩ, this will lead to a maximum voltage of 0.2 V_{DD} at STBY.
Compliance	ISO11898-2	ISO11898-2	
		ISO11898-5	ISO11898-5 adds a new low-power mode: - Bus pins are disconnected when the MCP2561 is not powered. No action required. ISO11898-5 increases DC Voltage requirements on CAN and Split pins: - Maximum VCANH, VCANL, VSPLIT: increased from +/- 42V to +/- 58V. No action required.

TABLE 1: MIGRATION CONSIDERATIONS (CONTINUED)

Difference	Function/Reference		Consideration
	MCP2551	MCP2561	
Operating Temperature	-40°C to +125°C	-40°C to +150°C	No action required.
EMC, ESD, Automotive	—	Meets all automotive requirements	Major improvements to EMC and ESD in the MCP2561. No action required.

TYPICAL APPLICATION: MCP2551
VERSUS MCP2561

Figure 2 and Figure 3 show two typical applications. The MCP2551 can be replaced with the MCP2561 if the following requirement is met: the **external resistor REXT must be lower than 100 kΩ**.

FIGURE 2: VREF/SPLIT NOT USED, ALWAYS IN NORMAL MODE

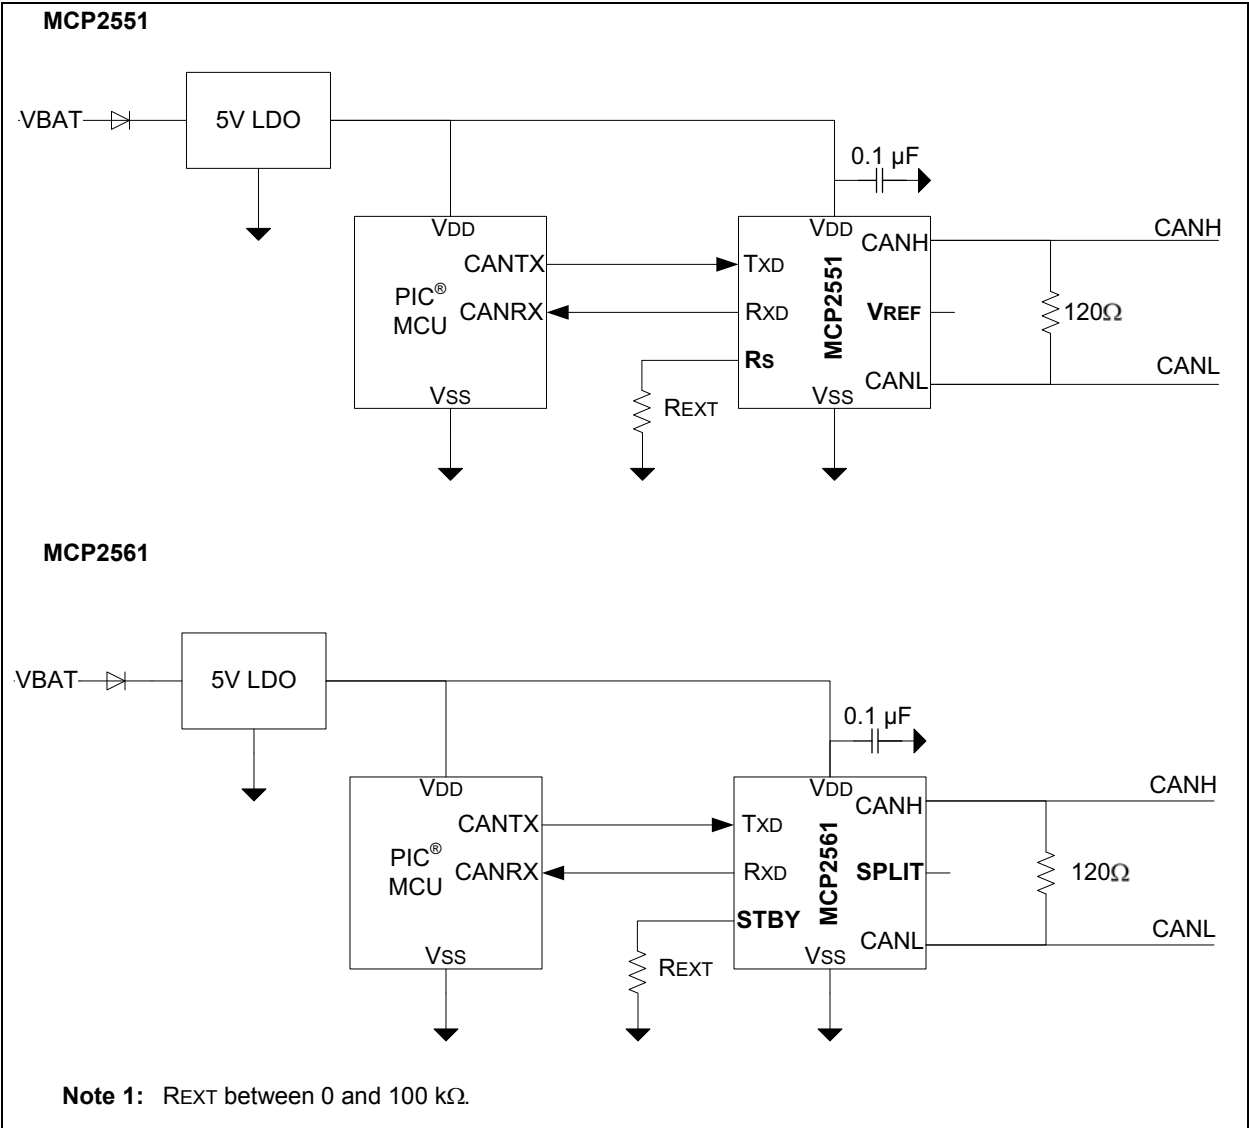
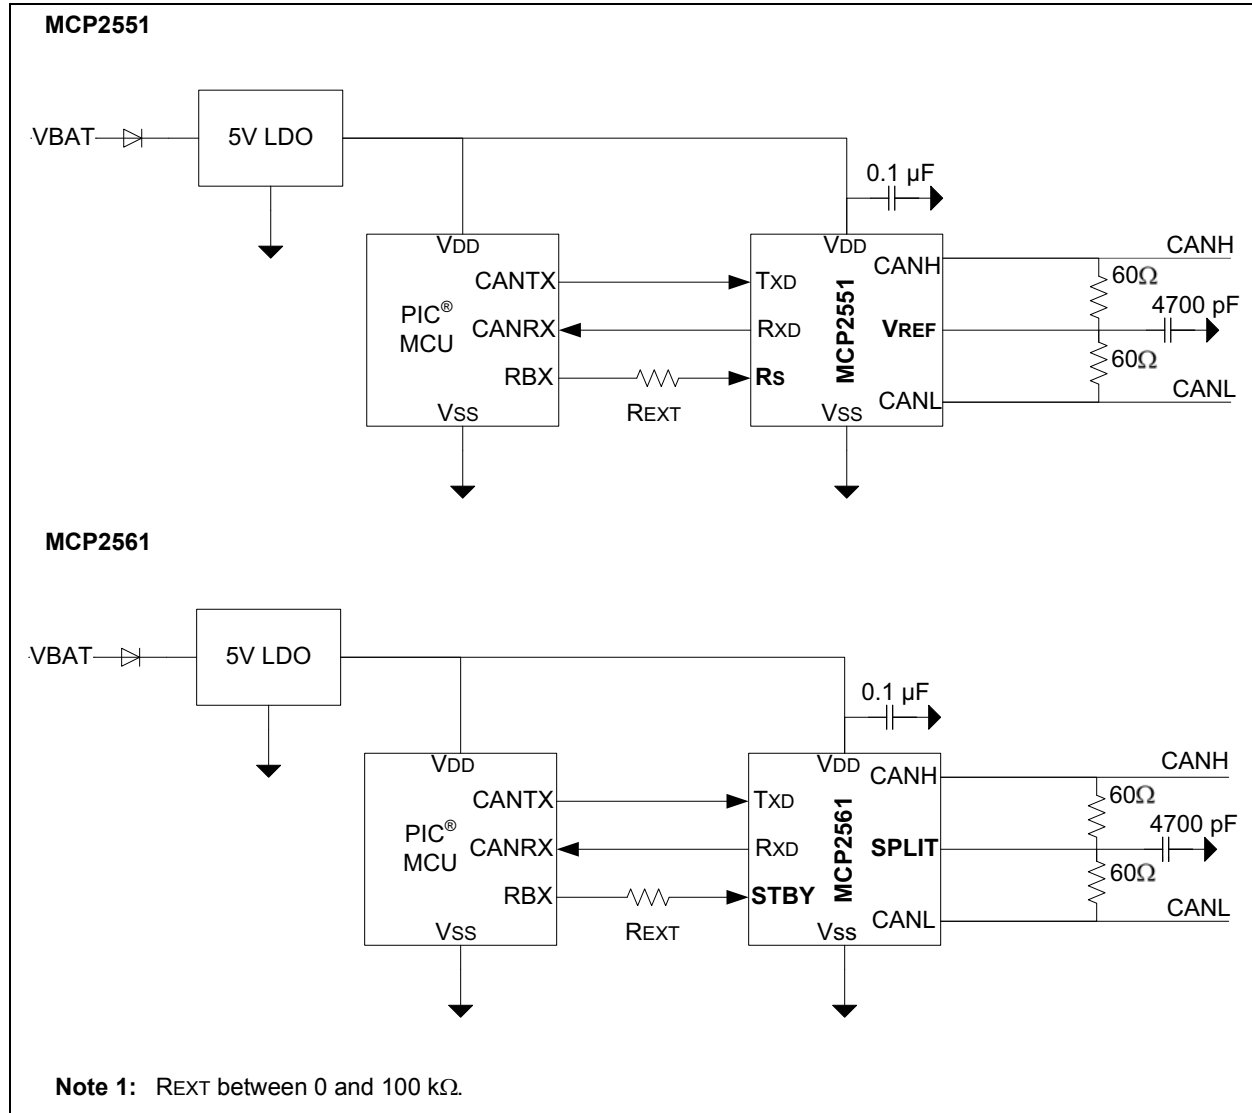


FIGURE 3: VREF/SPLIT USED, MODE CONTROLLED BY MICROCONTROLLER

CONCLUSION

This document describes the aspects to be taken into account before migrating from the MCP2551 to the MCP2561. The MCP2561 is a direct replacement for the MCP2551. The printed circuit board does not need to be modified. If an external resistor was used on the Rs pin, it has to be lower than 100 kΩ on the STBY pin. The MCP2561 has better EMC performance, lower current consumption and meets all automotive and industrial conformance and hardware requirements.

APPENDIX A: PART NUMBER REFERENCE

TABLE A-1: PART NUMBER ORDERING – ADDITIONAL INFORMATION

MCP2551 Part Number	MCP2561 Part Number Suggested for Replacement	Comments
MCP2551-I/P	MCP2561-E/P	MCP2561 supports E and H-Temp ranges
MCP2551-E/P	MCP2561-E/P	
MCP2551-I/SN	MCP2561-E/SN	MCP2561 supports E and H-Temp ranges
MCP2551T-I/SN	MCP2561T-E/SN	MCP2561 supports E and H-Temp ranges
MCP2551-E/SN	MCP2561-E/SN	
MCP2551T-E/SN	MCP2561T-E/SN	
—	MCP2561-H/P	MCP2561 offers a new H-Temp range
—	MCP2561-H/SN	MCP2561 offers a new H-Temp range
—	MCP2561T-H/SN	MCP2561 offers a new H-Temp range
—	MCP2561-E/MF	MCP2561 offers a new 8LD 3x3 DFN package option
—	MCP2561T-E/MF	MCP2561 offers a new 8LD 3x3 DFN package option
—	MCP2561-H/MF	MCP2561 offers a new H-Temp range
—	MCP2561T-H/MF	MCP2561 offers a new H-Temp range

Note 1: I-Temp = -40 to +85°C

2: E-Temp = -40 to +125°C

3: H-Temp = -40 to +150°C

Note the following details of the code protection feature on Microchip devices:

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as "unbreakable."

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights.

Trademarks

The Microchip name and logo, the Microchip logo, dsPIC, FlashFlex, KEELOQ, KEELOQ logo, MPLAB, PIC, PICmicro, PICSTART, PIC³² logo, rPIC, SST, SST Logo, SuperFlash and UNI/O are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

FilterLab, Hampshire, HI-TECH C, Linear Active Thermistor, MTP, SEEVAL and The Embedded Control Solutions Company are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Silicon Storage Technology is a registered trademark of Microchip Technology Inc. in other countries.

Analog-for-the-Digital Age, Application Maestro, BodyCom, chipKIT, chipKIT logo, CodeGuard, dsPICDEM, dsPICDEM.net, dsPICworks, dsSPEAK, ECAN, ECONOMONITOR, FanSense, HI-TIDE, In-Circuit Serial Programming, ICSP, Mindi, MiWi, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, mTouch, Omniclient Code Generation, PICC, PICC-18, PICDEM, PICDEM.net, PICkit, PICTail, REAL ICE, rLAB, Select Mode, SQL, Serial Quad I/O, Total Endurance, TSHARC, UniWinDriver, WiperLock, ZENA and Z-Scale are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

GestIC and ULPP are registered trademarks of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2013, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.



Printed on recycled paper.

ISBN: 978-1-62077-601-8

QUALITY MANAGEMENT SYSTEM
CERTIFIED BY DNV
== ISO/TS 16949 ==

Microchip received ISO/TS-16949:2009 certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona; Gresham, Oregon and design centers in California and India. The Company's quality system processes and procedures are for its PIC® MCUs and dsPIC® DSCs, KEELOQ® code hopping devices, Serial EEPROMs, microperipherals, nonvolatile memory and analog products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001:2000 certified.

Worldwide Sales and Service

AMERICAS

Corporate Office
2355 West Chandler Blvd.
Chandler, AZ 85224-6199
Tel: 480-792-7200
Fax: 480-792-7277
Technical Support:
<http://www.microchip.com/support>
Web Address:
www.microchip.com

Atlanta
Duluth, GA
Tel: 678-957-9614
Fax: 678-957-1455

Austin, TX
Tel: 512-257-3370

Boston
Westborough, MA
Tel: 774-760-0087
Fax: 774-760-0088

Chicago
Itasca, IL
Tel: 630-285-0071
Fax: 630-285-0075

Cleveland
Independence, OH
Tel: 216-447-0464
Fax: 216-447-0643

Dallas
Addison, TX
Tel: 972-818-7423
Fax: 972-818-2924

Detroit
Novi, MI
Tel: 248-848-4000

Houston, TX
Tel: 281-894-5983

Indianapolis
Noblesville, IN
Tel: 317-773-8323
Fax: 317-773-5453

Los Angeles
Mission Viejo, CA
Tel: 949-462-9523
Fax: 949-462-9608

New York, NY
Tel: 631-435-6000

San Jose, CA
Tel: 408-735-9110

Canada - Toronto
Tel: 905-673-0699
Fax: 905-673-6509

ASIA/PACIFIC

Asia Pacific Office
Suites 3707-14, 37th Floor
Tower 6, The Gateway
Harbour City, Kowloon
Hong Kong
Tel: 852-2401-1200
Fax: 852-2401-3431

Australia - Sydney
Tel: 61-2-9868-6733
Fax: 61-2-9868-6755

China - Beijing
Tel: 86-10-8569-7000
Fax: 86-10-8528-2104

China - Chengdu
Tel: 86-28-8665-5511
Fax: 86-28-8665-7889

China - Chongqing
Tel: 86-23-8980-9588
Fax: 86-23-8980-9500

China - Hangzhou
Tel: 86-571-2819-3187
Fax: 86-571-2819-3189

China - Hong Kong SAR
Tel: 852-2943-5100
Fax: 852-2401-3431

China - Nanjing
Tel: 86-25-8473-2460
Fax: 86-25-8473-2470

China - Qingdao
Tel: 86-532-8502-7355
Fax: 86-532-8502-7205

China - Shanghai
Tel: 86-21-5407-5533
Fax: 86-21-5407-5066

China - Shenyang
Tel: 86-24-2334-2829
Fax: 86-24-2334-2393

China - Shenzhen
Tel: 86-755-8864-2200
Fax: 86-755-8203-1760

China - Wuhan
Tel: 86-27-5980-5300
Fax: 86-27-5980-5118

China - Xian
Tel: 86-29-8833-7252
Fax: 86-29-8833-7256

China - Xiamen
Tel: 86-592-2388138
Fax: 86-592-2388130

China - Zhuhai
Tel: 86-756-3210040
Fax: 86-756-3210049

ASIA/PACIFIC

India - Bangalore
Tel: 91-80-3090-4444
Fax: 91-80-3090-4123

India - New Delhi
Tel: 91-11-4160-8631
Fax: 91-11-4160-8632

India - Pune
Tel: 91-20-3019-1500

Japan - Osaka
Tel: 81-6-6152-7160
Fax: 81-6-6152-9310

Japan - Tokyo
Tel: 81-3-6880-3770
Fax: 81-3-6880-3771

Korea - Daegu
Tel: 82-53-744-4301
Fax: 82-53-744-4302

Korea - Seoul
Tel: 82-2-554-7200
Fax: 82-2-558-5932 or
82-2-558-5934

Malaysia - Kuala Lumpur
Tel: 60-3-6201-9857
Fax: 60-3-6201-9859

Malaysia - Penang
Tel: 60-4-227-8870
Fax: 60-4-227-4068

Philippines - Manila
Tel: 63-2-634-9065
Fax: 63-2-634-9069

Singapore
Tel: 65-6334-8870
Fax: 65-6334-8850

Taiwan - Hsin Chu
Tel: 886-3-5778-366
Fax: 886-3-5770-955

Taiwan - Kaohsiung
Tel: 886-7-213-7830

Taiwan - Taipei
Tel: 886-2-2508-8600
Fax: 886-2-2508-0102

Thailand - Bangkok
Tel: 66-2-694-1351
Fax: 66-2-694-1350

EUROPE

Austria - Wels
Tel: 43-7242-2244-39
Fax: 43-7242-2244-393

Denmark - Copenhagen
Tel: 45-4450-2828
Fax: 45-4485-2829

France - Paris
Tel: 33-1-69-53-63-20
Fax: 33-1-69-30-90-79

Germany - Dusseldorf
Tel: 49-2129-3766400

Germany - Munich
Tel: 49-89-627-144-0
Fax: 49-89-627-144-44

Germany - Pforzheim
Tel: 49-7231-424750

Italy - Milan
Tel: 39-0331-742611
Fax: 39-0331-466781

Italy - Venice
Tel: 39-049-7625286

Netherlands - Drunen
Tel: 31-416-690399
Fax: 31-416-690340

Poland - Warsaw
Tel: 48-22-3325737

Spain - Madrid
Tel: 34-91-708-08-90
Fax: 34-91-708-08-91

Sweden - Stockholm
Tel: 46-8-5090-4654

UK - Wokingham
Tel: 44-118-921-5800
Fax: 44-118-921-5820