



LCR METER IM3536

Component measuring instruments



DC, 4 Hz to 8 MHz
Measurement frequency



The new standard

Introducing an LCR meter that brings exceptional specifications and cost performance to a wide range of applications, from R&D to production lines




Test fixtures and probes sold separately. Photograph depicts IM3536 used in combination with the SMD Test Fixture 9677.

One-eighth the precision variability and five times the measurement speed of legacy models means dramatically improved productivity.

High speed Stability

Repeatability and measurement time
(Comparison of IM3536 and 3532-50)

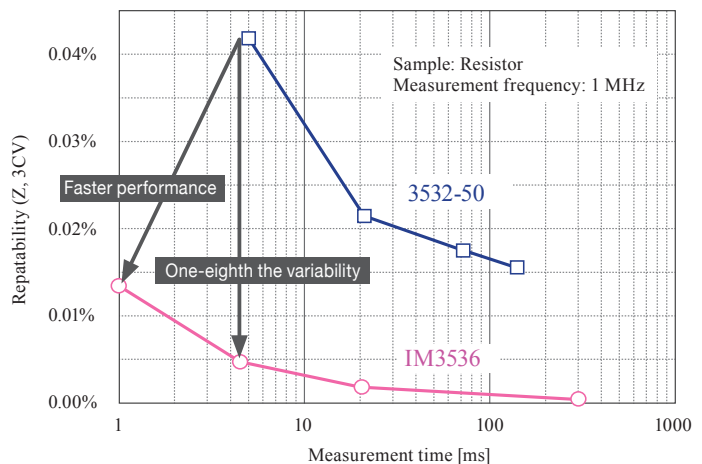

Raising the Bar for Basic Performance


High accuracy $\pm 0.05\%$ rdg.

High speed 1 ms (fastest time)



Guaranteed accuracy range from 1 m Ω

The IM3536 delivers a guaranteed accuracy range that starts at 1 m Ω . Furthermore, the frequency band has been expanded to 8 MHz, broadening the array of measurement targets with which it can be used compared to legacy products.

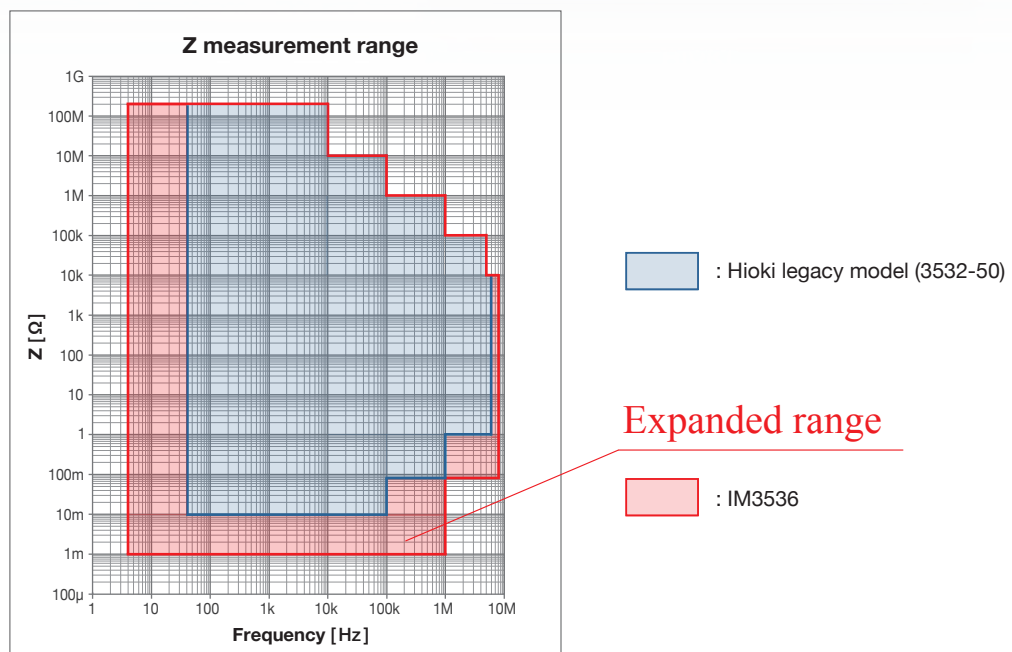


For more information about L and C measurable ranges, see page 14.



Low-impedance measurement with unmatched repeatability

The IM3536 delivers repeatability that is an order of magnitude better than that of previous products. This level of performance makes the instrument ideal for use in applications such as electrolytic capacitor low-ESR measurement and power supply coil impedance testing, the latter of which demands excellent frequency characteristics.

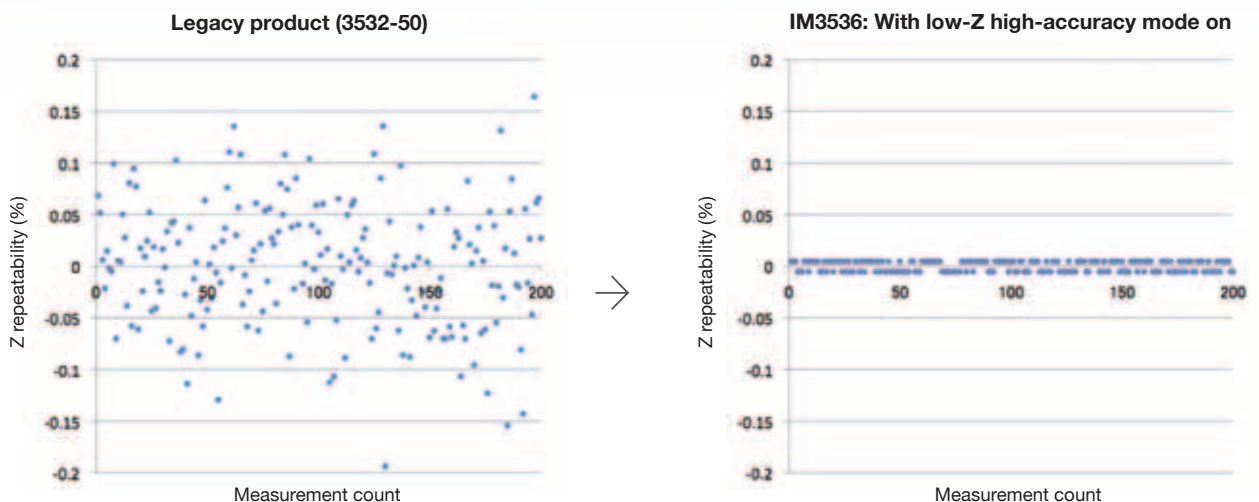

Graphs illustrate the results of measuring a resistance of 1 mΩ 200 times under the following conditions:

- Frequency: 1 kHz
- Measurement speed: FAST
- Measurement range: 100 mΩ



From measurement to analysis

Applications in development evaluation and research

Ideal for use in R&D work requiring a wide range of measurement conditions and for evaluation of devices under conditions of actual use

The IM3536 enables measurement conditions to be varied over a wide range, for example to analyze a coil's resonance point while varying the frequency or to perform measurement while changing the measurement signal during evaluation of a sample that exhibits signal dependency.

Variable frequency
DC, 4 Hz to 8 MHz


Variable voltage
10 mV to 5 V
(V mode/CV mode)

Variable current
10 μ A to 100 mA
(CC mode)

Example of measurement while varying the frequency from 1 MHz to 8 MHz



USB connection

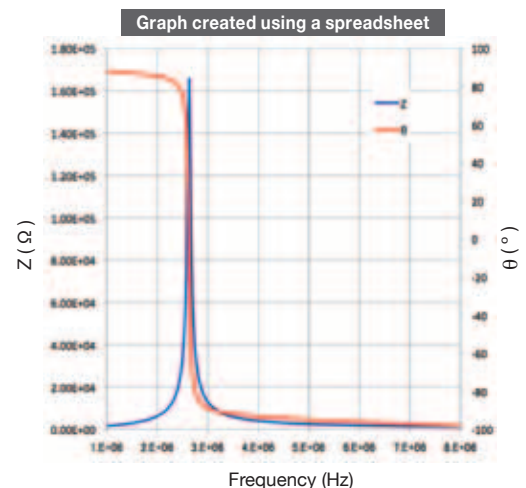

The IM3536 ships standard with application software that can save measurement data as an Excel file while sweeping through a range of frequencies pre-configured on a computer.

For more information, see page 5.

DC bias function: Measure under conditions simulating actual use or in accordance with industry standards

Internal DC bias (capacitor only)



A DC voltage can be superposed onto the measurement signal while measuring a capacitor.



The generated voltage can be varied from 0 V to 2.50 V DC (10 mV resolution).
(Low-Z high-accuracy mode: 0 V to 1 V)

External DC bias

(with support for L or C measurement, depending on the unit)



Requires a separate external DC bias power supply.

DC BIAS VOLTAGE UNIT 9268-10



Measurement frequency range: 40 Hz to 8 MHz
Maximum applied voltage: ±40 V DC


DC BIAS CURRENT UNIT 9269-10




Measurement frequency range: 40 Hz to 2 MHz
Maximum applied current: 2 A DC
* An internal 300µH inductance is connected in parallel to the DUT.

Calculate conductivity and the dielectric constant

The conditions used to calculate conductivity and the dielectric constant can be set easily using the instrument's touch screen.

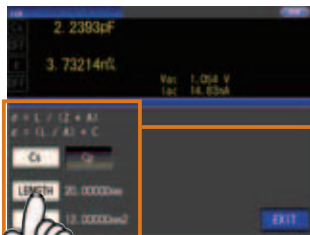

Enter the following parameters:
Conductor length (LENGTH)
Conductor cross-sectional area (AREA)

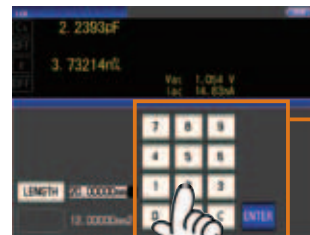


The instrument's touch keypad makes it easy to enter numbers.

Evaluate samples that exhibit signal dependence using free application software

The bundled application allows you to save measurement data from the LCR meter as a Microsoft Excel or text file (CSV format) using the instrument's USB, LAN, GP-IB, or RS-232C interface.


Standard accessory

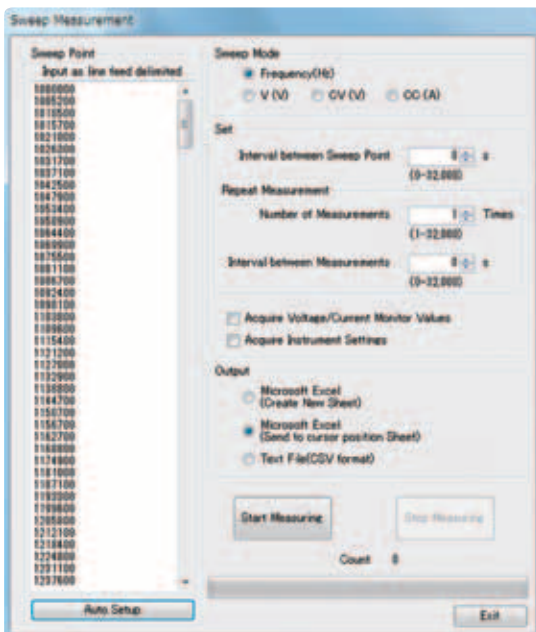

- Frequency characteristics (measurement while varying the frequency)
- Voltage characteristics (measurement while varying the voltage)
- Current characteristics (measurement while varying the current)
- Time interval measurement (measurement at a specified time interval)
- Capture measured value when the RETURN key is pressed (one-off measurement)

Simple, automatic configuration of sweep points

Sweep points are generated automatically once you set the start value, end value, and number of intermediate data points.

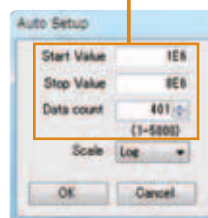

Data saved in CSV format

	A	B	C	D	E
1	Frequency/AC Status	Z	PH		
2	1000000	0.154E+03	87.847		
3	1005200	0.155E+03	87.819		
4	1010500	0.156E+03	87.832		
5	1015700	0.157E+03	87.808		
6	1021000	0.158E+03	87.857		
7	1026300	0.159E+03	87.895		
8	1031700	0.161E+03	87.882		
9	1037100	0.162E+03	87.871		
10	1042500	0.163E+03	87.87		
11	1047900	0.164E+03	87.859		
12	1053400	0.165E+03	87.85		
13	1058900	0.166E+03	87.841		
14	1064400	0.168E+03	87.833		
15	1069900	0.169E+03	87.82		
16	1075500	0.170E+03	87.814		
17	1081100	0.171E+03	87.806		
18	1086700	0.173E+03	87.798		
19	1092400	0.174E+03	87.785		
20	1098100	0.175E+03	87.774		
21	1103800	0.176E+03	87.758		




Simplifying the process of building production lines Increase convenience and efficiency

Perform two jobs with one instrument to save space and speed up the process of building a system

Continuous measurement function

Suppose you wish to test power supply inductance L-Q at 1 kHz plus DC resistance (DCR). The IM3536 steps up by delivering high-speed, continuous measurement of different conditions with a single instrument.

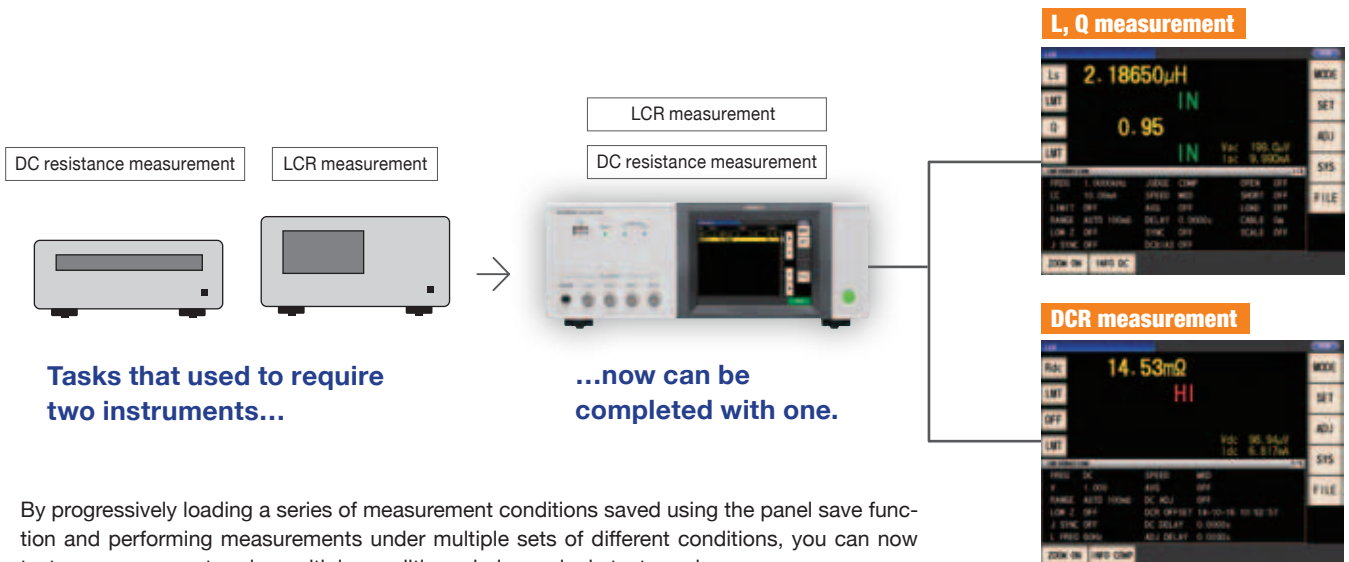

Display saved panels as a list and load them quickly

Panel save and load functions


Save and load measurement conditions and compensation values.

Ensure reliable application of settings during setup changes

Target A: Measurement conditions and judgment standards




- Measurement parameters: Ls, Q, Rdc
- Measurement frequency: 1 kHz
- Constant current: 1 mA

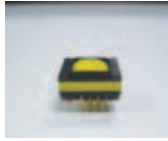

Target B: Measurement conditions and judgment standards

- Measurement parameters: Z, θ
- Measurement frequency: 1.5 kHz
- Constant current: 0.5 mA

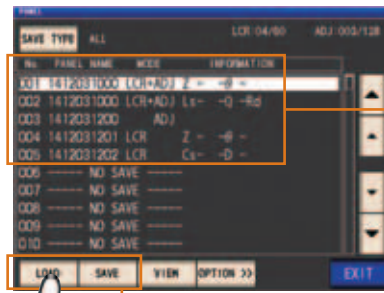

Easy-to-view list display
Filename
Measurement parameter name



Load or save using the touch screen keys


Analyze the data you need on a computer quickly and easily

Memory function and USB flash drive support



Save 32000 measurement results, copy them to a USB flash drive, and load them onto a computer. You can then open the measurement data using a spreadsheet to analyze variations and manage test data.

Even if both hands are full

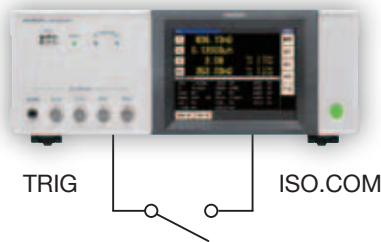

Select [External trigger] as the trigger setting and then control instrument operations such as measurement and saving of data from an external device such as a foot switch via the EXT. I/O terminal's TRIG signal.


Measure and save multiple test results

Measure the test target.


Save the results to the instrument's internal memory.

Number of tests: n

Copy the saved data to a USB flash drive.



Load the data onto a computer.

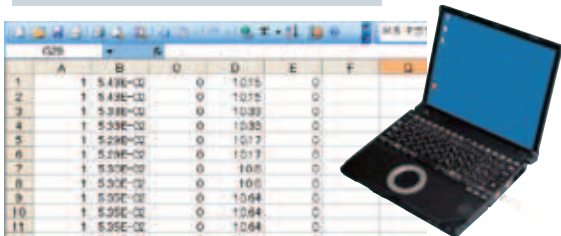


Analysis using a spreadsheet

Improved protective functionality to reduce maintenance downtime

Residual charge protection function

The IM3536 features an enhanced residual charge protection function that is designed to protect the instrument's internal circuitry from a capacitor discharge voltage in the event a charged capacitor is inadvertently connected to a measurement terminal.

Relationship between the capacitance from which LCR meters can be protected and residual voltage values

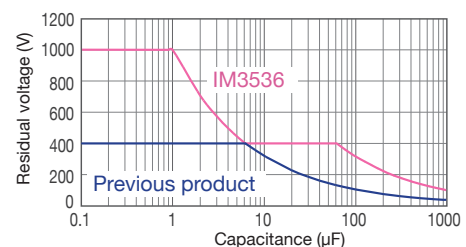




Functionality supporting more accurate measurement Delivering reliability for production-line testing

Compensate for anticipated errors


Cable length compensation

Select from cable length settings of 0 m, 1 m, 2 m, and 4 m, guaranteeing accuracy even when measurement cables have been extended.

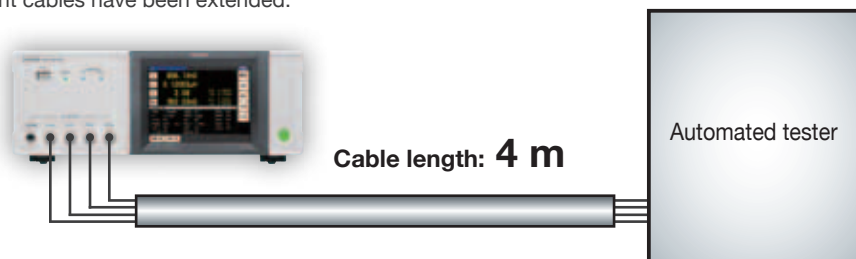

Load compensation


Up to five sets of compensation conditions can be saved.

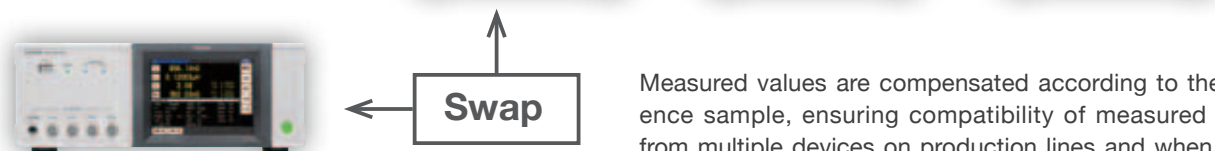

Measured values are compensated according to the reference sample, ensuring compatibility of measured values from multiple devices on production lines and when swapping out devices, for example when a unit needs to be calibrated.

Low-Z high-accuracy mode for increasing the maximum applied current


When using low-Z high-accuracy mode, the output resistance changes to 10 Ω, allowing more current to flow to the sample being measured so that high-precision measurement is guaranteed.

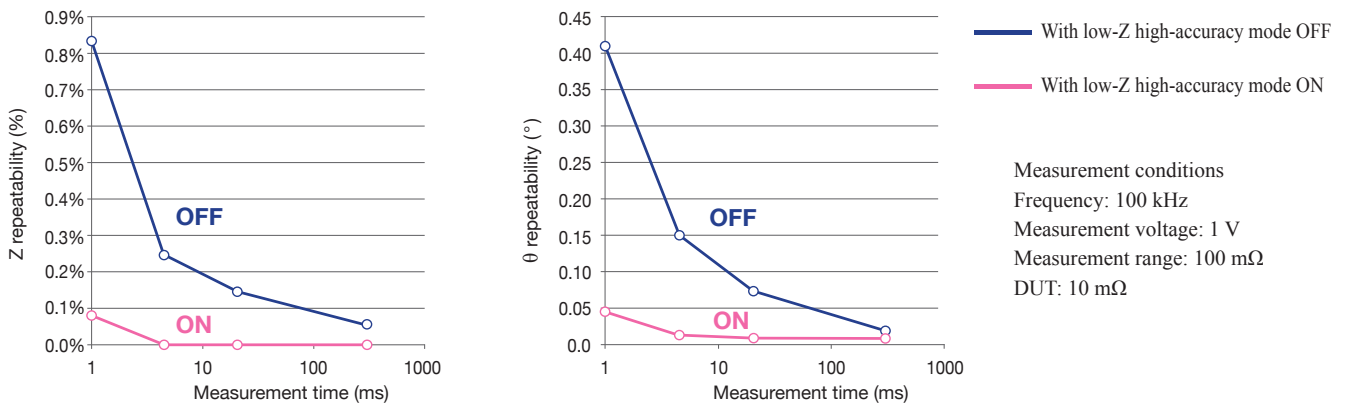


Low-Z high-accuracy mode can be used with the 100 mΩ, 1 Ω, and 10 Ω ranges. This mode is especially effective when performing low-inductance L measurement of power supplies and ESR measurement of aluminum electrolytic capacitors.

Contact check function

Detect faulty contact with the sample during four-terminal measurement.

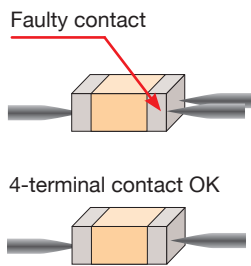

The contact check function measures the contact resistance between L_{POT} and L_{CUR} and between H_{POT} and H_{CUR} and displays an error if the readings are greater than or equal to a preset threshold.

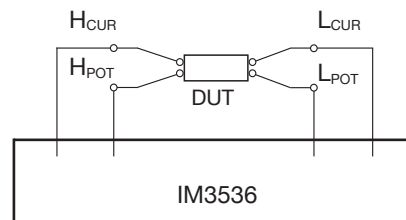


Set threshold values

Contact resistance
Approx. 1,000 Ω
Approx. 500 Ω
Approx. 100 Ω
Approx. 50 Ω
Approx. 20 Ω


H_{CUR} terminal: Current generation terminal
 H_{POT} terminal: HI voltage detection terminal
 L_{POT} terminal: LO voltage detection terminal
 L_{CUR} terminal: Current detection terminal

Hi-Z reject function

Detect contact errors during two-terminal measurement.

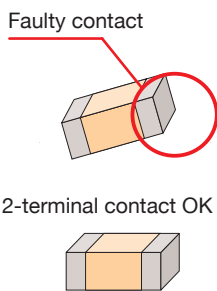

The Hi-Z reject function outputs an error if the measurement result exceeds a preset judgment standard. This capability enables the instrument to detect poor contact when performing measurement using a two-terminal fixture.

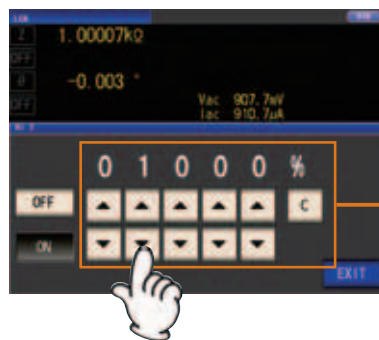


The judgment standard is calculated based on the measurement range and judgment reference value (valid setting range: 0% to 30,000%).

The instrument's touch keypad makes it easy to enter judgment reference values.

Improve measurement precision with the waveform averaging function


The IM3536's waveform averaging function lets you set the number of measured waveforms for each frequency band determined by the measurement speed setting (FAST, MED, SLOW, SLOW2).

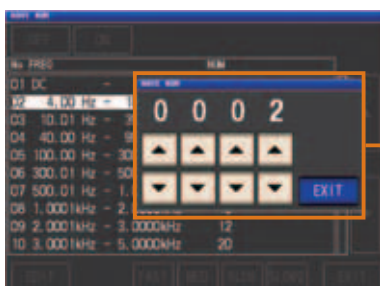

Number of waveforms → Many (increased measurement precision)

Normal (FAST, MED, SLOW, SLOW2) number of waveforms

Number of waveforms → Few (higher measurement speed)

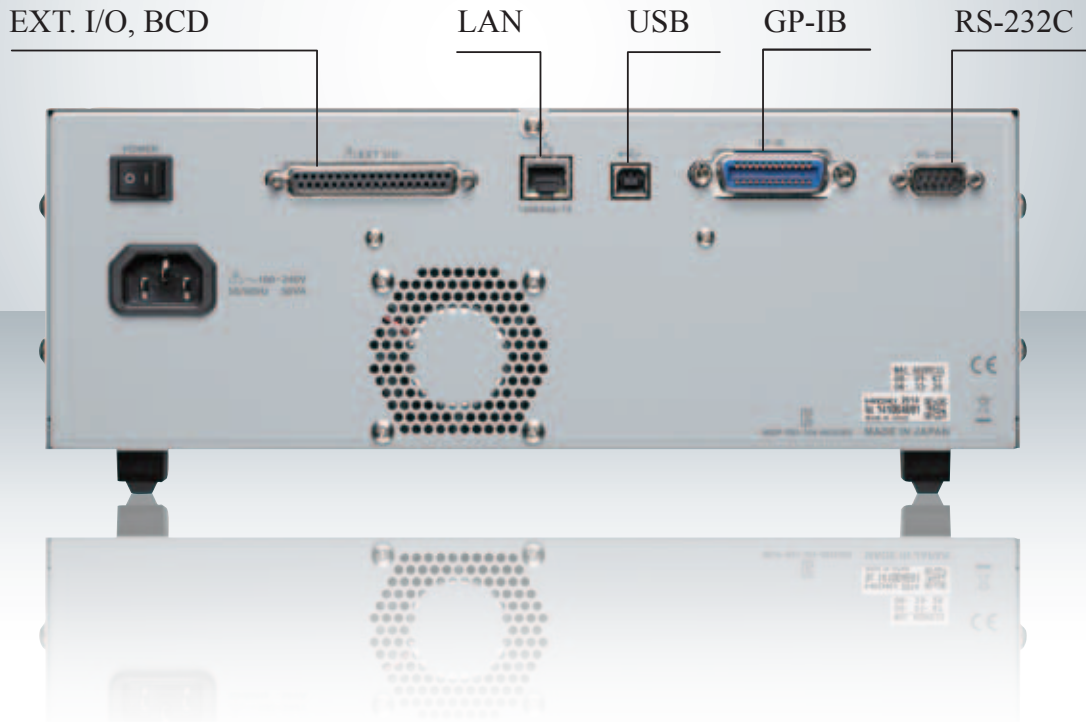


Access an extensive range of interfaces in all model variants

EXT. I/O

EXT. I/O allows you to output the measurement complete signal and judgment results signal and to control the instrument by inputting signals such as a measurement trigger signal. All signal lines are isolated from the instrument's measurement and control circuitry for maximum noise resistance.

■ Example of EXT I/O timing (LCR mode)

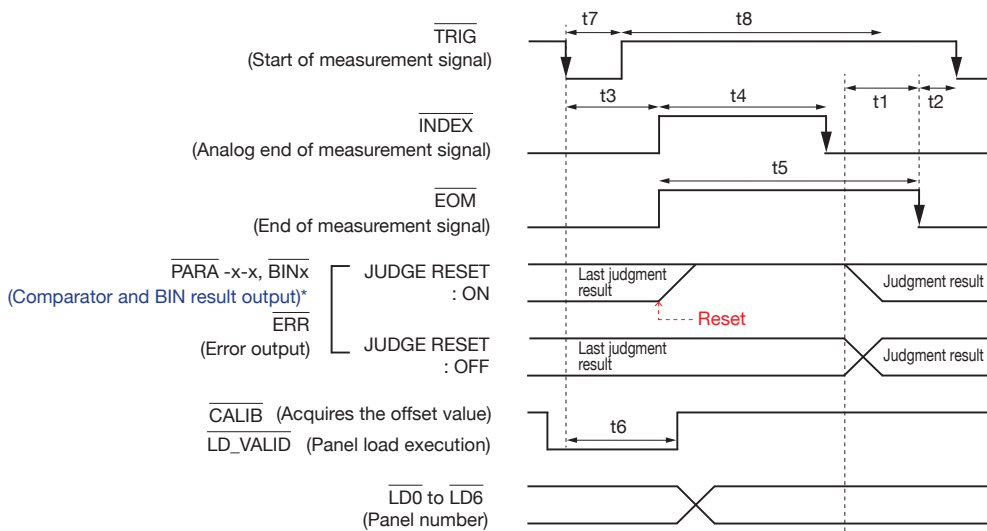

*: PARAX-HI, PARAX-IN, PARAX-LO, AND, BINx, OUT_OF_BINS

- t1: From Comparator, BIN Judgement Result to $\overline{\text{EOM}}$ (LO): Setting value for delay time ^{*1} (Settable range: 0.0000 s to 0.9999 s) ; 40 μs
t2: From $\overline{\text{EOM}}$ width (LO) to $\overline{\text{TRIG}}$ (LO): Minimum time from end of measurement to next trigger ^{*2} ; 400 μs
t3: From $\overline{\text{TRIG}}$ (LO) to $\overline{\text{INDEX}}$ (HI): Time from trigger to circuit response ^{*3} ; 400 μs
t4: $\overline{\text{INDEX}}$ width (HI): Analog measurement time (=Minimum chuck time), switching chuck with $\overline{\text{INDEX}}$ (LO) is possible ^{*4} ; 1 ms
t5: $\overline{\text{EOM}}$ width (HI): Measurement time ^{*4} ; 1.5 ms
t6: From $\overline{\text{TRIG}}$ width (LO) to $\overline{\text{LD-VALID}}$ (HI), $\overline{\text{CALIB}}$ (HI): Time to panel load execution and DC adjustment request signal detection: at least t3
t7: Trigger pulse width (LO time) ; At least 100 μs
t8: Trigger off (HI time) ; At least 100 μs

^{*1}. There is an approximate error of 100 μs in the delay time entered for Judgement Result \leftrightarrow EOM for the setting value. t1 is the reference value for when the setting value is 0.0000 s.

^{*2}. t2 is the reference value for when trigger input for during measurement is disabled.

^{*3}. Additional time is required when loading panel numbers using the panel load function.

^{*4}. Reference value for Measurement frequency: 1 kHz, Measurement speed: FAST, Range: HOLD

Measurement parameters and measurement conditions

Measurement parameters	Z	Impedance	Rs	Equivalent series resistance (ESR)
	Y	Admittance	Rp	Equivalent parallel resistance
	θ	Phase angle	Ls	Equivalent series inductance
	X	Reactance	Lp	Equivalent parallel inductance
	G	Conductance	Cs	Equivalent series capacitance
	B	Susceptance	Cp	Equivalent parallel capacitance
	Q	Q-factor	D	Loss factor $\tan \delta$
	Rdc	DC resistance	σ	Conductivity
			ϵ	Permittivity
Display range	Z	0.00 m to 9.99999 G Ω	Rs	$\pm(0.00$ m to 9.99999 G Ω)
	Y	0.000 n to 9.99999 GS	Rp	$\pm(0.00$ m to 9.99999 G Ω)
	θ	$\pm(0.000^\circ$ to 999.999 $^\circ$)	Ls	$\pm(0.00000$ μ to 9.99999 GH)
	X	$\pm(0.00$ m to 9.99999 G Ω)	Lp	$\pm(0.00000$ μ to 9.99999 GH)
	G	$\pm(0.000$ n to 9.99999 GS)	Cs	$\pm(0.00000$ p to 9.99999 GF)
	B	$\pm(0.000$ n to 9.99999 GS)	Cp	$\pm(0.00000$ p to 9.99999 GF)
	Q	$\pm(0.00$ to 9999.99)	D	$\pm(0.00000$ to 9.99999)
	Rdc	$\pm(0.00$ m to 9.99999 G Ω)	$\Delta\%$	$\pm(0.000\%$ to 999.999 $\%$)
			σ	$\pm(0.00000$ to 999.999 G)
			ϵ	$\pm(0.00000$ to 999.999 G)
	Measurable range	1 m Ω to 200 M Ω		
Output impedance	Normal mode: 100 Ω , Low impedance high accuracy mode: 10 Ω			
Measurement frequency	Range	4 Hz to 8 MHz		
	Resolution	4.00 Hz to 999.99 Hz 10 mHz steps 1.0000 kHz to 9.9999 kHz 100 mHz steps 10.000 kHz to 99.999 kHz 1 Hz steps 100.00 kHz to 999.99 kHz 10 Hz steps 1.0000 MHz to 8.0000 MHz 100 Hz steps		
	Accuracy	$\pm 0.01\%$ of setting or less		
Measurement signal level [V mode] [CV mode]	Range	[Normal mode] 4 Hz to 1.0000 MHz: 10 mV to 5 V (maximum 50 mA) 1.0001 MHz to 8 MHz: 10 mV to 1 V (maximum 10 mA) [Low impedance high accuracy mode] 4 Hz to 1.0000 MHz: 10 mV to 1 V (maximum 100 mA)		
	Resolution	10 mV to 1.000 V 1 mV steps		
Measurement signal level [CC mode]	Range	[Normal mode] 4 Hz to 1.0000 MHz: 10 μ A to 50 mA (maximum 5 V) 1.0001 MHz to 8 MHz: 10 μ A to 1 mA (maximum 1 V) [Low impedance high accuracy mode] 4 Hz to 1.0000 MHz: 10 μ A to 100 mA (maximum 1 V)		
	Resolution	10 μ A steps		
Monitor function	Monitor voltage range: 0.000 V to 5.000 V Monitor current range: 0.000 mA to 100.0 mA			
DC resistance measurement	Measurement signal level: Fixed at 1 V			
DC bias measurement	Generating range: DC voltage 0 V to 2.50 V (10 mV resolution) In low Z high accuracy mode: 0 V to 1 V (10 mV resolution)			

Measurement modes

Measurement modes	LCR mode: Measurement using a single set of conditions. Continuous measurement mode: Continuous measurement using previously saved conditions
-------------------	--

LCR mode

Measurements	Bin measurement: 10 categories for 2 measurement parameters Judgment method: Set as absolute values, percentage, or deviation percentage
	Comparator measurement: Hi, IN, and Lo judgments for 2 parameters Judgment method: Set as absolute values, percentage, or deviation percentage
Display	Zoom display function: Enlarged display of measured values Number of display digits setting: Allows you to set the number of display digits for measured values for each measurement parameter. (Valid setting range: 3 to 6 digits)

Continuous measurement mode

Measurements	Performs continuous measurement using measurement conditions that have been saved using the panel save function. Measurement is started by an external trigger (any of the three types described below)
Maximum number of measurements	60

Speed and accuracy

Measurement speed	FAST/MED/SLOW/SLOW2
Averaging	Valid setting range: 1 to 256 (in steps of 1)
Basic accuracy	Z: 0.05% rdg. θ : 0.03 $^\circ$ (representative value)
Guaranteed accuracy range	1 m Ω to 200 M Ω (impedance)
Guaranteed accuracy period	1 year
Warm-up time	60 minutes
Terminal structure	4-terminal structure

Supplementary functionality

Trigger function	Uses a specific signal to time the start of measurement. [Trigger types] Internal trigger: Automatically generates a trigger signal internally to repeat measurement. External trigger: Allows you to control the instrument's measurement operation by inputting a trigger signal from an external device (trigger sources: manual, communications commands, EXT. I/O).
	[Trigger delay] Sets the delay time from trigger input to measurement. Setting range: 0.0000 s to 9.9999 s [Trigger synchronous output] Outputs the measurement signal after trigger input and applies it to the sample during measurement only. Allows you to set a wait time until data is acquired. Setting range: 0.0000 s to 9.9999 s
Compensation function	[Open/short compensation] [Load compensation] Number of sets of compensation conditions: Up to 5 [Cable length compensation] Cable length settings: 0 m, 1 m, 2 m, 4 m [Correlation compensation] Compensation of display values based on user-input compensation coefficient
Contact check	[4-terminal contact check] Performs a contact (disconnection) check between H_{CUR} and H_{POT} and between L_{CUR} and L_{POT} . [High-Z reject function] Detection of OPEN state during 2-terminal measurement.

Recording and interface

Memory function	Measurement result items (maximum 32000 items) can be saved to the instrument. Memory can be read using communications commands or a USB flash drive.
Panel save and load functions	Measurement conditions: Up to 60 Compensation values: Up to 128
Interfaces	EXT. I/O(HANDLER) ,USB, USB flash drive, LAN, GP-IB, RS-232C
BCD output	[Output from EXT. I/O connector] Generates BCD output for the No.1 and No.3 parameter measured values. *Input and output signals are set to BCD mode (selection with judgment output).

Display and sound

Key lock function	Lock operation of the instrument using the touch screen. Unlock by entering a passcode.
Beep tone	Enable or disable for judgment results and key operation.
Display settings	LCD display on/off Off: The display turns off 10 sec. after the touch panel is last touched.
Display	5.7-inch color TFT with touch panel

Other

Operating temperature and humidity	0 $^\circ$ C to 40 $^\circ$ C (32 $^\circ$ F to 104 $^\circ$ F), 80% RH, non-condensing
Storage temperature and humidity	-10 $^\circ$ C to 50 $^\circ$ C (14 $^\circ$ F to 122 $^\circ$ F), 80% RH, non-condensing
Operating environment	Indoors, Pollution Degree 2, altitude up to 2000 m (6562-ft.)
Power supply and maximum rated power	100 V AC to 240 V AC (50/60 Hz), 50 VA
Dielectric strength	1.62 kV AC for 1 min. between power line and ground line
Standards compliance	EMC: EN 61326, EN 61000 Safety: EN 61010
Dimensions and Mass	Approx. 330 W \times 119 H \times 230 D mm (12.99 W \times 4.69 H \times 9.06 D in), approx. 4.2 kg (148.1 oz.)
Accessories	Power cord \times 1, Instruction manual \times 1, LCR application disc (Communications user manual) \times 1

Measurement accuracy

Measurement accuracy is calculated based on the following equation: **Measurement accuracy = Basic accuracy × C × D × E × F × G**

[C: Level coefficient] V: Setting value (corresponds to when V mode) [V]

Measurement level	1 V		
Coefficient (DC resistance measurement)	1		
Measurement level	0.010 V to 0.999 V	1 V	1.001 V to 5 V
Coefficient (AC measurement)	1+0.2/V	1	1+0.2/V

[D: Measurement speed coefficient]

Measurement speed	FAST	MED	SLOW	SLOW2
Coefficient				
DC resistance measurement	4	3	2	1
AC measurement	8	4	2	1

[E: Measurement cable length coefficient]

Coefficient	0 m	1 m	2 m	4 m
	1	1.5	2	3

Settable range for frequency

0 m: Up to 8 MHz, 1 m: 8 MHz, 2 m: Up to 2 MHz, 4 m: Up to 1MHz

[F: DC bias coefficient]

DC bias coefficient	OFF	ON
Coefficient	1	2

[G: Temperature coefficient]

Operating temperature	t [°C]
Coefficient	1+0.1× t-23

When the operating temperature (t) is 23°C±5°C, use a coefficient of 1.

Basic accuracy

Accuracy is calculated based on coefficients A and B from the basic accuracy chart shown below.

1 kΩ range or higher

100 Ω range or lower

$$\text{Basic accuracy} = \pm \left(A + B \times \left| \frac{10 \times Z_x}{\text{Range}} - 1 \right| \right) \quad \text{Basic accuracy} = \pm \left(A + B \times \left| \frac{\text{Range}}{Z_x} - 1 \right| \right)$$

Zx : Impedance of the measurement conductor

A: Noted in basic accuracy chart. (Upper value: Z accuracy [% rdg.]; lower value: θ accuracy [°])

B: Noted in basic accuracy chart. (Upper value: Z accuracy [% rdg.]; lower value: θ accuracy [°])

A is the accuracy of R when DC (± % rdg.)
B is the coefficient for the resistance of the sample



Free software for calculating accuracy

(LCR application disc)

Automatically calculate measurement accuracy based on user-entered measurement conditions and measurement results. Free download from the Hioki website.

Conditions Temperature and humidity ranges: 23°C ± 5°C, 80% RH or less (no condensation), at least 60 minutes after power ON, after performing open and short compensation

Basic accuracy

Range	Guaranteed accuracy range	DC	4Hz to 99.99Hz	100Hz to 999.99Hz	1kHz to 10kHz	10.001kHz to 100kHz	100.01kHz to 1MHz	1.0001MHz to 8MHz
100MΩ	8MΩ to 200MΩ	A=1 B=1	A=6 B=5 A=5 B=3	A=3 B=2 A=2 B=2	A=3 B=2 A=2 B=2			
10MΩ	800kΩ to 10MΩ	A=0.5 B=0.3	A=0.8 B=1 A=0.8 B=0.5	A=0.5 B=0.3 A=0.4 B=0.2	A=0.5 B=0.3 A=0.4 B=0.2	A=2 B=1 A=2 B=1		
1MΩ	80kΩ to 1MΩ	A=0.2 B=0.1	A=0.4 B=0.08 A=0.3 B=0.08	A=0.3 B=0.05 A=0.2 B=0.02	A=0.3 B=0.05 A=0.2 B=0.02	A=0.5 B=0.1 A=0.6 B=0.1	A=3 B=0.5 A=3 B=0.5	
100kΩ	8kΩ to 100kΩ	A=0.1 B=0.01	A=0.3 B=0.03 A=0.2 B=0.02	A=0.2 B=0.03 A=0.1 B=0.02	A=0.2 B=0.03 A=0.1 B=0.02	A=0.25 B=0.04 A=0.2 B=0.02	A=1 B=0.3 A=1 B=0.3	A=2 B=0.5 A=2 B=0.3
10kΩ	800Ω to 10kΩ	A=0.1 B=0.01	A=0.3 B=0.03 A=0.3 B=0.01	A=0.2 B=0.02 A=0.1 B=0.02	A=0.05 B=0.02 A=0.03 B=0.02	A=0.3 B=0.02 A=0.2 B=0.02	A=0.5 B=0.05 A=0.5 B=0.05	A=2 B=0.5 A=1.5 B=0.3
1kΩ	80Ω to 1kΩ	A=0.1 B=0.01	A=0.3 B=0.02 A=0.2 B=0.02	A=0.2 B=0.02 A=0.1 B=0.02	A=0.2 B=0.02 A=0.1 B=0.02	A=0.2 B=0.02 A=0.15 B=0.02	A=0.4 B=0.02 A=0.4 B=0.02	A=1.5 B=0.2 A=1.5 B=0.2
100Ω	8Ω to 100Ω	A=0.1 B=0.02	A=0.3 B=0.02 A=0.2 B=0.01	A=0.2 B=0.02 A=0.15 B=0.01	A=0.2 B=0.02 A=0.1 B=0.01	A=0.2 B=0.02 A=0.15 B=0.02	A=0.5 B=0.03 A=0.5 B=0.03	A=1.5 B=0.2 A=1.5 B=0.2
10Ω	800mΩ to 10Ω	A=0.2 B=0.15	A=0.5 B=0.1 A=0.3 B=0.1	A=0.4 B=0.05 A=0.3 B=0.03	A=0.4 B=0.05 A=0.3 B=0.03	A=0.4 B=0.05 A=0.3 B=0.03	A=0.8 B=0.1 A=0.5 B=0.05	A=2 B=1.5 A=2 B=1
1Ω	80mΩ to 1Ω	A=0.3 B=0.3	A=1.5 B=1 A=0.8 B=0.5	A=1 B=0.3 A=0.5 B=0.2	A=1 B=0.3 A=0.5 B=0.2	A=1 B=0.3 A=0.5 B=0.2	A=1.5 B=1 A=0.7 B=0.5	A=3 B=3 A=3 B=2
100mΩ	1mΩ to 100mΩ	A=1 B=1	A=8 B=8 A=5 B=4	A=5 B=4 A=3 B=2	A=3 B=2 A=2 B=1.5	A=2 B=2 A=2 B=1.5	A=4 B=3 A=3 B=4	

Method of determining basic accuracy

- Calculate the basic accuracy from the sample impedance, measurement range, and measurement frequency and the corresponding basic accuracy A and coefficient B from the table above.
- The calculation expression to use differs for each of the 1 kΩ range and above and 100 Ω range and below.
- For C and L, obtain basic accuracy A and coefficient B by determining the measurement range from the actual measurement value of impedance or the approximate impedance value calculated with the following expression.

$$Z_x (\Omega) \doteq \omega L (H) \quad (\theta \doteq 90^\circ)$$

$$\doteq \frac{1}{\omega C (F)} \quad (\theta \doteq -90^\circ)$$

$$\doteq R (\Omega) \quad (\theta \doteq 0^\circ) \quad (\omega: 2 \times \pi \times \text{Measurement frequency [Hz]})$$

Calculation example

Impedance Zx of sample: 500 Ω (actual measurement value)

Measurement conditions: When frequency 10 kHz and range 1 kΩ

Insert coefficient A = 0.2 and coefficient B = 0.02 for the Z basic accuracy from the table above into the expression.

$$Z \text{ basic accuracy} = 0.2 + 0.02 \times \left| \frac{10 \times 500}{10^3} - 1 \right| = 0.28 (\pm \% \text{rdg.})$$

Similarly, insert coefficient A = 0.1 and coefficient B = 0.02 for the θ basic accuracy, as follows:

$$\theta \text{ basic accuracy} = 0.1 + 0.02 \times \left| \frac{10 \times 500}{10^3} - 1 \right| = 0.18 (\pm \text{deg.})$$

Guaranteed accuracy measurement level range


The range of measurement levels for which accuracy is guaranteed varies with the setting conditions.

Range	Sample's impedance	DC	4 Hz to 99.99 Hz	100 Hz to 999.99 Hz	1 kHz to 10 kHz	10.001 Hz to 100 kHz	100.01 kHz to 1 MHz	1.0001 MHz to 5 MHz	5.0001 MHz to 8 MHz
100 MΩ	8 MΩ to 200 MΩ	1V (fixed)		0.101 V to 5 V		0.501 V to 5 V			
10 MΩ	10 MΩ to 100 MΩ								
	800 kΩ to 10 MΩ								
1 MΩ	1 MΩ to 10 MΩ								
	80 kΩ to 1 MΩ								
100 kΩ	100 kΩ to 1 MΩ								
	8 kΩ to 100 kΩ								
10 kΩ	10 kΩ to 100 kΩ								
	800 Ω to 10 kΩ								
1 kΩ	1 kΩ to 10 kΩ								
	80 Ω to 1 kΩ								
100 Ω	8 Ω to 100 Ω								
10 Ω	800 mΩ to 10 Ω								
1 Ω	80 mΩ to 1 Ω								
100 mΩ	1 mΩ to 100 mΩ								


The guaranteed accuracy range during DC bias operation is 10 mΩ or greater. The accuracy for DC resistance (Rdc) measurement is guaranteed only when offset values are acquired. The guaranteed accuracy range varies with the sample's impedance.

Measurable ranges

L measurement range

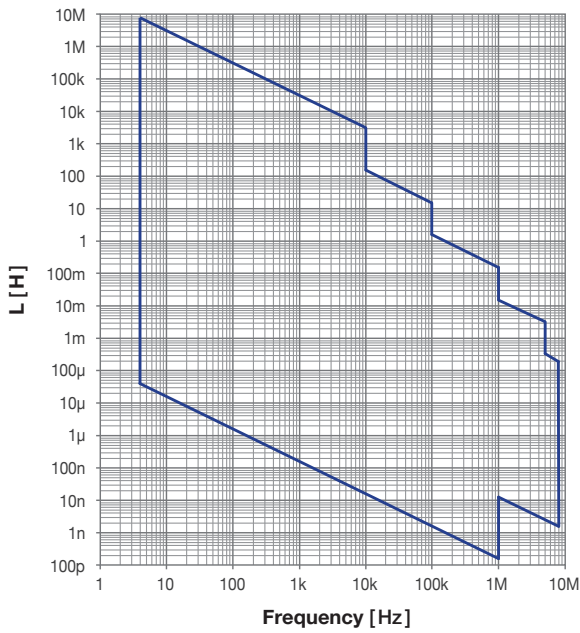

C measurement range

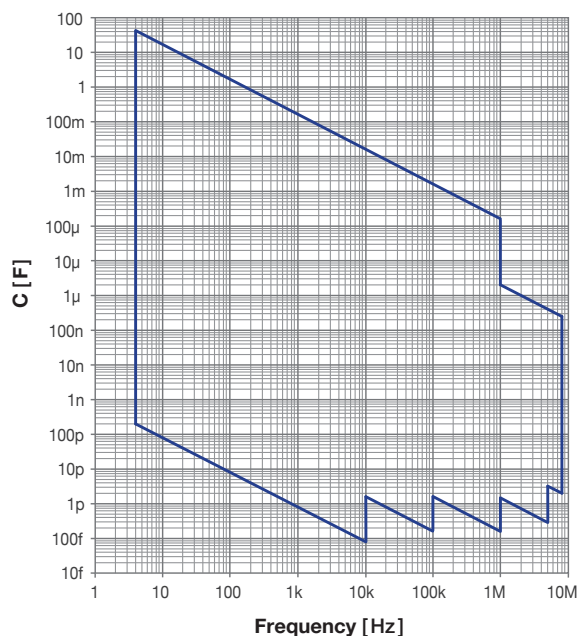

Note: Test fixtures are not supplied with the instrument. Select optional test fixtures or probes when ordering.

LCR METER IM3536

Standard accessories

- Power Cord
- Instruction manual
- LCR Application Disc (Communication commands user manual)




Free software for calculating accuracy (LCR application disc)

Automatically calculate measurement accuracy based on user-entered measurement conditions and measurement results. Free download from the Hioki website.

Options

RS-232C CABLE 9637

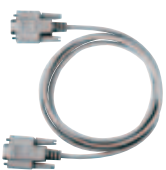

For the PC, 9pin - 9pin, cross, 1.8m (5.91 ft) length

GP-IB CONNECTOR CABLE 9151-02



2 m (6.56 ft) length

DC BIAS VOLTAGE UNIT 9268-10




Measurement frequency range: 40 Hz to 8 MHz
Maximum applied voltage: ±40 V DC

DC BIAS CURRENT UNIT 9269-10



Measurement frequency range: 40 Hz to 2 MHz
Maximum applied current: 2 A DC
* An internal 300μH inductance is connected in parallel to the DUT.

Probes and Test Fixtures for Lead Components

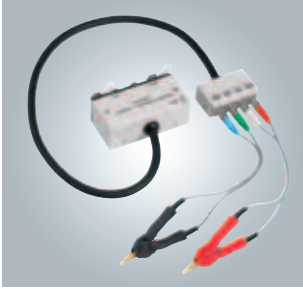

4-TERMINAL PROBE L2000

Measurable range: DC to 8 MHz
 Measurable terminal diameter:
 0.3 mm (0.01 in) to 5 mm (0.2 in)
 Cord length: 1 m (3.28 ft)




TEST FIXTURE 9262

Measurable range: DC to 8 MHz
 Measurable terminal diameter:
 0.3 mm (0.01 in) to 2 mm (0.08 in)
 Direct connection type



4-TERMINAL PROBE 9140-10

Measurable range: DC to 200 kHz
 Measurable terminal diameter:
 0.3 mm (0.01 in) to 5 mm (0.2 in)
 Cord length: 1 m (3.28 ft)

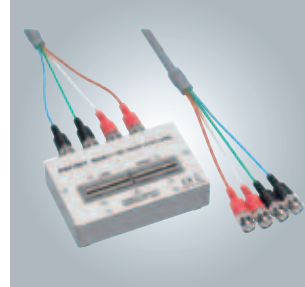

TEST FIXTURE 9261-10

Measurable range: DC to 8 MHz
 Measurable terminal diameter:
 0.3 mm (0.01 in) to 1.5 mm (0.06 in)
 Cord length: 1 m (3.28 ft)



4-TERMINAL PROBE 9500-10

Measurable range: DC to 200 kHz
 Measurable terminal diameter:
 0.3 mm (0.01 in) to 2 mm (0.08 in)
 Cord length: 1 m (3.28 ft)

Test Fixtures for SMDs



PINCHER PROBE L2001

Measurable range: DC to 8 MHz
 Replaceable tips
 Measurable sample sizes:
 IM9901: 0603 to 2220 (EIA)
 1608 to 5750 (JIS)
 IM9902: 0201 to 2220 (EIA)
 0603 to 5750 (JIS)
 Cord length: Approx. 730 mm (28.74 in)
 *Ships standard with one set of IM9901



SMD TEST FIXTURE 9263

Measurable range: DC to 8 MHz
 For SMD with electrodes on side
 Measurable sample sizes:
 0805 to 2220 (EIA)
 2012 to 5750 (JIS)
 Direct connection type



CONTACT TIPS IM9901



CONTACT TIPS IM9902

For more information, please see individual product catalogs.



SMD TEST FIXTURE 9677

Measurable range: DC to 120 MHz
 For SMD with electrodes on side
 Measurable sample sizes:
 0402 to 0603 (EIA)
 1005 to 1608 (JIS)
 Direct connection type

World's First - High Precision 4-Terminal Measurement



SMD TEST FIXTURE IM9100

Measurable range: DC to 8 MHz
 For SMD with electrodes on bottom
 Measurable sample sizes:
 01005 to 0402 (EIA)
 0402 to 1005 (JIS)
 Direct connection type












SMD TEST FIXTURE 9699

Measurable range: DC to 120 MHz
 For SMD with electrodes on bottom
 Measurable sample sizes:
 0608 to 0805 (EIA)
 1608 to 2012 (JIS)
 Direct connection type

For more information, please see individual product catalogs.

LCR Meter Series Full Product Lineup

Model	Measurement speed (Basic value)		Measurement frequency range												
	Applications and measurement object														
LCR METER IM3536		1ms	DC	4Hz									8MHz	General-purpose LCR meter up to 8 MHz Measure electronic components such as capacitors and inductors	
LCR METER IM3533		2ms	DC	1MHz								200kHz	Capable of special measurements of transformers including turn ratio and mutual inductance IM3533-01: High-end model of the IM3523 and IM3533 with sweep measurement		
LCR METER IM3523		2ms	DC	40Hz							200kHz	Extremely cost-effective model suitable for production lines including integration into automated machinery For C-D and ESR measurement of electrolytic capacitors and L-Q and DCR measurement of inductors			
LCR HiTESTER 3511-50		5ms			120Hz	1kHz							Compact LCR meter with single function For production lines of aluminum electrolytic capacitors		
C METER 3506-10		1.5ms					1kHz					1MHz	C meter for low-capacity capacitors For production of MLCC and film capacitors		
C HiTESTER 3504		2ms				120Hz	1kHz							C meter for large-capacity MLCCs For sorting machines of large-capacity MLCCs (3504-50/60) and taping machines (3504-40)	
	3504-40 3504-50 3504-60														
IMPEDANCE ANALYZER IM7580		0.5ms											1MHz	300MHz	High-frequency measurement up to 300 MHz Ideal for production lines of ferrite beads and inductors
IMPEDANCE ANALYZER IM3570		0.5ms	DC	4Hz								5MHz	LCR meter integrated with impedance analyzer Measure the frequency characteristics of piezo-electric devices, functional polymer capacitors, and power inductors		
CHEMICAL IMPEDANCE ANALYZER IM3590		2ms	DC	1MHz							200kHz	Supports LCR impedance measurements for Cole-Cole plots and equivalent-circuit analyses Measure electrochemical components, materials, batteries, and electric double-layer capacitors (EDLCs)			

Note: Company names and Product names appearing in this catalog are trademarks or registered trademarks of various companies.

HIOKI

HIOKI E. E. CORPORATION

HEADQUARTERS

81 Koizumi, Ueda, Nagano, 386-1192, Japan
TEL +81-268-28-0562 FAX +81-268-28-0568
http://www.hioki.com / E-mail: os-com@hioki.co.jp

HIOKI USA CORPORATION

TEL +1-609-409-9109 FAX +1-609-409-9108
http://www.hiokiusa.com / E-mail: hioki@hiokiusa.com

HIOKI (Shanghai) SALES & TRADING CO., LTD.
TEL +86-21-63910090 FAX +86-21-63910360
http://www.hioki.cn / E-mail: info@hioki.com.cn

DISTRIBUTED BY

HIOKI INDIA PRIVATE LIMITED
TEL +91-124-6590210 FAX +91-124-6460113
E-mail: hioki@hioki.in

HIOKI SINGAPORE PTE. LTD.
TEL +65-6634-7677 FAX +65-6634-7477
E-mail: info-sg@hioki.com.sg

HIOKI KOREA CO., LTD.
TEL +82-42-936-1281 FAX +82-42-936-1284
E-mail: info-kr@hioki.co.jp